



# OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>

Machine Id  
**EPIROC MT65 TRK 219**  
 Component  
**Rear Differential**  
 Fluid  
**PENNZOIL SYNTHETIC SAE 75W140 GL-5 (--- GAL)**

## RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>WC0883871</b>	WC0883826	WC0848146
Sample Date		Client Info		<b>18 Jan 2024</b>	05 Dec 2023	27 Sep 2023
Machine Age	hrs	Client Info		<b>7736</b>	7425	6884
Oil Age	hrs	Client Info		<b>0</b>	500	500
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Not Changed</b>	Not Changed	Not Changed
Filter Changed		Client Info		<b>Not Changed</b>	Not Changed	N/A
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

## WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>500	<b>35</b>	27	26
Chromium	ppm	ASTM D5185(m)	>10	<b>0</b>	0	0
Nickel	ppm	ASTM D5185(m)	>10	<b>&lt;1</b>	<1	<1
Titanium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)		<b>0</b>	<1	<1
Aluminum	ppm	ASTM D5185(m)	>25	<b>&lt;1</b>	0	<1
Lead	ppm	ASTM D5185(m)	>25	<b>0</b>	<1	<1
Copper	ppm	ASTM D5185(m)	>100	<b>&lt;1</b>	<1	1
Tin	ppm	ASTM D5185(m)	>10	<b>0</b>	0	0
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
White Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE

## CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>75	<b>2</b>	3	4
Potassium	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	1	2
Water		WC Method	>.2	<b>NEG</b>	NEG	NEG
Silt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	NONE	VLITE
Appearance	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	Visual*	>.2	<b>NEG</b>	NEG	NEG

## FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		<b>&lt;1</b>	2	2
Boron	ppm	ASTM D5185(m)		<b>88</b>	92	87
Barium	ppm	ASTM D5185(m)		<b>0</b>	<1	<1
Molybdenum	ppm	ASTM D5185(m)		<b>0</b>	0	0
Manganese	ppm	ASTM D5185(m)		<b>0</b>	0	0
Magnesium	ppm	ASTM D5185(m)		<b>&lt;1</b>	<1	1
Calcium	ppm	ASTM D5185(m)		<b>6</b>	5	6
Phosphorus	ppm	ASTM D5185(m)		<b>850</b>	835	844
Zinc	ppm	ASTM D5185(m)		<b>4</b>	4	5
Sulfur	ppm	ASTM D5185(m)		<b>18885</b>	18896	18750
Visc @ 40°C	cSt	ASTM D7279(m)	175	<b>178</b>	178	177

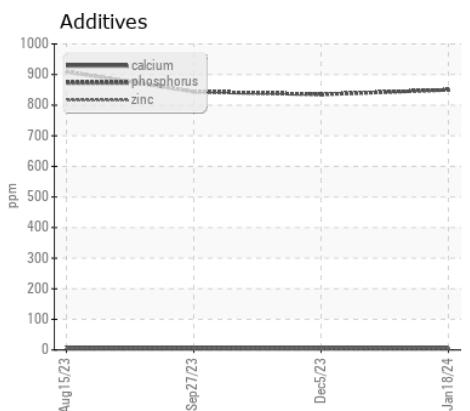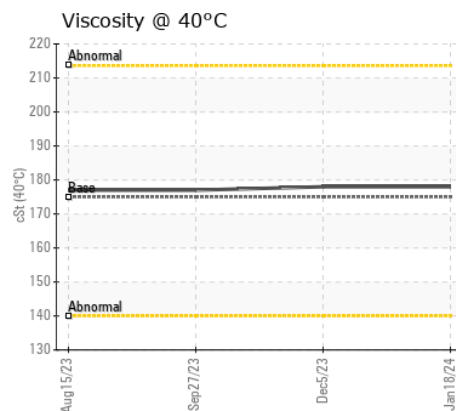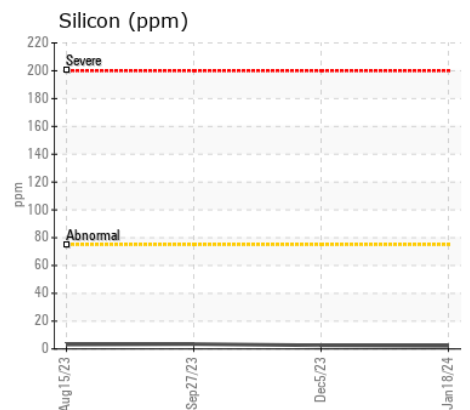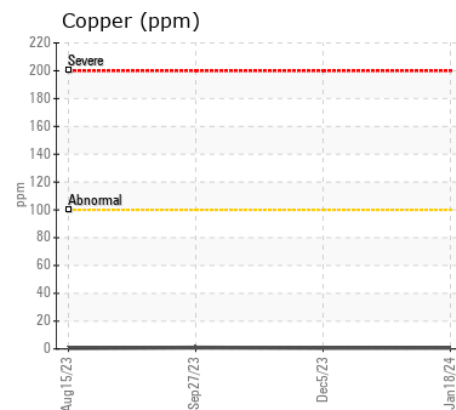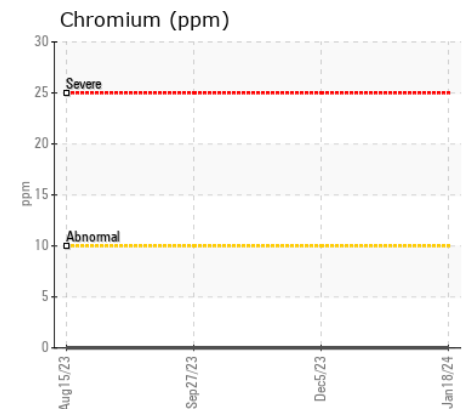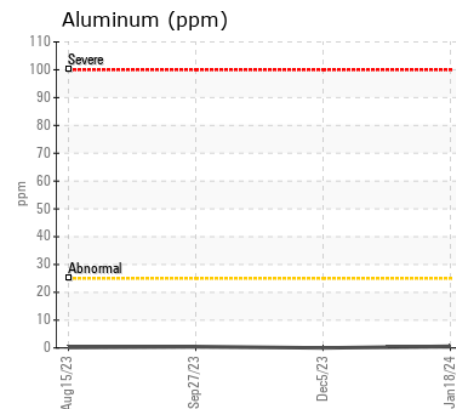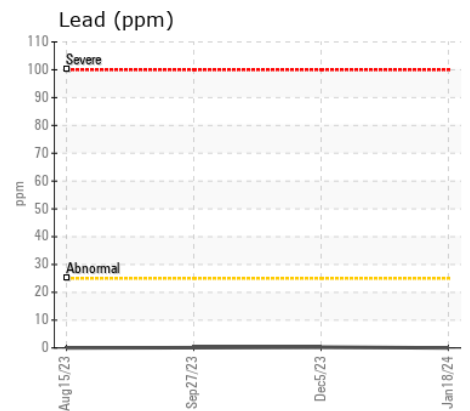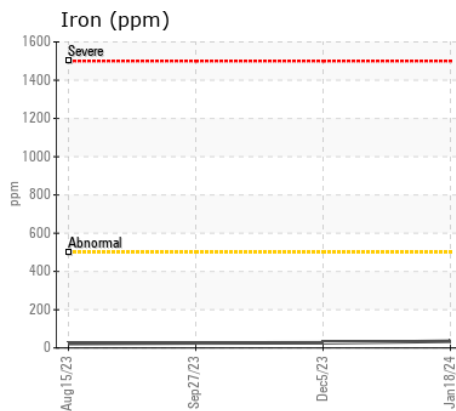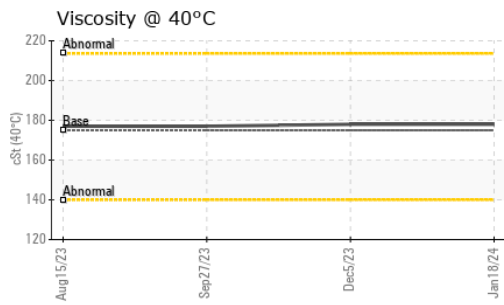

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : WC0883871 **Received** : 23 Jan 2024  
**Lab Number** : 02610704 **Diagnosed** : 23 Jan 2024  
**Unique Number** : 5711790 **Diagnostician** : Wes Davis  
**Test Package** : MOB 1

**Agnico Eagle Canada**  
 1350 Government Rd. W, MACASSA COMPLEX  
 Kirkland Lake, ON  
 CA P2N 3J1  
 Contact: Mike Campbell  
 mike.campbell@agnicoeagle.com  
 T: (705)567-5208  
 F: (705)567-5221

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.