
WEAR CONTAMINATION **FLUID CONDITION**

NORMAL NORMAL NORMAL

Machine Id **423009**

Component Hydraulic System

PETRO CANADA HYDREX MV 32 (GAL)							
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor. Please contact your representative for information regarding the proper sampling kits for your service. NOTE: We recommend using MOB 2 test kits, this testkit includes Particle Count to determine the ISO cleanliness of the fluid.	Sample Number		Client Info		GFL0098014		
	Sample Date		Client Info		31 Jan 2024		
	Machine Age	hrs	Client Info		14106		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Not Changd		
	Filter Changed		Client Info		Not Changd		
	Sample Status				NORMAL		
WEAD							
WEAR All component wear rates are normal.	Iron	ppm	ASTM D5185(m)		9		
	Chromium	ppm	ASTM D5185(m)		<1		
	Nickel	ppm	ASTM D5185(m)	>10	<1		
	Titanium	ppm	ASTM D5185(m)		0		
	Silver	ppm	ASTM D5185(m)		0		
	Aluminum	ppm	ASTM D5185(m)		2		
	Lead	ppm	ASTM D5185(m)	>10	<1		
	Copper	ppm	, ,	>75	1		
	Tin	ppm	. ,	>10	0		
	Vanadium	ppm	ASTM D5185(m)		0		
	White Metal	scalar	Visual*	NONE	NONE		
	Yellow Metal	scalar	Visual*	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185(m)	>20	6		
There is no indication of any contamination in the component(unconfirmed).	Potassium	ppm	ASTM D5185(m)	>20	1		
	Water			>0.1	NEG		
	Silt	scalar	Visual*	NONE	NONE		
	Debris	scalar	Visual*	NONE	NONE		
	Sand/Dirt	scalar	Visual*	NONE	NONE		
	Appearance	scalar	Visual*	NORML	NORML		
	Odor	scalar	Visual*	NORML	NORML		
	Emulsified Water	scalar	Visual*	>0.1	NEG		
FLUID CONDITION	Sodium	nnm	ASTM D5185(m)		<1		
	Boron	ppm	ASTM D5185(m)	0	<1		
The condition of the oil is acceptable for the time in service.	Barium	ppm	ASTM D5185(m)		0		
	Molybdenum	ppm	ASTM D5185(m)		0		
	Manganese	ppm	ASTM D5185(m)		0		
	Magnesium	ppm	ASTM D5185(m)		8		
	Calcium	ppm	ASTM D5185(m)	50	66		
	Phosphorus	ppm	ASTM D5185(m)	330	333		
	Zinc	ppm	ASTM D5185(m)	430	407		
	Sulfur	ppm	ASTM D5185(m)	760	1291		
	Visc @ 40°C	cSt	ASTM D7279(m)	31.9	35.3		
Report Id: GEI 593 [WCAMIS] 02615980 (Generated: 02/15/2024 14:36:09) Rev: 1					tact/Location		#i - GEI 503

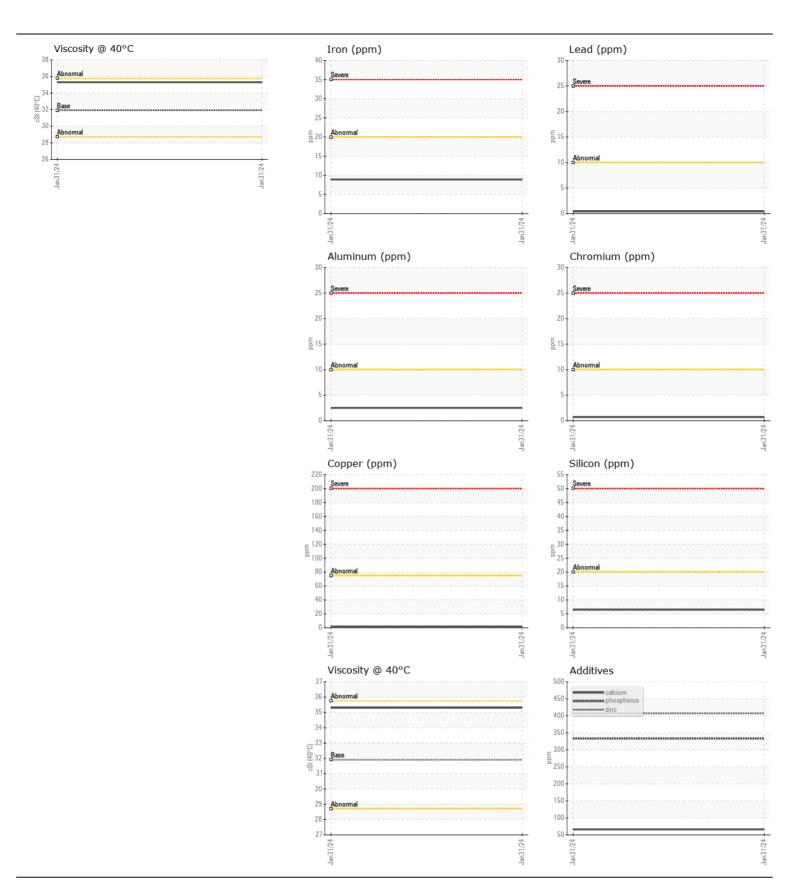





Laboratory Sample No.

: GFL0098014 Lab Number : 02615980 Unique Number : 5733090 Test Package : MOB 1

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Received : 15 Feb 2024 **Tested** : 15 Feb 2024

Diagnosed : 15 Feb 2024 - Wes Davis

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

GFL Environmental - 593 4421 Boban Drive Nanaimo, BC **CA V9T 6A6** Contact: Patrick Rutti prutti@gflenv.com T: (250)739-3345

Report Id: GFL593 [WCAMIS] 02615980 (Generated: 02/15/2024 14:36:11) Rev: 1