



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	ABNORMAL
FLUID CONDITION	NORMAL

Area
[413228654]

Machine Id
1000029345

Component
Hydraulic System

Fluid
TOTAL FINA NEVASTANE FG AW 46 (--- GAL)

RECOMMENDATION

We recommend you service the filters on this component. We recommend an early resample to monitor this condition. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		WC0892341	WC0881693	WC0828644
Sample Date		Client Info		16 Feb 2024	24 Nov 2023	17 Aug 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Filter Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Filter Changed		Client Info		N/A	N/A	N/A
Sample Status				ABNORMAL	ABNORMAL	ABNORMAL

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>20	2	1	1
Chromium	ppm	ASTM D5185(m)	>20	0	0	0
Nickel	ppm	ASTM D5185(m)	>20	0	<1	0
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)		0	<1	0
Aluminum	ppm	ASTM D5185(m)	>20	<1	0	<1
Lead	ppm	ASTM D5185(m)	>20	0	0	<1
Copper	ppm	ASTM D5185(m)	>20	3	3	5
Tin	ppm	ASTM D5185(m)	>20	0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
White Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE

CONTAMINATION










There is a moderate amount of silt (particulates < 14 microns in size) present in the oil.

Silicon	ppm	ASTM D5185(m)	>15	4	4	4
Potassium	ppm	ASTM D5185(m)	>20	<1	0	<1
Water		WC Method	>0.05	NEG	NEG	NEG
Particles >4µm		ASTM D7647	>5000	▲ 12632	▲ 6694	▲ 9690
Particles >6µm		ASTM D7647	>1300	▲ 4006	▲ 2691	▲ 3667
Particles >14µm		ASTM D7647	>160	▲ 286	▲ 425	▲ 639
Particles >21µm		ASTM D7647	>40	51	▲ 138	▲ 226
Particles >38µm		ASTM D7647	>10	3	14	12
Particles >71µm		ASTM D7647	>3	1	1	0
Oil Cleanliness		ISO 4406 (c)	>19/17/14	▲ 21/19/15	▲ 20/19/16	▲ 20/19/16
Silt	scalar	Visual*	NONE	NONE	NONE	VLITE
Debris	scalar	Visual*	NONE	NONE	VLITE	NONE
Sand/Dirt	scalar	Visual*	NONE	VLITE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.05	NEG	NEG	NEG

FLUID CONDITION

The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

Sodium	ppm	ASTM D5185(m)		0	<1	0
Boron	ppm	ASTM D5185(m)		0	<1	<1
Barium	ppm	ASTM D5185(m)		0	<1	0
Molybdenum	ppm	ASTM D5185(m)		0	0	0
Manganese	ppm	ASTM D5185(m)		0	0	0
Magnesium	ppm	ASTM D5185(m)		0	0	0
Calcium	ppm	ASTM D5185(m)		<1	<1	<1
Phosphorus	ppm	ASTM D5185(m)		186	180	201
Zinc	ppm	ASTM D5185(m)		31	29	31
Sulfur	ppm	ASTM D5185(m)		695	634	659
Acid Number (AN)	mg KOH/g	ASTM D974*		0.23	0.23	0.23
Visc @ 40°C	cSt	ASTM D7279(m)	46	44.7	44.8	44.6

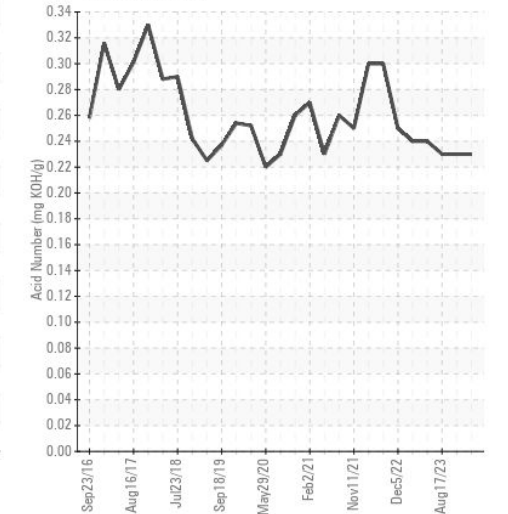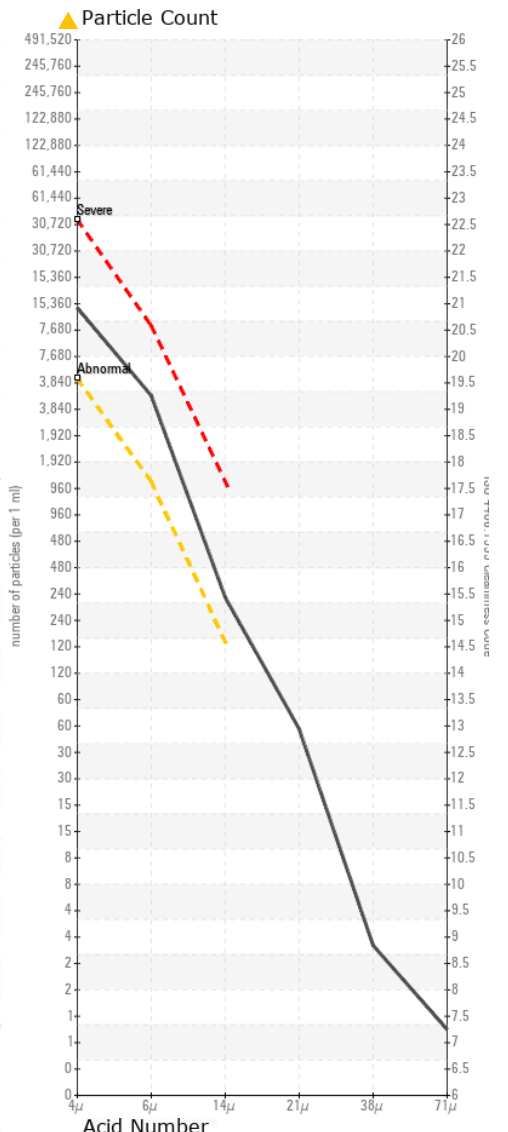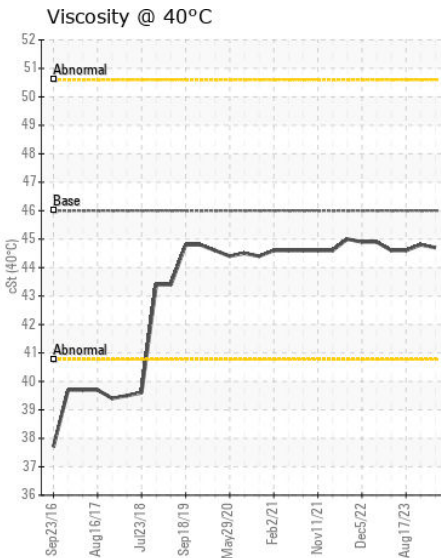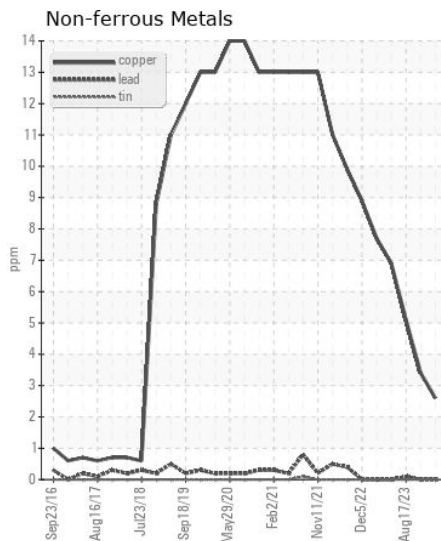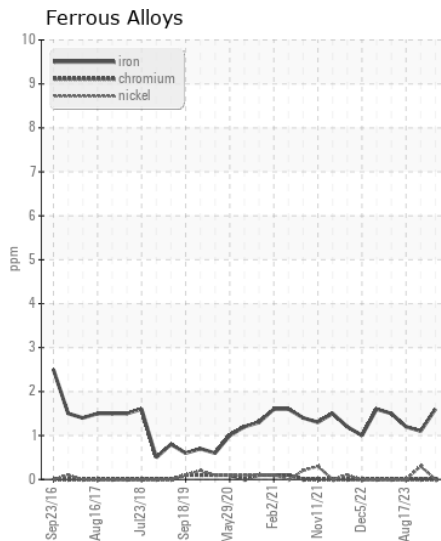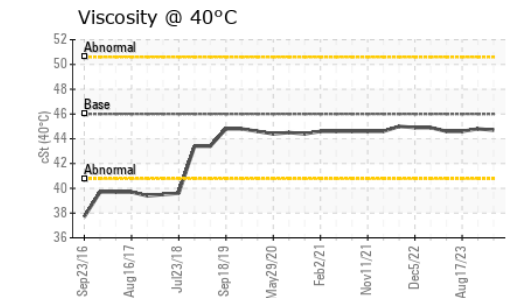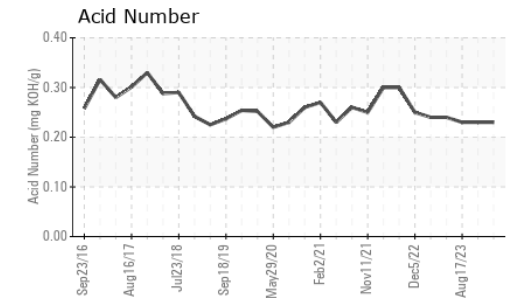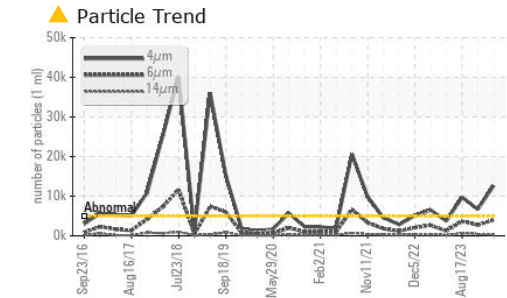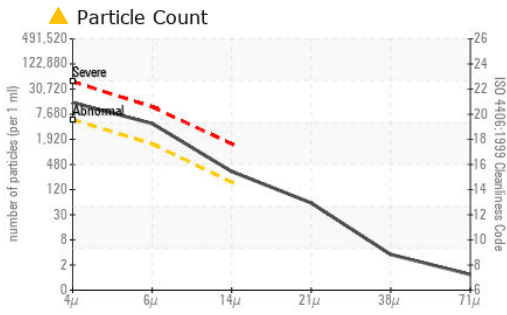

ISO 17025:2017
Accredited
Laboratory

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0892341
Lab Number : 02617259
Unique Number : 5734369
Test Package : IND 2

Received : 21 Feb 2024
Tested : 23 Feb 2024
Diagnosed : 23 Feb 2024 - Wes Davis

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

Cargill Meat Solutions
 165 Dunlop Drive
 Guelph, ON
 CA N1L 1P4

Contact: Jakub Posluszny
 jakub_posluszny@cargill.com
 T: (519)823-5200
 F: (519)823-5893