WEAR CONTAMINATION FLUID CONDITION

NORMAL NORMAL


Area

[42881538]

1381M

Component Diesel Engine

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		WC0737699		
	Sample Date		Client Info		11 Jan 2024		
	Machine Age	kms	Client Info		29735		
	Oil Age	kms	Client Info		3000		
	Filter Age	kms	Client Info		3000		
	Oil Changed		Client Info		Changed		
	Filter Changed		Client Info		Changed		
	Sample Status				NORMAL		
VEAR	lvan		ACTM DE10E/m)	. 00	45		
	Iron Chromium	ppm	ASTM D5185(m)		15 0		
Metal levels are typical for a new component breaking in.	Nickel	ppm	ASTM D5185(m) ASTM D5185(m)		<1		
	Titanium	ppm	ASTM D5185(m)		0		
	Silver	ppm	ASTM D5185(m)	>2 >2	0		
	Aluminum	ppm	ASTM D5185(m)		3		
	Lead	ppm	ASTM D5185(m)	>40	<1		
	Copper	ppm	ASTM D5185(m)		<1		
	Tin	ppm	ASTM D5185(m)		0		
	Vanadium	ppm	ASTM D5185(m)	7.0	0		
CONTAMINATION	Silicon	ppm	ASTM D5185(m)	>25	5		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185(m)	>20	4		
	Fuel		WC Method	>3.0	<1.0		
	Water		WC Method	>0.2	NEG		
	Glycol		WC Method		NEG		
	Soot %	%	ASTM D7844*	>6	0		
	Nitration	Abs/cm	ASTM D7624*	>20	9.7		
	Sulfation	Abs/.1mm	ASTM D7415*	>30	21.4		
	Emulsified Water	scalar	Visual*	>0.2	NEG		
LUID CONDITION	Sodium	ppm	ASTM D5185(m)		2		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185(m)		52		
	Barium	ppm	ASTM D5185(m)		0		
	Molybdenum	ppm	ASTM D5185(m)		7		
	Manganese	ppm	ASTM D5185(m)		0		
	Magnesium	ppm	ASTM D5185(m)		725		
	Calcium	ppm	ASTM D5185(m)		1371		
	Phosphorus	ppm	ASTM D5185(m)	1260	717		
	Zinc	ppm	ASTM D5185(m)	1400	788		
	Sulfur	ppm	ASTM D5185(m)		2679		
	Oxidation	Abs/.1mm	ASTM D7414*	>25	17.7		
	Visc @ 100°C	cSt	ASTM D7279(m)	11.1	11.4		

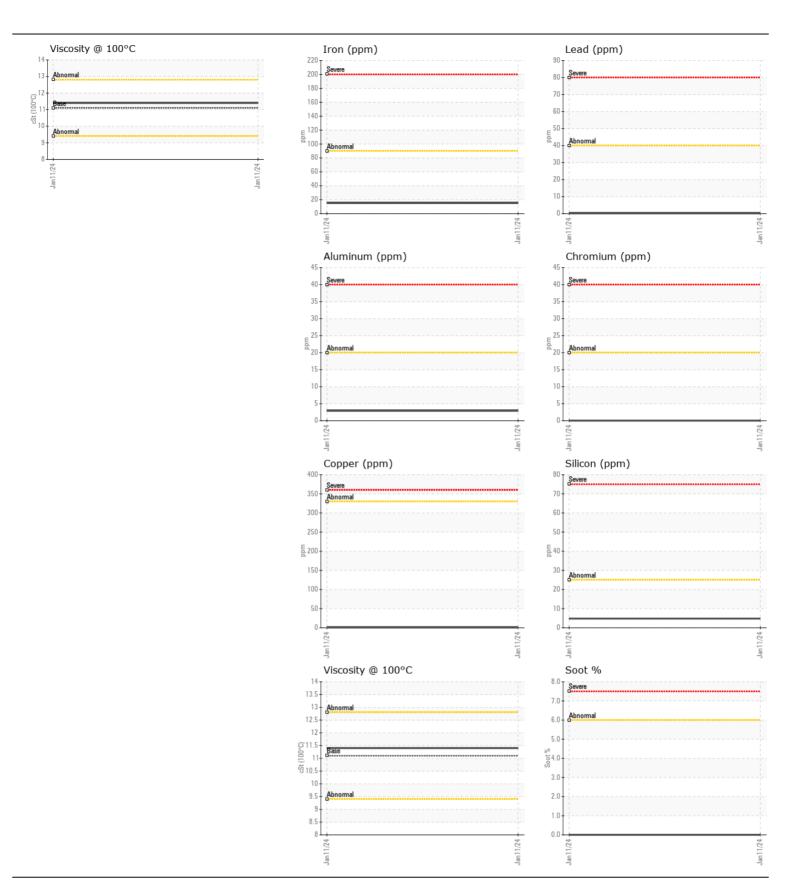



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No.

: WC0737699 Lab Number : 02617352 Unique Number : 5734462 Test Package : MOB 1

Received **Tested** 

Diagnosed

: 22 Feb 2024 : 22 Feb 2024 : 22 Feb 2024 - Wes Davis

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 RUSH TRUCK CENTRES OF CANADA 1750 MCCONNELL AVE CORNWALL, ON

CA K6H 5V3 Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-268-2131.

cornwallservice@rushtruckcentres.ca T:

Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

F: