

Machine Id  
**OR904**  
Component  
**Diesel Engine**  
Fluid  
**PETRO CANADA DURON UHP 5W40 (13 LTR)**

**RECOMMENDATION**

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>PC0078308</b>	PC0064776	PC0059103
Sample Date		Client Info		<b>20 Feb 2024</b>	06 Sep 2022	09 Feb 2022
Machine Age	hrs	Client Info		<b>5555</b>	4676	4645
Oil Age	hrs	Client Info		<b>0</b>	0	0
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Changed</b>	Changed	N/A
Filter Changed		Client Info		<b>Changed</b>	Changed	N/A
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

**WEAR**

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>100	<b>12</b>	17	18
Chromium	ppm	ASTM D5185(m)	>20	<b>1</b>	2	2
Nickel	ppm	ASTM D5185(m)	>4	<b>&lt;1</b>	0	<1
Titanium	ppm	ASTM D5185(m)		<b>0</b>	<1	0
Silver	ppm	ASTM D5185(m)	>3	<b>0</b>	0	0
Aluminum	ppm	ASTM D5185(m)	>20	<b>3</b>	4	4
Lead	ppm	ASTM D5185(m)	>40	<b>&lt;1</b>	<1	<1
Copper	ppm	ASTM D5185(m)	>330	<b>2</b>	4	4
Tin	ppm	ASTM D5185(m)	>15	<b>&lt;1</b>	<1	<1
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
White Metal	scalar	Visual*	NONE	<b>NONE</b>	---	VLITE
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	---	VLITE

**CONTAMINATION**











There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>25	<b>5</b>	7	7
Potassium	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	<1	<1
Fuel		WC Method	>5	<b>&lt;1.0</b>	<1.0	<1.0
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Glycol		WC Method		<b>NEG</b>	NEG	NEG
Soot %	%	ASTM D7844*	>3	<b>0</b>	0	0
Nitration	Abs/cm	ASTM D7624*	>20	<b>11.9</b>	11.7	11.3
Sulfation	Abs/.1mm	ASTM D7415*	>30	<b>21.4</b>	21.8	21.1
Silt	scalar	Visual*	NONE	<b>NONE</b>	---	NONE
Debris	scalar	Visual*	NONE	<b>NONE</b>	---	VLITE
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	---	NONE
Appearance	scalar	Visual*	NORML	<b>NORML</b>	---	NORML
Odor	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	Visual*	>0.2	<b>NEG</b>	NEG	NEG

**FLUID CONDITION**

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		<b>4</b>	5	4
Boron	ppm	ASTM D5185(m)	65	<b>33</b>	44	51
Barium	ppm	ASTM D5185(m)	0	<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185(m)	65	<b>56</b>	53	55
Manganese	ppm	ASTM D5185(m)	0	<b>0</b>	<1	<1
Magnesium	ppm	ASTM D5185(m)	1160	<b>1034</b>	1030	1125
Calcium	ppm	ASTM D5185(m)	820	<b>794</b>	796	803
Phosphorus	ppm	ASTM D5185(m)	1160	<b>921</b>	1017	1024
Zinc	ppm	ASTM D5185(m)	1260	<b>1101</b>	1117	1196
Sulfur	ppm	ASTM D5185(m)	3000	<b>2776</b>	2638	2735
Oxidation	Abs/.1mm	ASTM D7414*	>25	<b>22.7</b>	20.8	20.7
Visc @ 40°C	cSt	ASTM D7279(m)	95.1	<b>79.8</b>	76.5	80.2
Visc @ 100°C	cSt	ASTM D7279(m)	14.3	<b>13.2</b>	12.6	12.9
Viscosity Index (VI)	Scale	ASTM D2270*	169	<b>167</b>	164	161

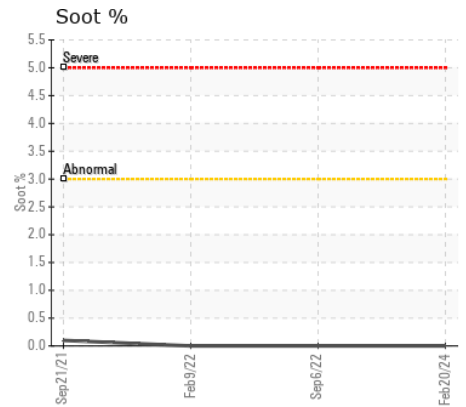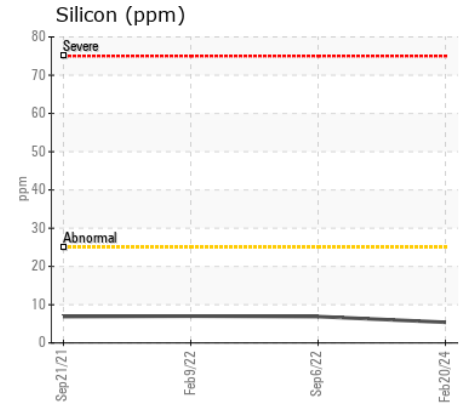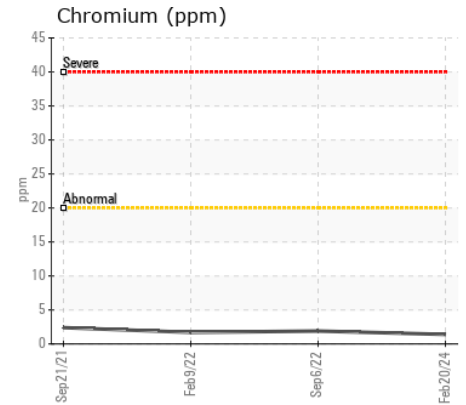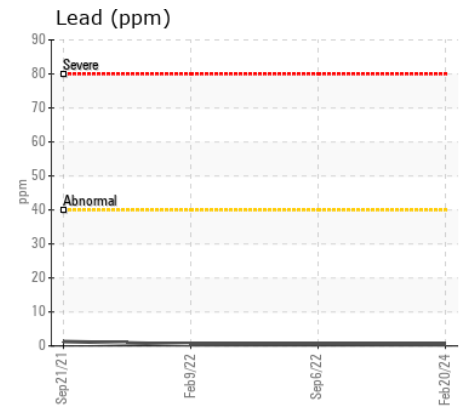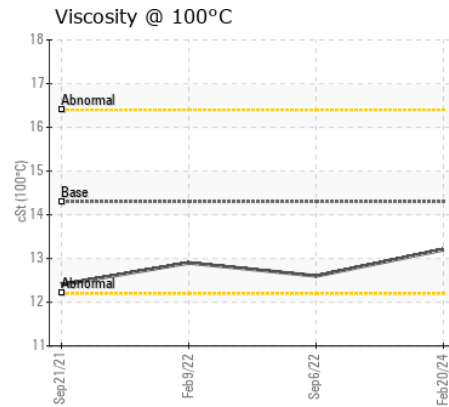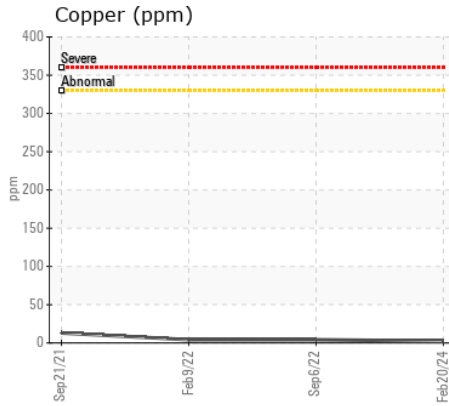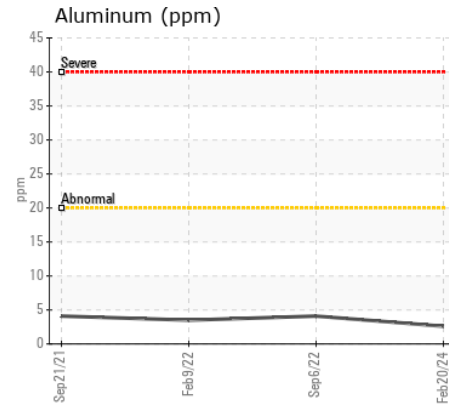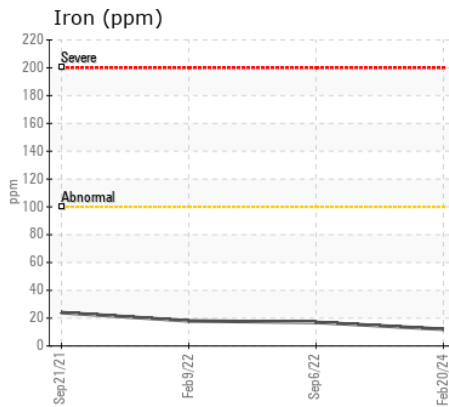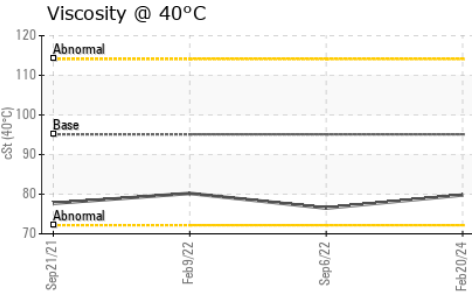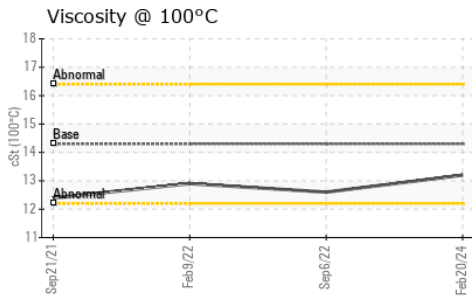

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : PC0078308  
**Lab Number** : 02617400  
**Unique Number** : 5734510  
**Test Package** : MOB 1 ( Additional Tests: KV40, VI, Visual )  
**Received** : 22 Feb 2024  
**Tested** : 22 Feb 2024  
**Diagnosed** : 22 Feb 2024 - Wes Davis

Green Infrastructure and Partners Inc (GIPI) - 286 - Shoring & Foundations  
 151 Ram Forest Rd,  
 Stouffville, ON  
 CA L4A 2G8  
 Contact: Bill Acton  
 bacton@gipi.com

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.

T:  
F: