



# LIEBHERR

## OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Machine Id  
**096750-1204**

Component  
**Front Right Wheel Hub**

Fluid  
**PETRO CANADA TRAXON 75W90 SYNTHETIC (--- GAL)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>LH0285137</b>	LH0203119	LH0251706
Sample Date		Client Info		<b>05 Feb 2024</b>	02 May 2023	30 Jan 2023
Machine Age	hrs	Client Info		<b>10945</b>	9957	9461
Oil Age	hrs	Client Info		<b>0</b>	0	0
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Changed</b>	Changed	Changed
Filter Changed		Client Info		<b>N/A</b>	N/A	N/A
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

### WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>650	<b>42</b>	41	37
Chromium	ppm	ASTM D5185(m)	>4	<b>0</b>	0	0
Nickel	ppm	ASTM D5185(m)	>4	<b>&lt;1</b>	<1	0
Titanium	ppm	ASTM D5185(m)	>4	<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)		<b>0</b>	0	0
Aluminum	ppm	ASTM D5185(m)	>25	<b>&lt;1</b>	<1	0
Lead	ppm	ASTM D5185(m)	>4	<b>&lt;1</b>	0	0
Copper	ppm	ASTM D5185(m)	>60	<b>2</b>	1	2
Tin	ppm	ASTM D5185(m)	>4	<b>0</b>	0	0
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
White Metal	scalar	Visual*	NONE	<b>VLITE</b>	VLITE	VLITE
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE

### CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>75	<b>1</b>	1	2
Potassium	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	<1	0
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Silt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	Visual*	>0.2	<b>NEG</b>	NEG	NEG

### FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		<b>&lt;1</b>	1	1
Boron	ppm	ASTM D5185(m)	328	<b>190</b>	123	225
Barium	ppm	ASTM D5185(m)	1	<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185(m)		<b>0</b>	0	0
Manganese	ppm	ASTM D5185(m)		<b>0</b>	<1	<1
Magnesium	ppm	ASTM D5185(m)	1	<b>1</b>	<1	<1
Calcium	ppm	ASTM D5185(m)	7	<b>5</b>	3	4
Phosphorus	ppm	ASTM D5185(m)	1145	<b>1703</b>	2055	1631
Zinc	ppm	ASTM D5185(m)	3	<b>8</b>	6	8
Sulfur	ppm	ASTM D5185(m)	17909	<b>23098</b>	24733	23921
Visc @ 40°C	cSt	ASTM D7279(m)	99.6	<b>120</b>	135	109

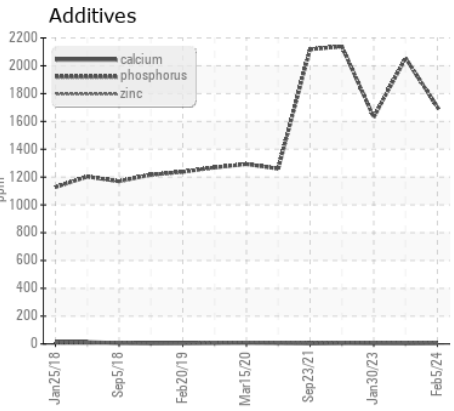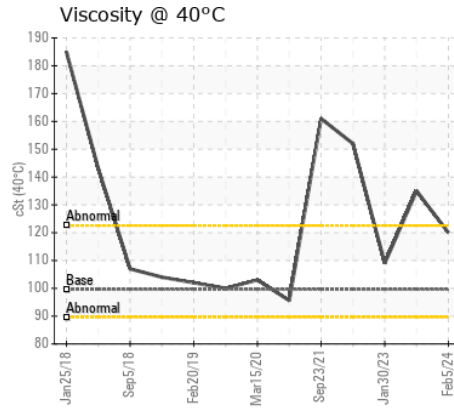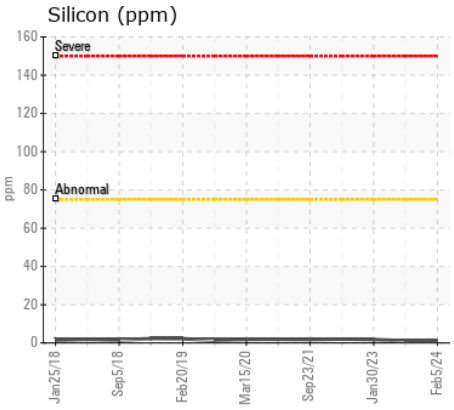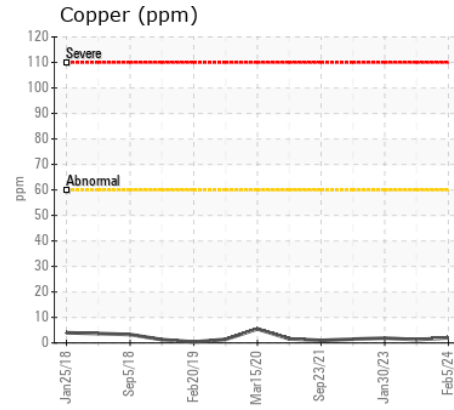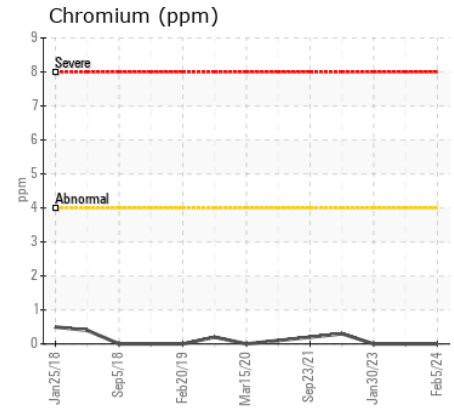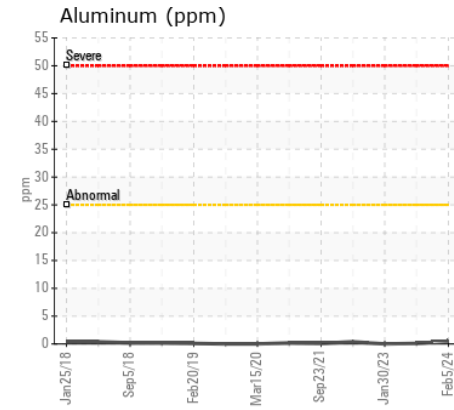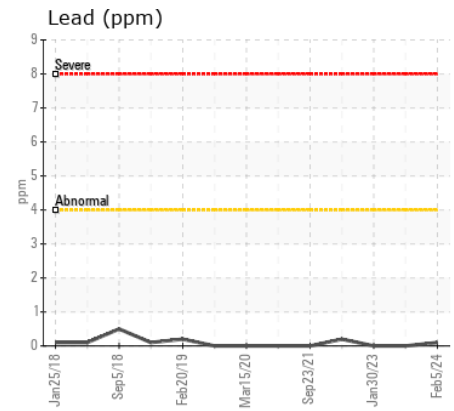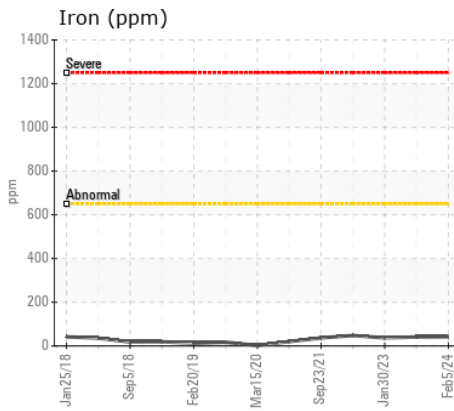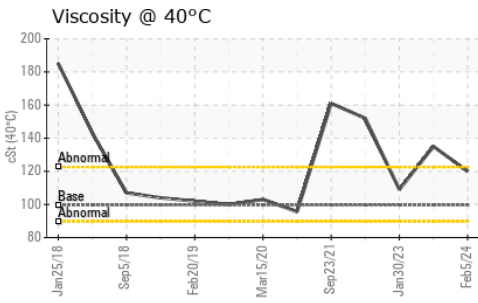

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : LH0285137  
**Lab Number** : 02617486  
**Unique Number** : 5734596  
**Test Package** : MOB 1  
**Received** : 22 Feb 2024  
**Tested** : 22 Feb 2024  
**Diagnosed** : 22 Feb 2024 - Wes Davis

**American Iron and Metal**  
 120 Bentley Avenue  
 Ottawa, ON  
 CA K2E 6T9  
 Contact: Yvon Lalonde

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.

T: (819)230-7247  
 F: