

**OIL ANALYSIS REPORT** 

WEAR CONTAMINATION FLUID CONDITION

NORMAL NORMAL


Area

## (CGAMI) PERIMETER AVIATION [52991] Machine Id [CGAMI] FAIRCHILD SA227 P-44301C (S/N AC587)

1 Jet Turbine

EASTMAN TURBO OIL 2380 (--- GAL)

IDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
	Sample Number		Client Info		GT57535	GT57288	GT57299
	Sample Date		Client Info		14 Feb 2024	19 Jan 2024	05 Dec 2023
	Machine Age	hrs	Client Info		0	0	0
	Oil Age	hrs	Client Info		104	12	812
	Filter Age	hrs	Client Info		92	93	100
	Oil Changed		Client Info		N/A	N/A	N/A
	Filter Changed		Client Info		N/A	N/A	N/A
	 Sample Status				<b></b>		
	Iron	ppm	ASTM D5185(m)	>8	0	<1	<1
	Chromium	ppm	ASTM D5185(m)	>2	0	0	0
	Nickel	ppm	ASTM D5185(m)	>2	0	0	0
	Silver	ppm	ASTM D5185(m)	>2	0	0	0
	Aluminum	ppm	ASTM D5185(m)	>2	<1	<1	<1
	Lead	ppm	ASTM D5185(m)	>3	<1	<1	<1
	Copper	ppm	ASTM D5185(m)	>3	0	0	0
	Water		WC Method	>0.1	NEG	NEG	NEG
	Magnesium	ppm	ASTM D5185(m)	0	0	0	0
	Acid Number (AN)	mg KOH/g	ASTM D974*	0.43	0.75	0.69	1.14

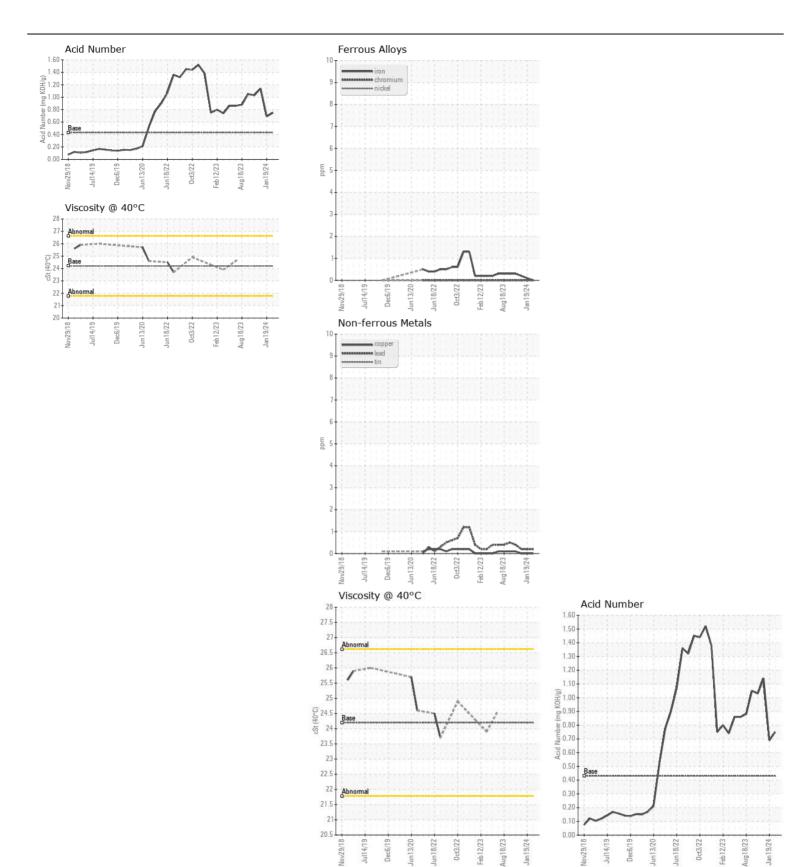





Laboratory Sample No.

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : GT57535 Lab Number : 02617559 Unique Number : 5734669

Received Tested

Diagnosed Test Package : G331 ( Additional Tests: ICP )

: 22 Feb 2024

**Honeywell Engines** 

111 S. 34th Street, 301 Receiving, Attn: SOAP Program PHOENIX, AZ US 85034 Contact: GARRETT

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

Validity of results and interpretation are based on the sample and information as supplied.

F: (602)365-2676