



# LIEBHERR

## OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Machine Id  
**LIEBHERR LH40M 112208-1215**  
Component  
**Front Differential**  
Fluid  
**PETRO CANADA TRAXON SYNTHETIC 75W90 (27 LTR)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>LH0278760</b>	LH0256579	LH0193032
Sample Date		Client Info		<b>22 Feb 2024</b>	22 Mar 2023	13 Jul 2021
Machine Age	hrs	Client Info		<b>12935</b>	11044	6336
Oil Age	hrs	Client Info		<b>0</b>	0	0
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Changed</b>	Changed	Changed
Filter Changed		Client Info		<b>None</b>	None	None
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

### WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>150	<b>2</b>	2	3
Chromium	ppm	ASTM D5185(m)	>5	<b>0</b>	0	0
Nickel	ppm	ASTM D5185(m)	>10	<b>&lt;1</b>	0	<1
Titanium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)		<b>0</b>	0	<1
Aluminum	ppm	ASTM D5185(m)	>5	<b>&lt;1</b>	<1	0
Lead	ppm	ASTM D5185(m)	>5	<b>0</b>	0	0
Copper	ppm	ASTM D5185(m)	>125	<b>7</b>	4	4
Tin	ppm	ASTM D5185(m)	>5	<b>0</b>	0	0
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
White Metal	scalar	Visual*	NONE	<b>NONE</b>	VLITE	NONE
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE

### CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>20	<b>1</b>	2	<1
Potassium	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	0	<1
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Silt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	Visual*	NONE	<b>NONE</b>	NONE	VLITE
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	Visual*	>0.2	<b>NEG</b>	NEG	NEG

### FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		<b>&lt;1</b>	0	3
Boron	ppm	ASTM D5185(m)	328	<b>118</b>	308	21
Barium	ppm	ASTM D5185(m)	1	<b>0</b>	0	<1
Molybdenum	ppm	ASTM D5185(m)		<b>0</b>	<1	0
Manganese	ppm	ASTM D5185(m)		<b>0</b>	<1	<1
Magnesium	ppm	ASTM D5185(m)	1	<b>&lt;1</b>	4	0
Calcium	ppm	ASTM D5185(m)	7	<b>4</b>	14	5
Phosphorus	ppm	ASTM D5185(m)	1145	<b>958</b>	1336	2223
Zinc	ppm	ASTM D5185(m)	3	<b>10</b>	18	6
Sulfur	ppm	ASTM D5185(m)	17909	<b>20896</b>	21228	25368
Visc @ 40°C	cSt	ASTM D7279(m)	99.6	<b>95.7</b>	106	185

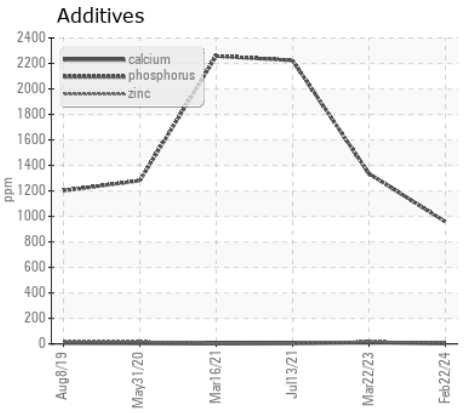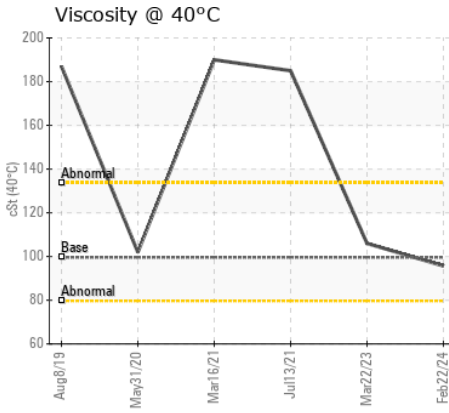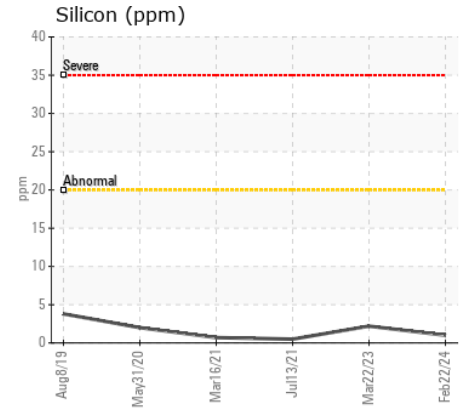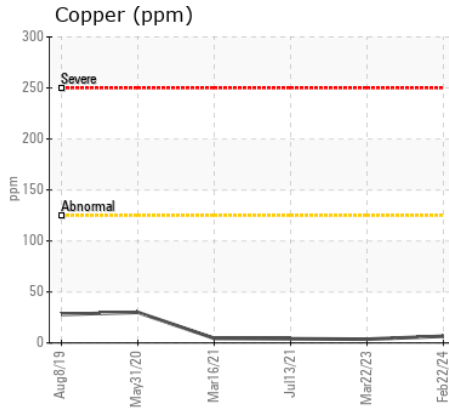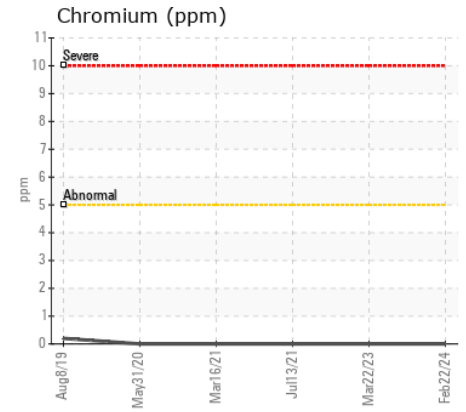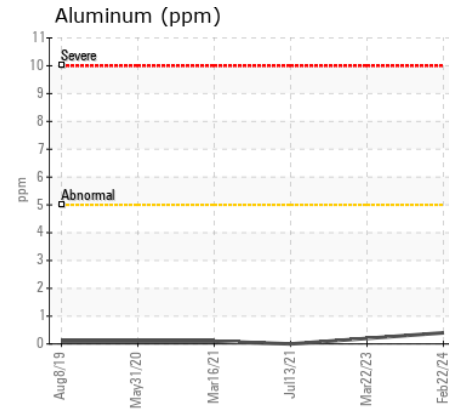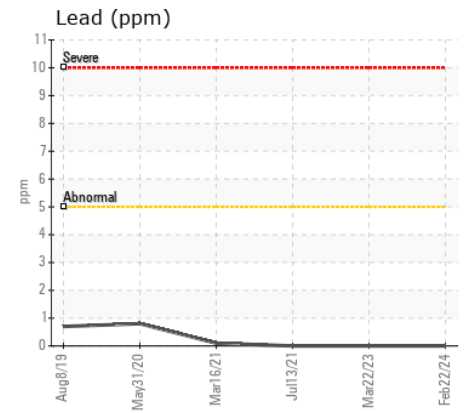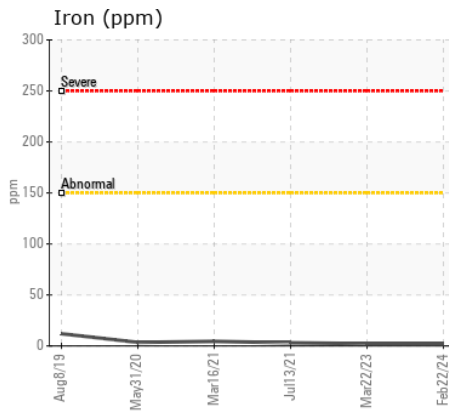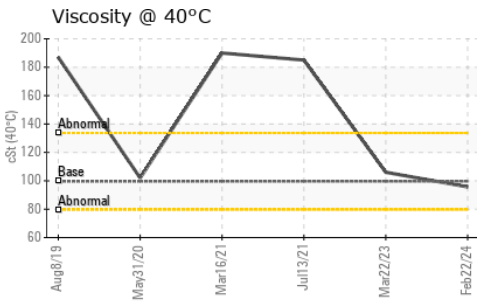

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : LH0278760  
**Lab Number** : 02619327  
**Unique Number** : 5736437  
**Test Package** : MOB 1  
**Received** : 01 Mar 2024  
**Tested** : 01 Mar 2024  
**Diagnosed** : 01 Mar 2024 - Wes Davis

**KIMCO STEEL SALES LTD.**  
 1325 JOHN COUNTER BLVD  
 KINGSTON, ON  
 CA K7L 4W1  
 Contact: David Roy  
 doug@kimcosteel.com  
 T: (800)267-0902  
 F: (613)548-4653

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.