



# LIEBHERR

## OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Machine Id  
**LIEBHERR LH40M 112208-1215**

Component  
**Rear Right Wheel Hub**

Fluid  
**PETRO CANADA TRAXON SYNTHETIC 75W90 (--- GAL)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>LH0278762</b>	LH0256583	LH0193028
Sample Date		Client Info		<b>22 Feb 2024</b>	22 Mar 2023	13 Jul 2021
Machine Age	hrs	Client Info		<b>12935</b>	11044	6336
Oil Age	hrs	Client Info		<b>0</b>	0	0
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Changed</b>	Changed	Changed
Filter Changed		Client Info		<b>N/A</b>	N/A	N/A
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

### WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>650	<b>12</b>	14	17
Chromium	ppm	ASTM D5185(m)	>4	<b>0</b>	0	0
Nickel	ppm	ASTM D5185(m)	>4	<b>&lt;1</b>	0	<1
Titanium	ppm	ASTM D5185(m)	>4	<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)		<b>0</b>	0	0
Aluminum	ppm	ASTM D5185(m)	>25	<b>&lt;1</b>	<1	0
Lead	ppm	ASTM D5185(m)	>4	<b>0</b>	<1	<1
Copper	ppm	ASTM D5185(m)	>60	<b>6</b>	12	15
Tin	ppm	ASTM D5185(m)	>4	<b>0</b>	0	0
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
White Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	VLITE
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE

### CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>75	<b>1</b>	2	2
Potassium	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	0	<1
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Silt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	Visual*	>0.2	<b>NEG</b>	NEG	NEG

### FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		<b>&lt;1</b>	<1	1
Boron	ppm	ASTM D5185(m)	328	<b>272</b>	283	254
Barium	ppm	ASTM D5185(m)	1	<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185(m)		<b>0</b>	0	<1
Manganese	ppm	ASTM D5185(m)		<b>0</b>	<1	<1
Magnesium	ppm	ASTM D5185(m)	1	<b>1</b>	2	<1
Calcium	ppm	ASTM D5185(m)	7	<b>11</b>	11	9
Phosphorus	ppm	ASTM D5185(m)	1145	<b>1332</b>	1441	1428
Zinc	ppm	ASTM D5185(m)	3	<b>13</b>	16	12
Sulfur	ppm	ASTM D5185(m)	17909	<b>21363</b>	22208	21739
Visc @ 40°C	cSt	ASTM D7279(m)	99.6	<b>107</b>	108	111

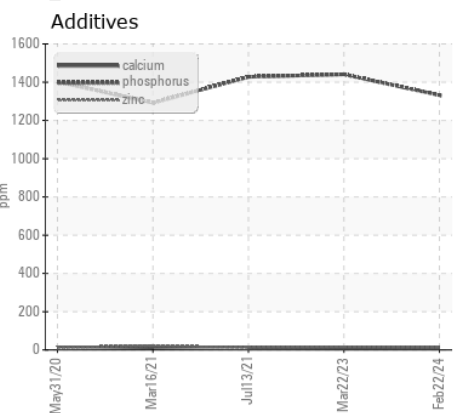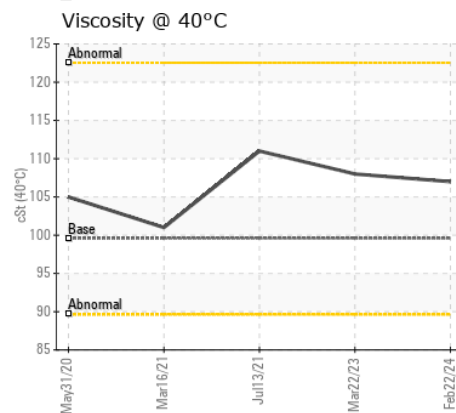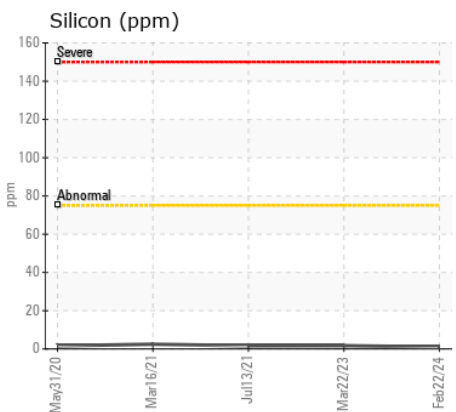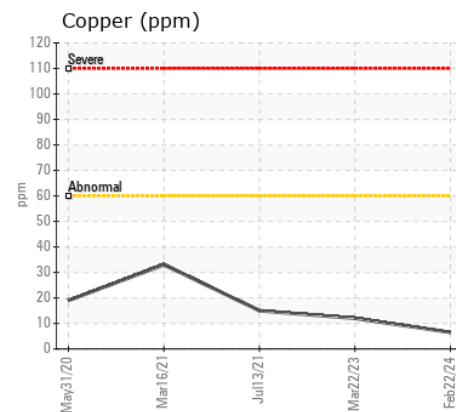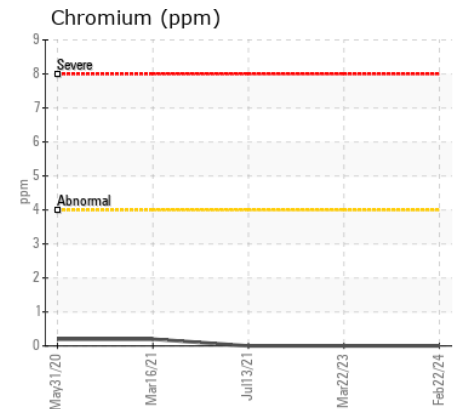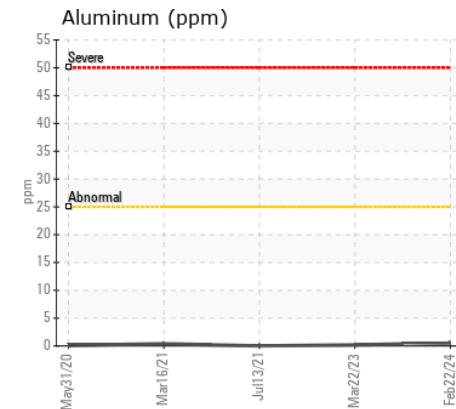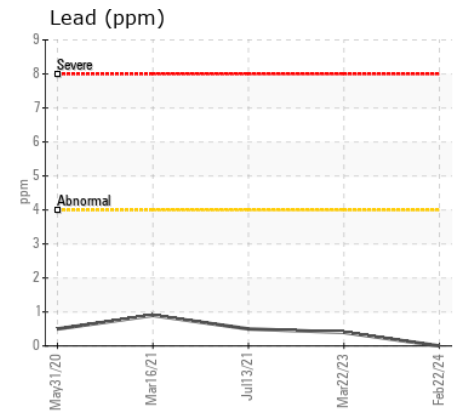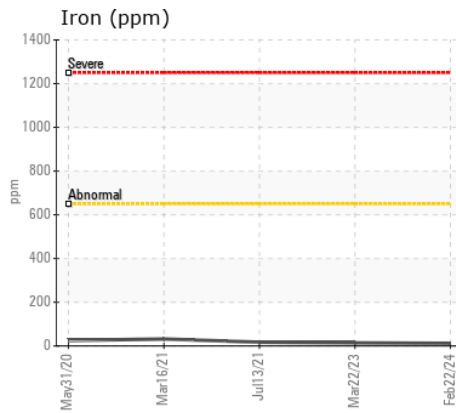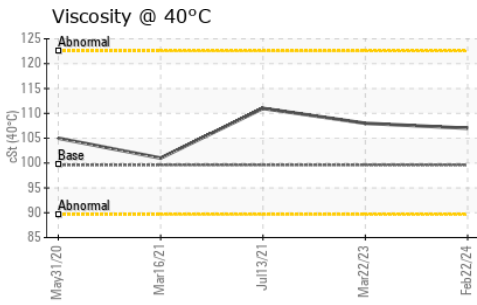

ISO 17025:2017  
Accredited  
Laboratory

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9

**Sample No.** : LH0278762

**Lab Number** : 02619334

**Unique Number** : 5736444

**Test Package** : MOB 1

**Received** : 01 Mar 2024

**Tested** : 01 Mar 2024

**Diagnosed** : 01 Mar 2024 - Wes Davis

**KIMCO STEEL SALES LTD.**

1325 JOHN COUNTER BLVD

KINGSTON, ON

CA K7L 4W1

Contact: David Roy

doug@kimcosteel.com

T: (800)267-0902

F: (613)548-4653

To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

Validity of results and interpretation are based on the sample and information as supplied.