



WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL



Area
[1235248]
 Machine Id
828012
 Component
Diesel Engine
 Fluid
PETRO CANADA DURON SHP 15W40 (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		GFL0093970	GFL0093941	GFL0093924
Sample Date		Client Info		01 Mar 2024	05 Dec 2023	17 Sep 2023
Machine Age	hrs	Client Info		11712	11188	10624
Oil Age	hrs	Client Info		0	0	0
Filter Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Filter Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>80	21	19	15
Chromium	ppm	ASTM D5185(m)	>5	<1	<1	<1
Nickel	ppm	ASTM D5185(m)	>2	<1	<1	0
Titanium	ppm	ASTM D5185(m)		0	0	<1
Silver	ppm	ASTM D5185(m)	>3	0	<1	<1
Aluminum	ppm	ASTM D5185(m)	>30	3	3	4
Lead	ppm	ASTM D5185(m)	>30	0	<1	1
Copper	ppm	ASTM D5185(m)	>150	1	1	2
Tin	ppm	ASTM D5185(m)	>5	0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0

CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>20	4	5	4
Potassium	ppm	ASTM D5185(m)	>20	5	6	8
Fuel		WC Method	>5	<1.0	<1.0	<1.0
Water		WC Method	>0.2	NEG	NEG	NEG
Glycol		WC Method		NEG	0.0	0.0
Soot %	%	ASTM D7844*	>3	0.3	0.3	0.3
Nitration	Abs/cm	ASTM D7624*	>20	8.9	9.2	10.3
Sulfation	Abs/.1mm	ASTM D7415*	>30	19.4	19.6	20.1
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG	NEG

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		53	113	142
Boron	ppm	ASTM D5185(m)	0	4	3	10
Barium	ppm	ASTM D5185(m)	0	0	<1	0
Molybdenum	ppm	ASTM D5185(m)	60	60	63	84
Manganese	ppm	ASTM D5185(m)	0	0	0	<1
Magnesium	ppm	ASTM D5185(m)	1010	879	731	83
Calcium	ppm	ASTM D5185(m)	1070	1114	1215	1987
Phosphorus	ppm	ASTM D5185(m)	1150	955	895	978
Zinc	ppm	ASTM D5185(m)	1270	1128	1115	1101
Sulfur	ppm	ASTM D5185(m)	2060	2588	2423	2921
Oxidation	Abs/.1mm	ASTM D7414*	>25	15.5	16.2	15.7
Visc @ 100°C	cSt	ASTM D7279(m)	15.4	13.1	13.0	13.1

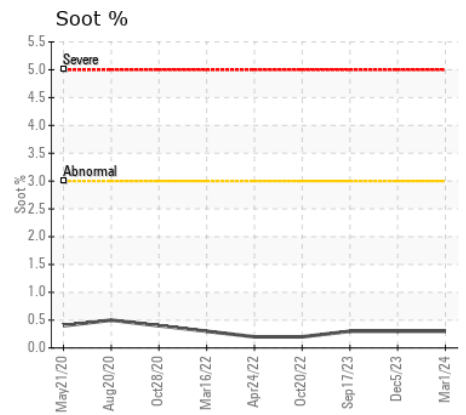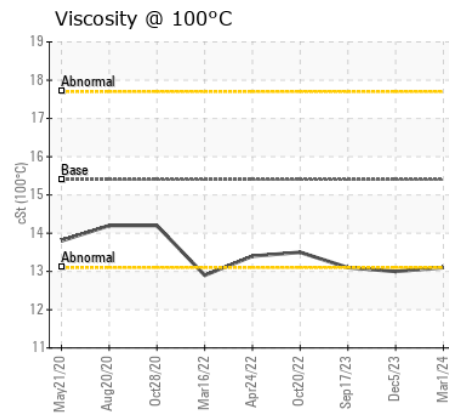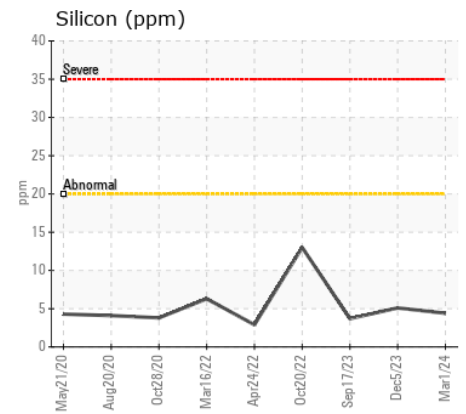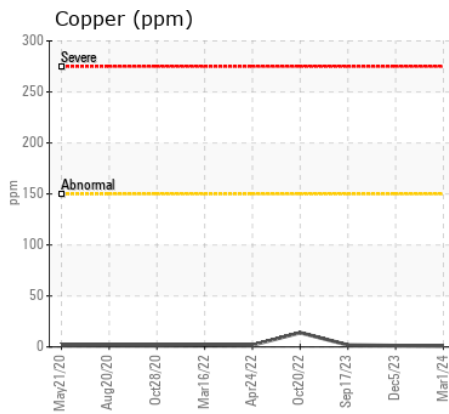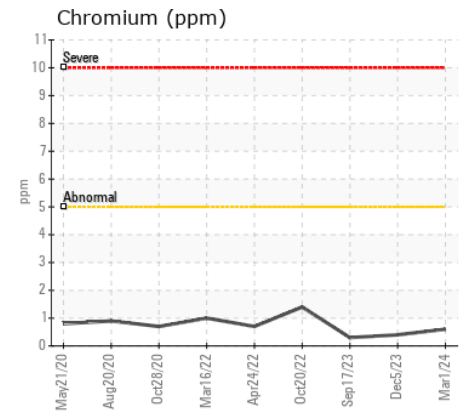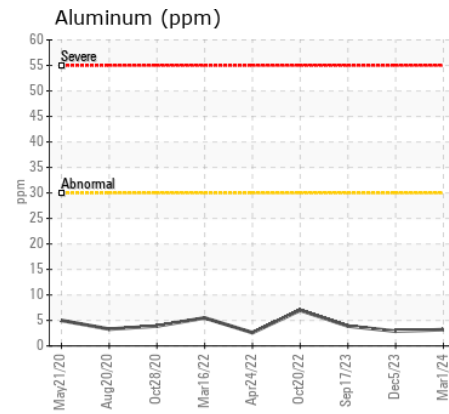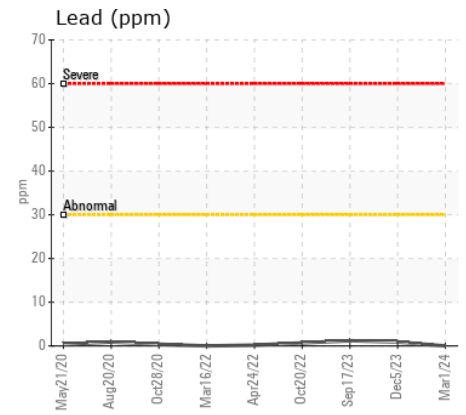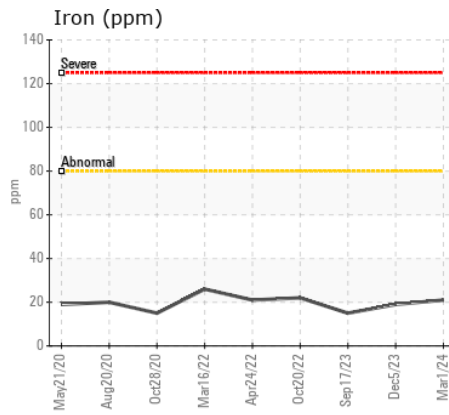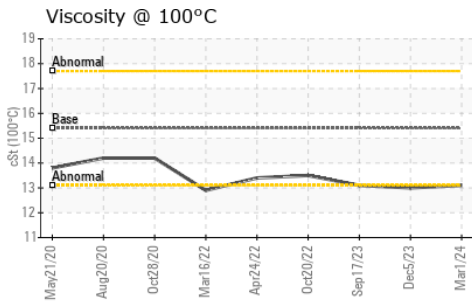

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : GFL0093970
Lab Number : 02619817
Unique Number : 5736927
Test Package : MOB 1
Received : 05 Mar 2024
Tested : 05 Mar 2024
Diagnosed : 05 Mar 2024 - Wes Davis

GFL Environmental - 777 - Belleville-Municipal waste
 197 Putman Industrial Road
 Belleville, ON
 CA K8N 4Z6
 Contact: Andrea Michael
 amichael@gflenv.com
 T: (613)962-7144
 F: (613)962-1994

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.