

OIL ANALYSIS REPORT

WEAR CONTAMINATION FLUID CONDITION

NORMAL NORMAL

Area

SKYCARE AIR AMBULANCE [53042]


Machine Id


FAIRCHILD SA227 P-44470C (S/N AC632)


Right Jet Turbine


EASTMAN TURBO OIL 2380 (--- GAL)

RECOMMENDATION	- .					 L	
	Test	UOM	Method	Limit/Abn	Current	History1	History2
This is a baseline read-out on the submitted sample.	Sample Number		Client Info		GT57685	GT57682	GT57548
	Sample Date		Client Info		04 Mar 2024	19 Feb 2024	03 Feb 2024
	Machine Age	hrs	Client Info		0	0	0
	Oil Age	hrs	Client Info		819	755	676
	Filter Age	hrs	Client Info		64	79	79
	Oil Changed		Client Info		N/A	N/A	N/A
	Filter Changed		Client Info		N/A	N/A	N/A
	Sample Status				NORMAL		NORMAL
WEAR	Iron	ppm	ASTM D5185(m)	>8	0	0	0
	Chromium	ppm	ASTM D5185(m)	>2	0	0	0
	Nickel	ppm	ASTM D5185(m)	>2	0	0	0
	Silver	ppm	ASTM D5185(m)	>2	0	0	0
	Aluminum	ppm	ASTM D5185(m)	>2	<1	<1	<1
	Lead	ppm	ASTM D5185(m)	>3	<1	<1	<1
	Copper	ppm	ASTM D5185(m)	>3	<1	0	<1
CONTAMINATION	Water		WC Method	>0.1	NEG	NEG	NEG
FLUID CONDITION	Magnesium	ppm	ASTM D5185(m)	0	0	0	0
	Acid Number (AN)	mg KOH/g	ASTM D974*	0.43	0.95	0.91	0.86
	Visc @ 40°C	cSt	ASTM D7279(m)	24.2	24.3		24.7

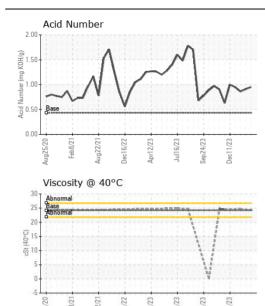

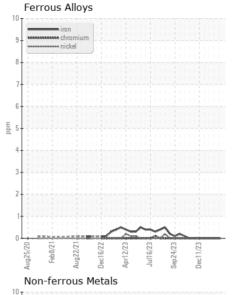

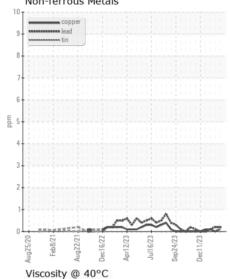

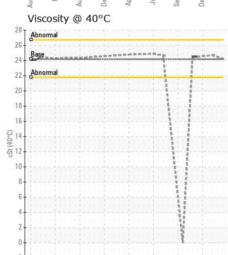





CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No.

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : GT57685 Lab Number : 02620714

Unique Number : 5737824

Received Tested Diagnosed

: 07 Mar 2024 : 07 Mar 2024

Sep24/23

Dec11/23

: 07 Mar 2024 - Wes Davis

Honeywell Engines 111 S. 34th Street, 301 Receiving, Attn: SOAP Program PHOENIX, AZ

US 85034 Contact: GARRETT

Test Package : G331 (Additional Tests: ICP) To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

Validity of results and interpretation are based on the sample and information as supplied.

T: F: (602)365-2676