



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Area
[13923446]
 Machine Id
CAHE-HPU47000

Component
Hydraulic System
 Fluid
MOBIL DTE EXCEL ISO 32 (--- GAL)

RECOMMENDATION

Confirm the source of the lubricant being utilized for top-up/fill. Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		PP	---	---
Sample Date		Client Info		26 Dec 2023	---	---
Machine Age	hrs	Client Info		0	---	---
Oil Age	hrs	Client Info		0	---	---
Filter Age	hrs	Client Info		0	---	---
Oil Changed		Client Info		N/A	---	---
Filter Changed		Client Info		N/A	---	---
Sample Status				NORMAL	---	---

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>20	<1	---	---
Chromium	ppm	ASTM D5185(m)	>20	0	---	---
Nickel	ppm	ASTM D5185(m)	>20	0	---	---
Titanium	ppm	ASTM D5185(m)		0	---	---
Silver	ppm	ASTM D5185(m)		0	---	---
Aluminum	ppm	ASTM D5185(m)	>20	0	---	---
Lead	ppm	ASTM D5185(m)	>20	0	---	---
Copper	ppm	ASTM D5185(m)	>20	<1	---	---
Tin	ppm	ASTM D5185(m)	>20	0	---	---
Vanadium	ppm	ASTM D5185(m)		0	---	---
White Metal	scalar	Visual*	NONE	NONE	---	---
Yellow Metal	scalar	Visual*	NONE	NONE	---	---

CONTAMINATION











The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

Silicon	ppm	ASTM D5185(m)	>15	0	---	---
Potassium	ppm	ASTM D5185(m)	>20	0	---	---
Water		WC Method	>0.05	NEG	---	---
Particles >4µm		ASTM D7647	>5000	1333	---	---
Particles >6µm		ASTM D7647	>1300	327	---	---
Particles >14µm		ASTM D7647	>160	14	---	---
Particles >21µm		ASTM D7647	>40	4	---	---
Particles >38µm		ASTM D7647	>10	1	---	---
Particles >71µm		ASTM D7647	>3	1	---	---
Oil Cleanliness		ISO 4406 (c)	>19/17/14	18/16/11	---	---
Silt	scalar	Visual*	NONE	NONE	---	---
Debris	scalar	Visual*	NONE	NONE	---	---
Sand/Dirt	scalar	Visual*	NONE	NONE	---	---
Appearance	scalar	Visual*	NORML	NORML	---	---
Odor	scalar	Visual*	NORML	NORML	---	---
Emulsified Water	scalar	Visual*	>0.05	NEG	---	---

FLUID CONDITION

Additive levels indicate the addition of a different brand, or type of oil. The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		2	---	---
Boron	ppm	ASTM D5185(m)		<1	---	---
Barium	ppm	ASTM D5185(m)		0	---	---
Molybdenum	ppm	ASTM D5185(m)		0	---	---
Manganese	ppm	ASTM D5185(m)		0	---	---
Magnesium	ppm	ASTM D5185(m)		<1	---	---
Calcium	ppm	ASTM D5185(m)		104	---	---
Phosphorus	ppm	ASTM D5185(m)		409	---	---
Zinc	ppm	ASTM D5185(m)		27	---	---
Sulfur	ppm	ASTM D5185(m)		1391	---	---
Acid Number (AN)	mg KOH/g	ASTM D974*	.2	0.05	---	---
Visc @ 40°C	cSt	ASTM D7279(m)	33.0	31.4	---	---

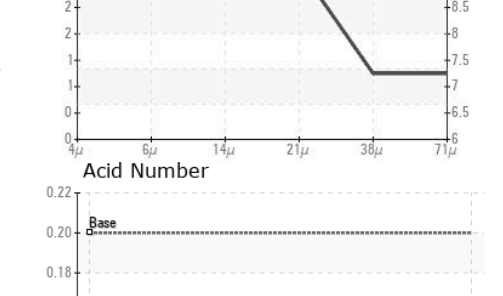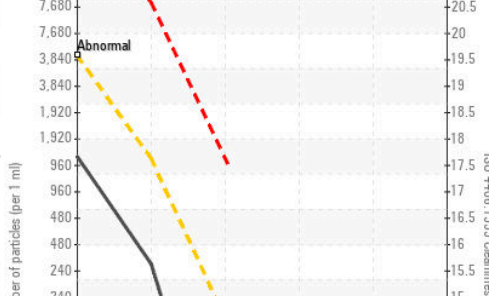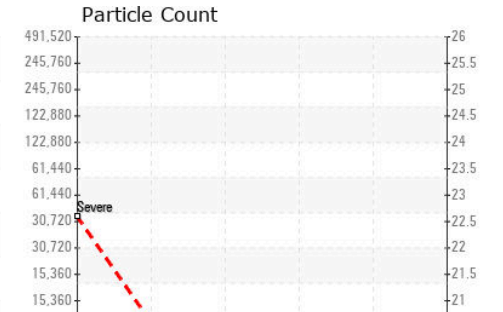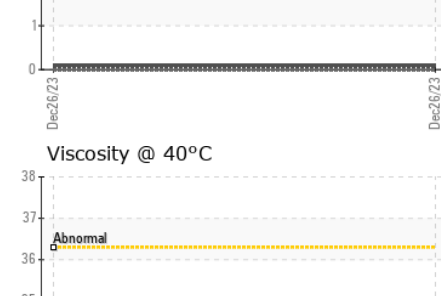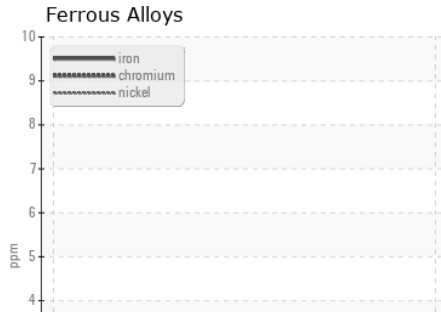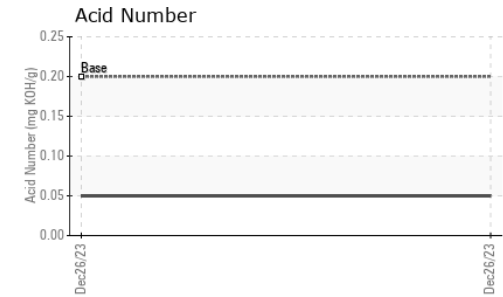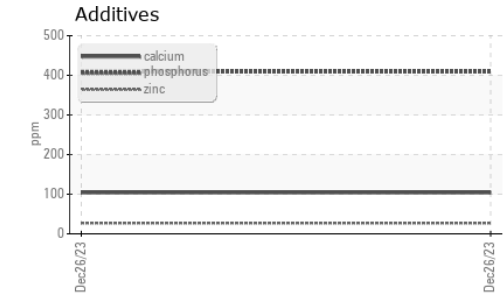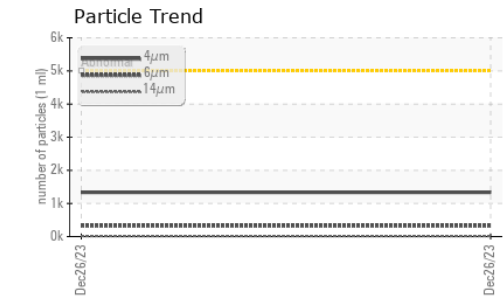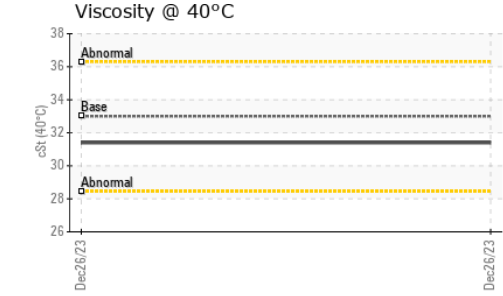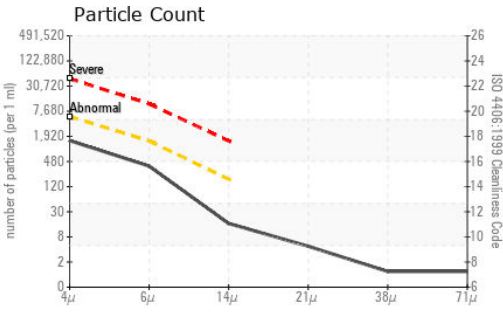

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : PP
Lab Number : 02624955
Unique Number : 5750074
Test Package : MAR 2
Received : 27 Mar 2024
Tested : 28 Mar 2024
Diagnosed : 28 Mar 2024 - Kevin Marson

KCA Deutag Drilling Canada Inc.
 Suite 201, 45 Hebron Way
 St. John's, NL
 CA A1A 0P9
 Contact: Reg Costello
 Hebron.MaintSuperintendent@kcadeutag.com
 T: (709)778-6228
 F: (709)730-1834

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.