



# LIEBHERR

## OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Machine Id  
**LIEBHERR PR736XL 019279-1155**

Component  
**Right Final Drive**

Fluid  
**PETRO CANADA TRAXON 75W90 SYNTHETIC (22 LTR)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>LH0287992</b>	LH0260449	LH0246911
Sample Date		Client Info		<b>20 Mar 2024</b>	26 Jun 2023	10 Feb 2023
Machine Age	hrs	Client Info		<b>5050</b>	3979	3487
Oil Age	hrs	Client Info		<b>0</b>	0	0
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Changed</b>	Changed	Not Changd
Filter Changed		Client Info		<b>N/A</b>	N/A	N/A
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

### WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>500	<b>9</b>	11	14
Chromium	ppm	ASTM D5185(m)	>10	<b>0</b>	0	0
Nickel	ppm	ASTM D5185(m)	>10	<b>0</b>	0	0
Titanium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)		<b>0</b>	0	0
Aluminum	ppm	ASTM D5185(m)	>25	<b>0</b>	<1	<1
Lead	ppm	ASTM D5185(m)	>25	<b>0</b>	<1	<1
Copper	ppm	ASTM D5185(m)	>50	<b>6</b>	10	14
Tin	ppm	ASTM D5185(m)	>10	<b>0</b>	<1	<1
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
White Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE

### CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>75	<b>&lt;1</b>	1	1
Potassium	ppm	ASTM D5185(m)	>20	<b>0</b>	<1	0
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Silt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	Visual*	>0.2	<b>NEG</b>	NEG	NEG

### FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		<b>&lt;1</b>	<1	1
Boron	ppm	ASTM D5185(m)	328	<b>310</b>	311	301
Barium	ppm	ASTM D5185(m)	1	<b>0</b>	<1	<1
Molybdenum	ppm	ASTM D5185(m)		<b>0</b>	0	0
Manganese	ppm	ASTM D5185(m)		<b>0</b>	0	<1
Magnesium	ppm	ASTM D5185(m)	1	<b>&lt;1</b>	2	1
Calcium	ppm	ASTM D5185(m)	7	<b>4</b>	19	4
Phosphorus	ppm	ASTM D5185(m)	1145	<b>1235</b>	1310	1302
Zinc	ppm	ASTM D5185(m)	3	<b>9</b>	10	7
Sulfur	ppm	ASTM D5185(m)	17909	<b>20403</b>	20578	20767
Visc @ 40°C	cSt	ASTM D7279(m)	99.6	<b>95.1</b>	92.6	85.2

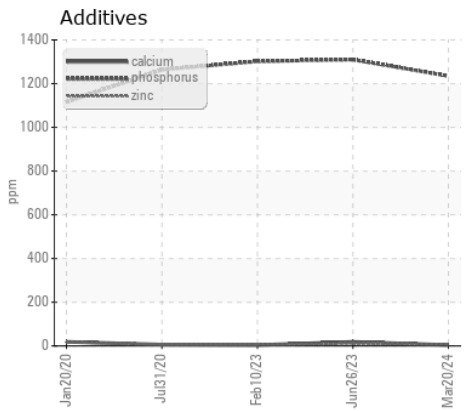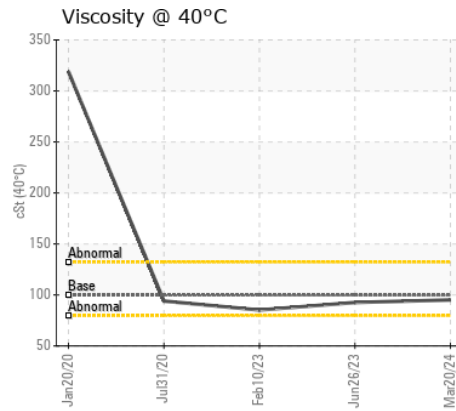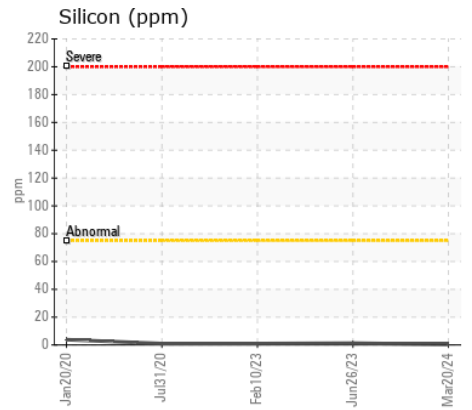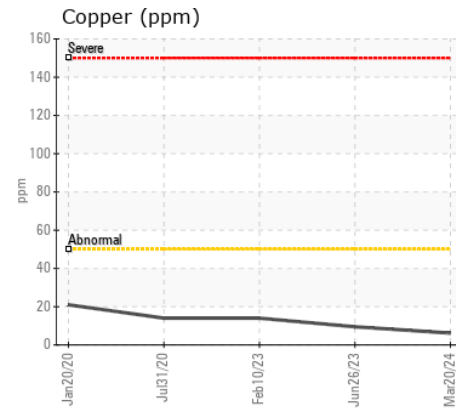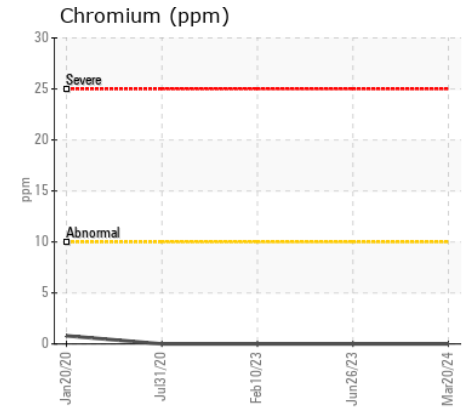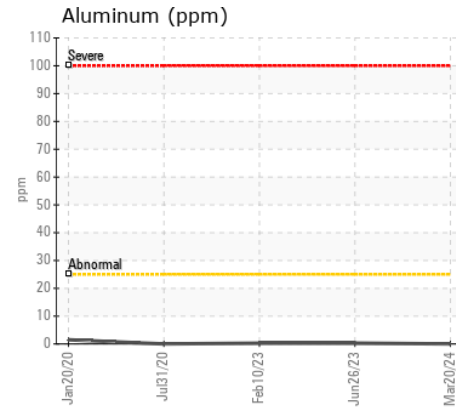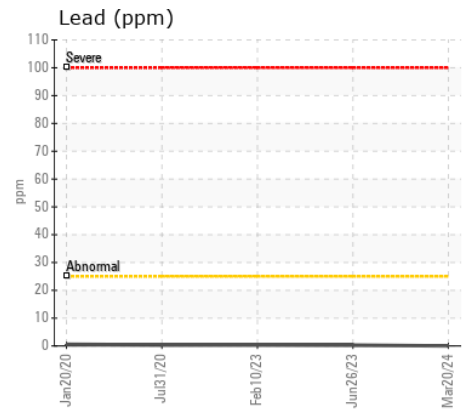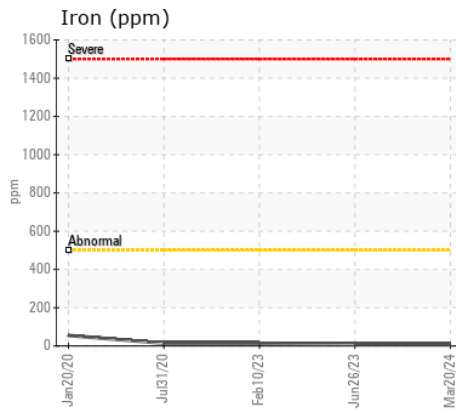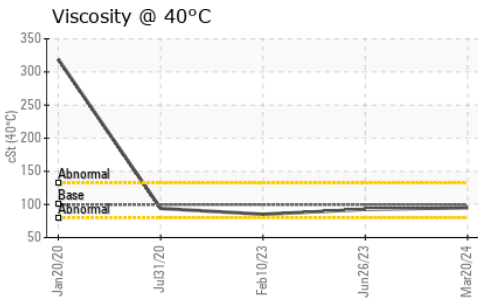

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : LH0287992  
**Lab Number** : 02625013  
**Unique Number** : 5750132  
**Test Package** : MOB 1  
**Received** : 27 Mar 2024  
**Tested** : 27 Mar 2024  
**Diagnosed** : 27 Mar 2024 - Wes Davis

**ECOWASTE INDUSTRIES LTD.**  
 15111 WILLIAMS ROAD  
 RICHMOND, BC  
 CA V6W 1G9  
 Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.

T: (604)277-1410  
 F: