



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Machine Id
1414 KING
Component
Left Diesel Engine
Fluid
MOBIL 15W40 (35 LTR)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		WC0910586	WC0783858	WC0647831
Sample Date		Client Info		01 Mar 2024	02 Mar 2023	23 Mar 2022
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Filter Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Filter Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>100	2	2	1
Chromium	ppm	ASTM D5185(m)	>20	0	0	0
Nickel	ppm	ASTM D5185(m)	>4	0	0	0
Titanium	ppm	ASTM D5185(m)		0	<1	0
Silver	ppm	ASTM D5185(m)	>3	0	0	0
Aluminum	ppm	ASTM D5185(m)	>20	<1	2	<1
Lead	ppm	ASTM D5185(m)	>40	<1	1	<1
Copper	ppm	ASTM D5185(m)	>330	3	2	3
Tin	ppm	ASTM D5185(m)	>15	<1	<1	<1
Vanadium	ppm	ASTM D5185(m)		0	0	0

CONTAMINATION











There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>25	3	4	3
Potassium	ppm	ASTM D5185(m)	>20	0	0	<1
Fuel		WC Method	>5	<1.0	<1.0	<1.0
Water		WC Method	>0.2	NEG	NEG	NEG
Glycol		WC Method		NEG	NEG	NEG
Soot %	%	ASTM D7844*	>3	0	0	0
Nitration	Abs/cm	ASTM D7624*	>20	4.6	4.8	5.3
Sulfation	Abs/.1mm	ASTM D7415*	>30	18.4	21.9	19.2
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG	NEG

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)	>118	<1	<1	1
Boron	ppm	ASTM D5185(m)		81	305	15
Barium	ppm	ASTM D5185(m)		0	0	0
Molybdenum	ppm	ASTM D5185(m)		63	76	59
Manganese	ppm	ASTM D5185(m)		0	<1	<1
Magnesium	ppm	ASTM D5185(m)		867	533	944
Calcium	ppm	ASTM D5185(m)		1092	1337	1061
Phosphorus	ppm	ASTM D5185(m)		1000	1079	1004
Zinc	ppm	ASTM D5185(m)		1157	1157	1188
Sulfur	ppm	ASTM D5185(m)		2721	2818	2818
Oxidation	Abs/.1mm	ASTM D7414*	>25	13.3	13.3	14.2
Visc @ 100°C	cSt	ASTM D7279(m)		13.4	13.7	13.1

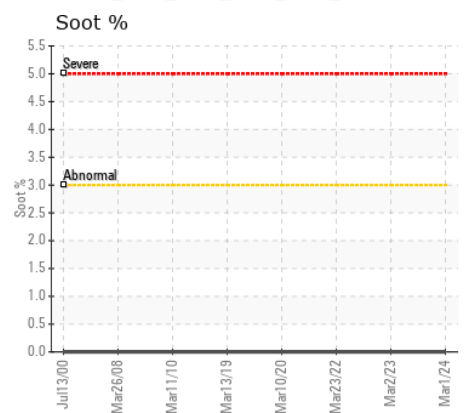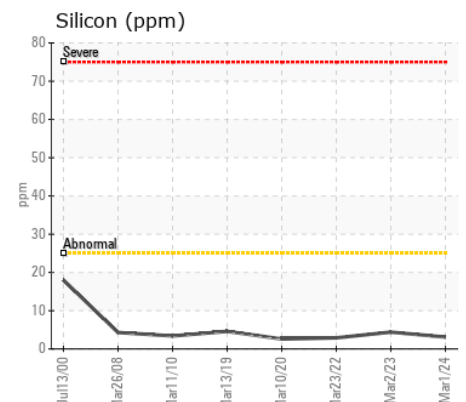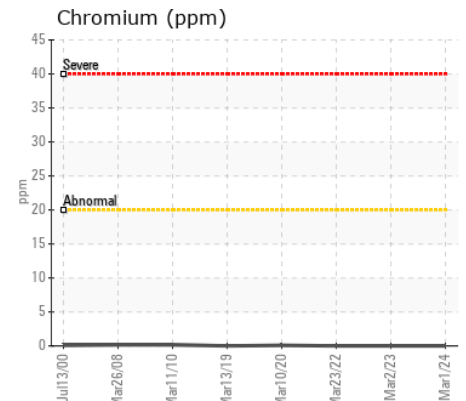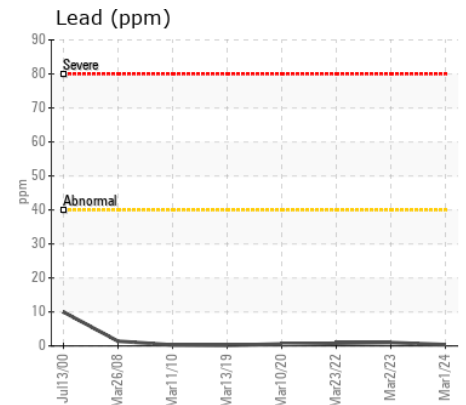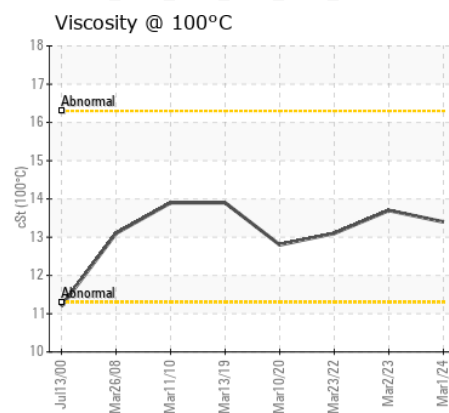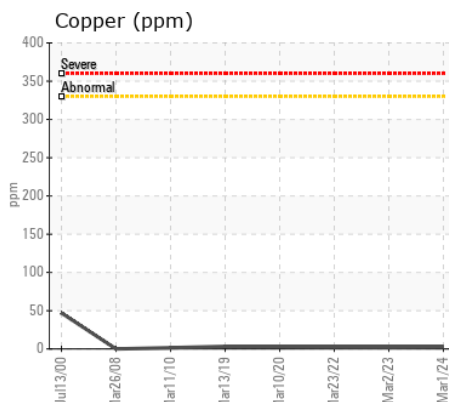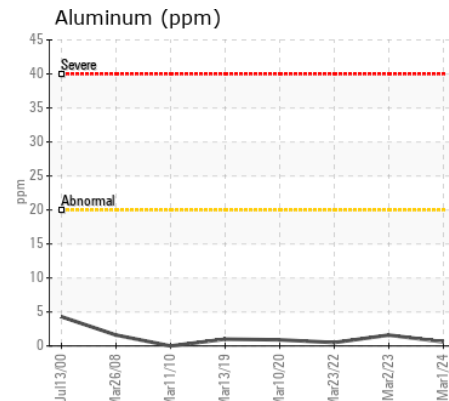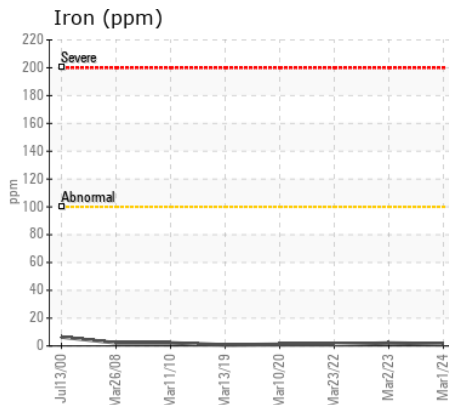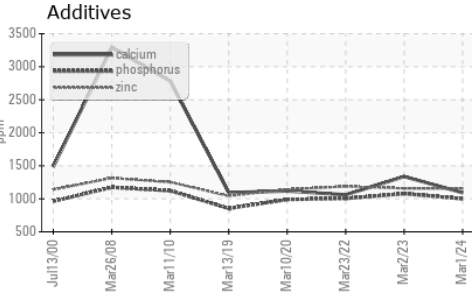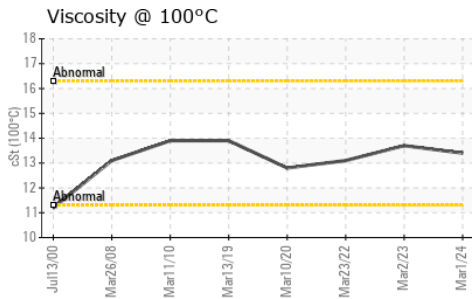

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0910586
Lab Number : 02625616
Unique Number : 5750735
Test Package : MOB 1
Received : 01 Apr 2024
Tested : 01 Apr 2024
Diagnosed : 01 Apr 2024 - Wes Davis

NORTHERN GENERATOR CO. LTD.
 80 ASHBRIDGE CIRCLE., UNIT #1 & 2
 WOODBRIDGE, ON
 CA L4L 3R5
 Contact: Selome Afework
 selome@northerngenerator.com
 T: (905)264-9744
 F: (905)264-9714

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.