

OIL ANALYSIS REPORT

WEAR CONTAMINATION FLUID CONDITION

NORMAL NORMAL NORMAL


(C-GTTM) CARSON AIR LTD [53115]


[C-GTTM] FAIRCHILD SA227 P-44575C (S/N AC-741B)


1 Jet Turbine


SHELL AEROSHELL 500 (--- GAL)


ENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
_	Sample Number	20111	Client Info		GT57628	GT57153	GT57158
	Sample Date		Client Info		27 Mar 2024	06 Dec 2023	11 Sep 2023
	Machine Age	hrs	Client Info		0	0	0
	Oil Age	hrs	Client Info		596	439	299
	Filter Age	hrs	Client Info		156	141	157
	Oil Changed		Client Info		N/A	N/A	N/A
	Filter Changed		Client Info		N/A	N/A	N/A
	Sample Status						
	Iron	ppm	ASTM D5185(m)	>8	<1	0	<1
	Chromium	ppm	ASTM D5185(m)	>2	0	0	0
	Nickel	ppm	ASTM D5185(m)	>2	0	0	0
	Silver	ppm	ASTM D5185(m)	>2	0	0	0
	Aluminum	ppm	ASTM D5185(m)	>2	<1	<1	1
	Lead	ppm	ASTM D5185(m)	>3	<1	0	<1
	Copper	ppm	ASTM D5185(m)	>3	<1	0	<1
	Water		WC Method	>0.1	NEG	NEG	NEG
	Magnesium	ppm	ASTM D5185(m)	0	0	0	0
	Acid Number (AN)	mg KOH/g	ASTM D974*	0.11	0.26	0.30	0.26

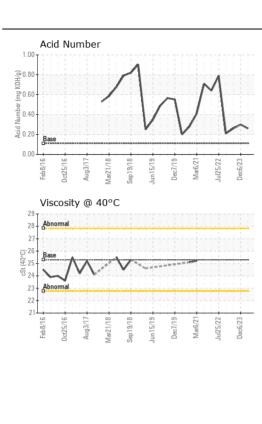

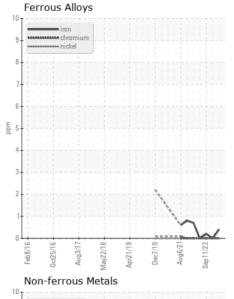

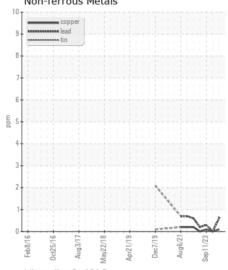

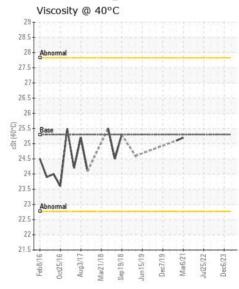

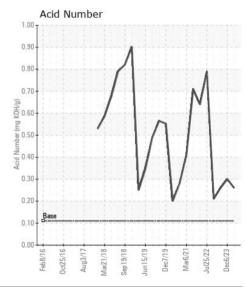



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No.

Lab Number : 02625931

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : GT57628

Validity of results and interpretation are based on the sample and information as supplied.

Received Tested Unique Number : 5759063 Test Package : G331 (Additional Tests: ICP)

Diagnosed

: 01 Apr 2024

Honeywell Engines 111 S. 34th Street, 301 Receiving, Attn: SOAP Program PHOENIX, AZ US 85034

Contact: GARRETT

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

T: F: (602)365-2676