



# OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Machine Id  
**VOLVO L120H 633097**  
Component  
**Front Differential**  
Fluid  
**VOLVO WB 102 (--- GAL)**

## RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>WC0896375</b>	WC0896426	WC0849246
Sample Date		Client Info		<b>12 Mar 2024</b>	22 Jan 2024	20 Nov 2023
Machine Age	hrs	Client Info		<b>14000</b>	13000	12000
Oil Age	hrs	Client Info		<b>2000</b>	1000	2000
Filter Age	hrs	Client Info		<b>1000</b>	1000	1000
Oil Changed		Client Info		<b>Changed</b>	Not Changd	Changed
Filter Changed		Client Info		<b>Changed</b>	Changed	Changed
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

## WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>500	<b>16</b>	16	17
Chromium	ppm	ASTM D5185(m)	>10	<b>0</b>	0	0
Nickel	ppm	ASTM D5185(m)	>10	<b>0</b>	0	<1
Titanium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)		<b>0</b>	0	<1
Aluminum	ppm	ASTM D5185(m)	>25	<b>1</b>	1	<1
Lead	ppm	ASTM D5185(m)	>25	<b>0</b>	0	0
Copper	ppm	ASTM D5185(m)	>100	<b>&lt;1</b>	<1	<1
Tin	ppm	ASTM D5185(m)	>10	<b>0</b>	0	0
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
White Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE

## CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>75	<b>8</b>	11	8
Potassium	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	<1	0
Water		WC Method	>.2	<b>NEG</b>	NEG	NEG
Silt	scalar	Visual*	NONE	<b>VLITE</b>	NONE	NONE
Debris	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	Visual*	>.2	<b>NEG</b>	NEG	NEG

## FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		<b>&lt;1</b>	<1	<1
Boron	ppm	ASTM D5185(m)		<b>107</b>	115	103
Barium	ppm	ASTM D5185(m)		<b>0</b>	0	<1
Molybdenum	ppm	ASTM D5185(m)		<b>0</b>	0	0
Manganese	ppm	ASTM D5185(m)		<b>0</b>	0	0
Magnesium	ppm	ASTM D5185(m)		<b>17</b>	19	16
Calcium	ppm	ASTM D5185(m)		<b>3808</b>	4042	3629
Phosphorus	ppm	ASTM D5185(m)		<b>1269</b>	1276	1225
Zinc	ppm	ASTM D5185(m)		<b>1551</b>	1607	1513
Sulfur	ppm	ASTM D5185(m)		<b>3104</b>	3715	3089
Visc @ 40°C	cSt	ASTM D7279(m)		<b>42.5</b>	42.8	42.3

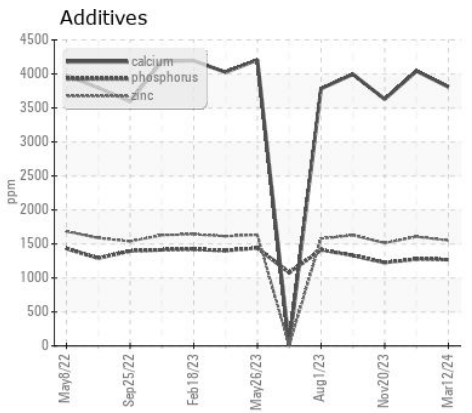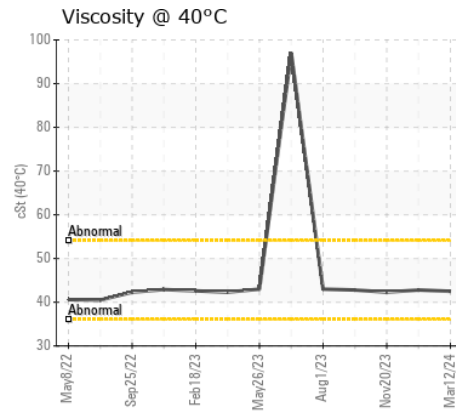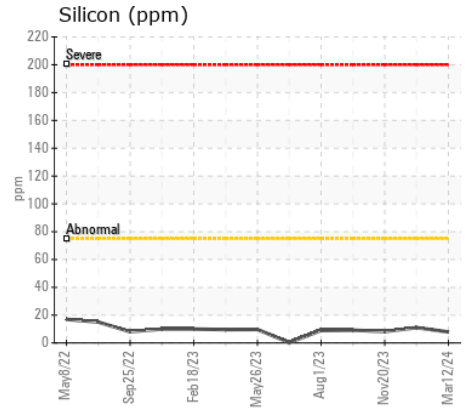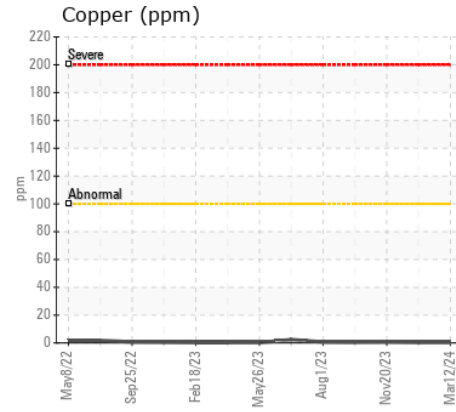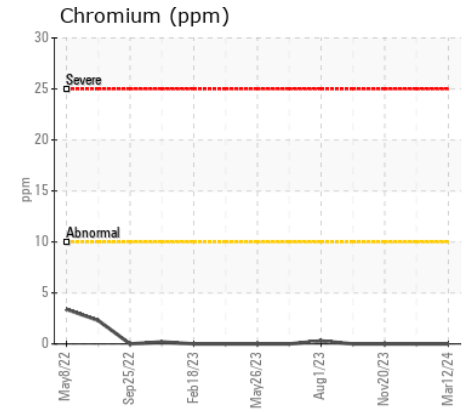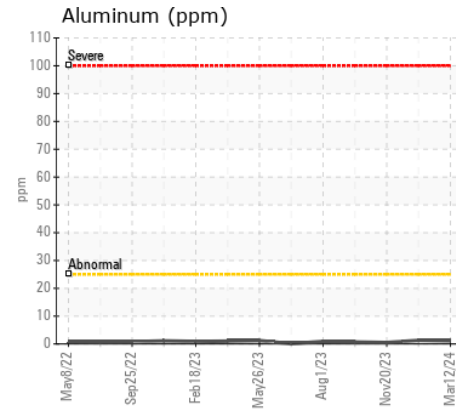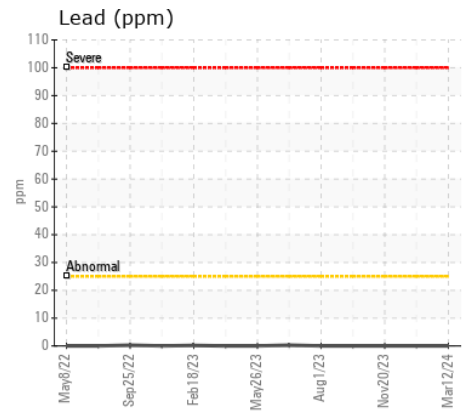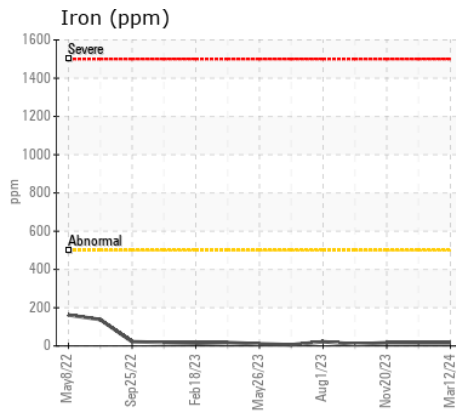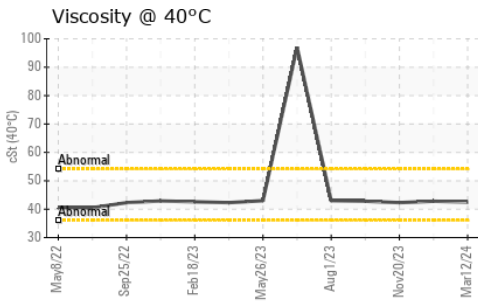

ISO 17025:2017  
Accredited  
Laboratory

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9

**Sample No.** : WC0896375

**Lab Number** : 02626142

**Unique Number** : 5759274

**Test Package** : MOB 1

**Received** : 02 Apr 2024

**Tested** : 02 Apr 2024

**Diagnosed** : 02 Apr 2024 - Wes Davis

**INTERFOR CORP**

5060 RTE 430

BRUNSWICK MINE, NB

CA E2A 6W6

Contact: Daniel Hachey

daniel.hachey@interfor.com

T: (506)547-8700

F: (506)548-1892

To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

Validity of results and interpretation are based on the sample and information as supplied.