



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Machine Id
402 CRANE AUXILIARY TROLLEY GEARBOX (S/N VA0426886)

Component
Gearbox

Fluid
SHELL OMALA S4 GX 220 (19 LTR)

RECOMMENDATION

Resample at the next service interval to monitor.

WEAR

All component wear rates are normal.









CONTAMINATION

There is no indication of any contamination in the oil.

FLUID CONDITION

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		WC0716515	WC0811789	WC0665417
Sample Date		Client Info		25 Mar 2024	18 Sep 2023	19 Sep 2022
Machine Age	yrs	Client Info		0	0	0
Oil Age	yrs	Client Info		0	0	0
Filter Age	yrs	Client Info		0	0	0
Oil Changed		Client Info		Not Changd	Not Changd	Not Changd
Filter Changed		Client Info		Not Changd	N/A	Not Changd
Sample Status				NORMAL	NORMAL	NORMAL
PQ		ASTM D8184*		10	0	16
Iron	ppm	ASTM D5185(m)	>200	31	4	44
Chromium	ppm	ASTM D5185(m)	>15	0	0	0
Nickel	ppm	ASTM D5185(m)	>15	<1	<1	<1
Titanium	ppm	ASTM D5185(m)		<1	0	0
Silver	ppm	ASTM D5185(m)		0	<1	0
Aluminum	ppm	ASTM D5185(m)	>25	0	<1	<1
Lead	ppm	ASTM D5185(m)	>100	0	0	0
Copper	ppm	ASTM D5185(m)	>200	<1	<1	<1
Tin	ppm	ASTM D5185(m)	>25	0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
White Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Silicon	ppm	ASTM D5185(m)	>50	14	12	16
Potassium	ppm	ASTM D5185(m)	>20	2	<1	2
Water		WC Method	>0.2	NEG	NEG	NEG
Silt	scalar	Visual*	NONE	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	VLITE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	LIGHT	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG	NEG
Sodium	ppm	ASTM D5185(m)		2	2	2
Boron	ppm	ASTM D5185(m)		15	25	19
Barium	ppm	ASTM D5185(m)		<1	<1	<1
Molybdenum	ppm	ASTM D5185(m)		11	0	11
Manganese	ppm	ASTM D5185(m)		0	0	<1
Magnesium	ppm	ASTM D5185(m)		<1	<1	<1
Calcium	ppm	ASTM D5185(m)		16	3	16
Phosphorus	ppm	ASTM D5185(m)		414	406	461
Zinc	ppm	ASTM D5185(m)		8	5	6
Sulfur	ppm	ASTM D5185(m)		5442	4844	5574
Acid Number (AN)	mg KOH/g	ASTM D974*		0.86	1.00	0.77
Visc @ 40°C	cSt	ASTM D7279(m)	230	205	227	209

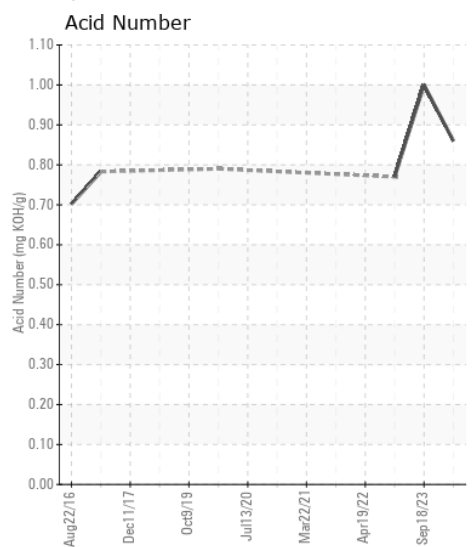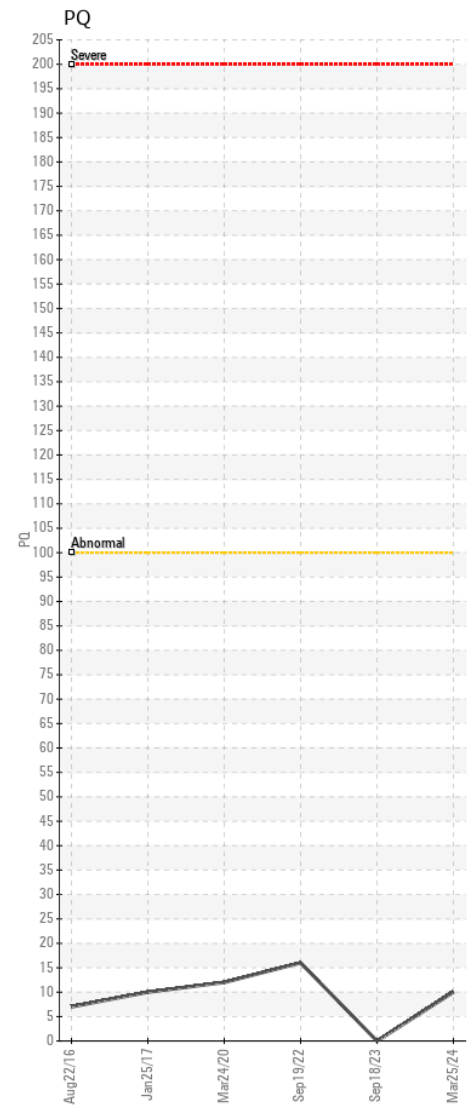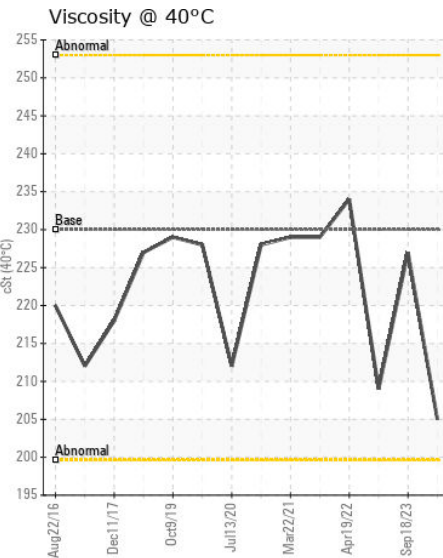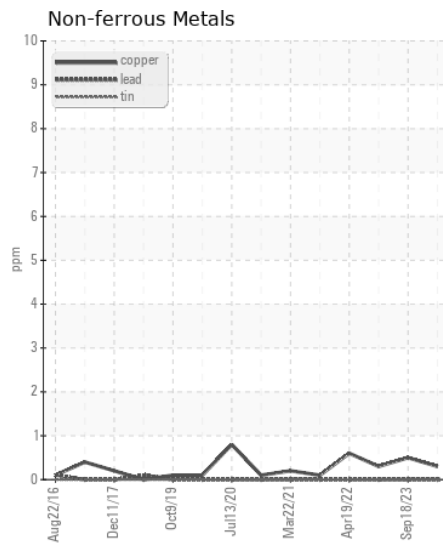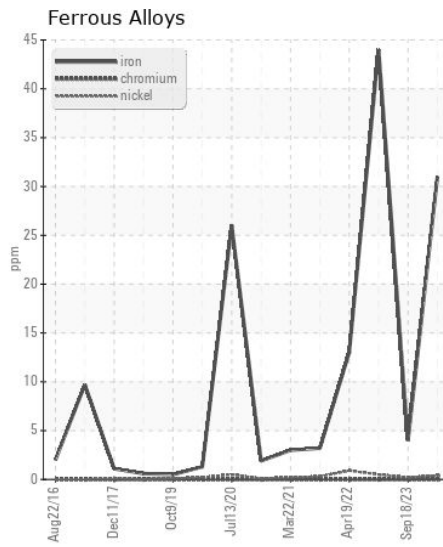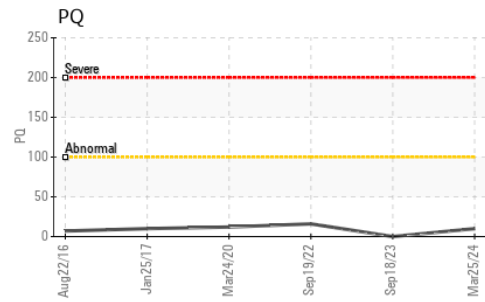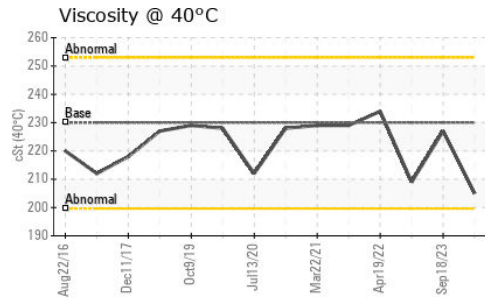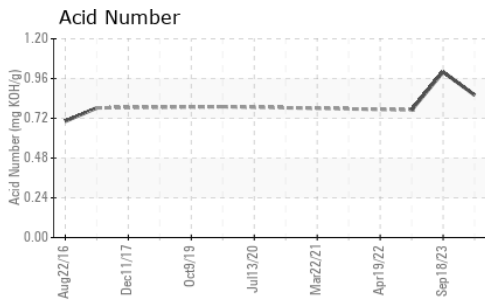

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0716515 **Received** : 04 Apr 2024
Lab Number : 02626733 **Tested** : 04 Apr 2024
Unique Number : 5759865 **Diagnosed** : 04 Apr 2024 - Wes Davis
Test Package : IND 2 (Additional Tests: TAN Man)

Vale - Copper Cliff Smelter
 COPPER CLIFF SMELTER WAREHOUSE, 155 BALSAM ST.
 COPPER CLIFF, ON
 CA P0M 1N0
 Contact: Andy Kozachanko
 andrew.kozachanko@vale.com
 T: (705)682-6687
 F: (705)682-6939

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.