



WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Machine Id
45299
Component
Diesel Engine
Fluid
DIESEL ENGINE OIL SAE 10W30 (--- GAL)

RECOMMENDATION

Échantillonner de nouveau l'équipement au prochain intervalle de vidange afin d'en surveiller la condition.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		GFL0114918	---	---
Sample Date		Client Info		03 Apr 2024	---	---
Machine Age	hrs	Client Info		12621	---	---
Oil Age	hrs	Client Info		0	---	---
Filter Age	hrs	Client Info		0	---	---
Oil Changed		Client Info		Changed	---	---
Filter Changed		Client Info		Changed	---	---
Sample Status				NORMAL	---	---

WEAR

Les taux d'usure de tous les composants sont normaux.

Iron	ppm	ASTM D5185(m)	>100	23	---	---
Chromium	ppm	ASTM D5185(m)	>20	1	---	---
Nickel	ppm	ASTM D5185(m)	>4	0	---	---
Titanium	ppm	ASTM D5185(m)		0	---	---
Silver	ppm	ASTM D5185(m)	>3	0	---	---
Aluminum	ppm	ASTM D5185(m)	>20	4	---	---
Lead	ppm	ASTM D5185(m)	>40	0	---	---
Copper	ppm	ASTM D5185(m)	>330	2	---	---
Tin	ppm	ASTM D5185(m)	>15	0	---	---
Vanadium	ppm	ASTM D5185(m)		0	---	---
White Metal	scalar	Visual*	NONE	NONE	---	---
Yellow Metal	scalar	Visual*	NONE	NONE	---	---

CONTAMINATION











Il n'y a aucun indice de contamination dans l'huile.

Silicon	ppm	ASTM D5185(m)	>25	6	---	---
Potassium	ppm	ASTM D5185(m)	>20	3	---	---
Fuel		WC Method	>5	<1.0	---	---
Water		WC Method	>0.2	NEG	---	---
Glycol		WC Method		NEG	---	---
Soot %	%	ASTM D7844*	>3	0	---	---
Nitration	Abs/cm	ASTM D7624*	>20	8.6	---	---
Sulfation	Abs/.1mm	ASTM D7415*	>30	19.8	---	---
Silt	scalar	Visual*	NONE	NONE	---	---
Debris	scalar	Visual*	NONE	VLITE	---	---
Sand/Dirt	scalar	Visual*	NONE	NONE	---	---
Appearance	scalar	Visual*	NORML	NORML	---	---
Odor	scalar	Visual*	NORML	NORML	---	---
Emulsified Water	scalar	Visual*	>0.2	NEG	---	---

FLUID CONDITION

La viscosité de l'échantillon se situe dans la portée de l'SAE 40; nous vous conseillons de vérifier. L'état de l'huile est acceptable pour la durée de service.

Sodium	ppm	ASTM D5185(m)		3	---	---
Boron	ppm	ASTM D5185(m)	250	25	---	---
Barium	ppm	ASTM D5185(m)	10	0	---	---
Molybdenum	ppm	ASTM D5185(m)	100	29	---	---
Manganese	ppm	ASTM D5185(m)		<1	---	---
Magnesium	ppm	ASTM D5185(m)	450	138	---	---
Calcium	ppm	ASTM D5185(m)	3000	2306	---	---
Phosphorus	ppm	ASTM D5185(m)	1150	974	---	---
Zinc	ppm	ASTM D5185(m)	1350	1141	---	---
Sulfur	ppm	ASTM D5185(m)	4250	2922	---	---
Oxidation	Abs/.1mm	ASTM D7414*	>25	14.7	---	---
Visc @ 100°C	cSt	ASTM D7279(m)	10.9	13.3	---	---

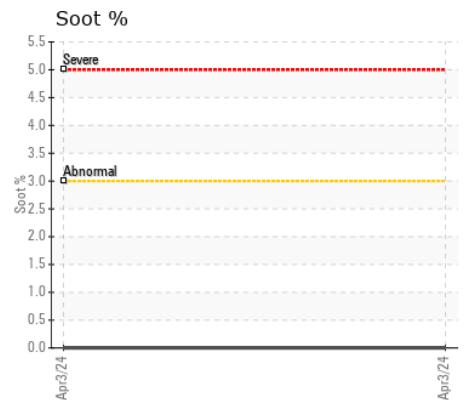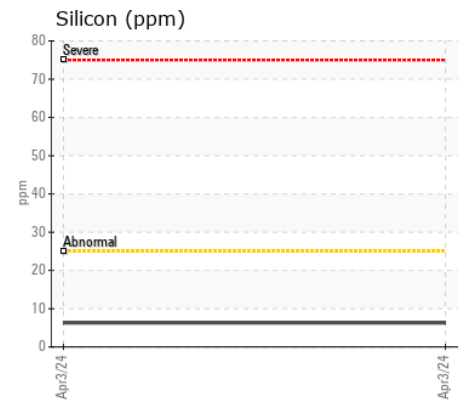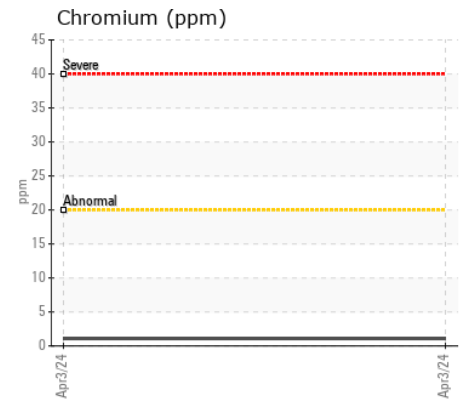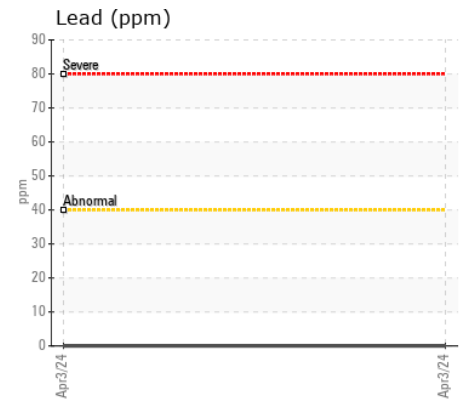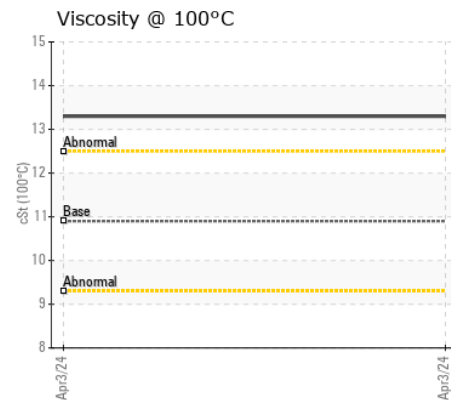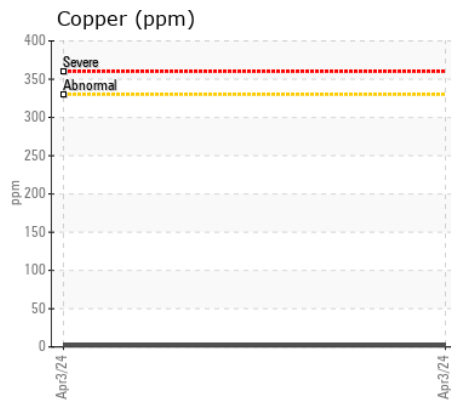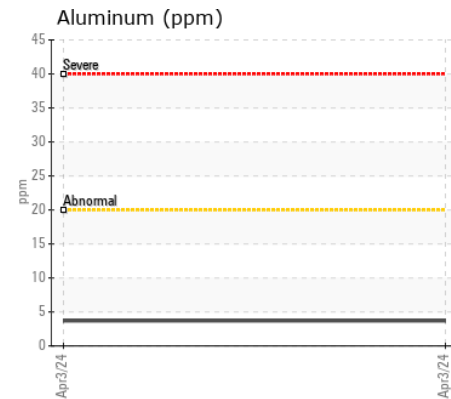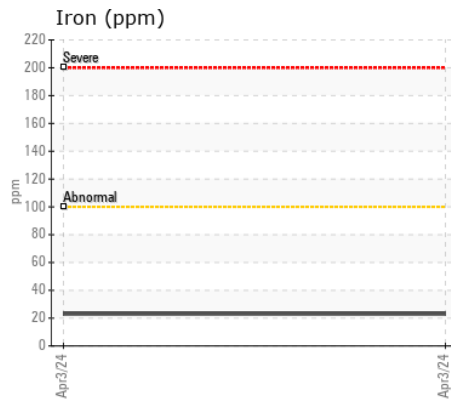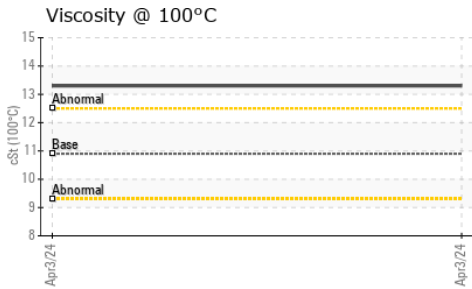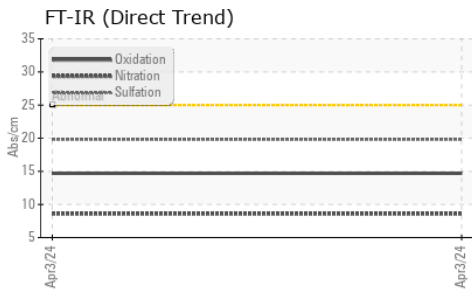

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : GFL0114918 **Received** : 09 Apr 2024
Lab Number : 02627618 **Tested** : 09 Apr 2024
Unique Number : 5760750 **Diagnosed** : 09 Apr 2024 - Kevin Marson
Test Package : MOB 1 (Additional Tests: Visual)

GFL Environmental - 780 - GMA - ICI - Solid Waste
 4365 boul. St-Elzear Ouest,
 Laval, QC
 CA H7P 4J3
 Contact: Pieces Laval
 pieces.laval@gflenv.com
 T: (450)687-3838
 F:

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.