



Machine Id
OR1043
Component
Hydraulic System
Fluid
{not provided} (--- GAL)

RECOMMENDATION

Nous avons pris note que le filtre a été remplacé au moment de l'échantillonnage. Nous vous recommandons d'échantillonner de nouveau dès que possible afin de contrôler la situation. Le fluide n'était pas spécifié, toutefois, une comparaison avec d'autres fluides indiquent que ce fluide est du ISO 32 AW Hydraulic Oil. Veuillez confirmer la viscosité de l'huile et veuillez préciser la marque de votre prochain échantillon.

WEAR

Les taux d'usure de tous les composants sont normaux.








CONTAMINATION

Il y a une quantité modérée de particules (de 4 à 14 microns) dans l'huile.

FLUID CONDITION

La viscosité de l'échantillon se situe dans la portée de l'ISO 32; nous vous conseillons de vérifier. L'huile peut encore servir si la contamination peut être réduite à un niveau acceptable.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		GFL0093670	---	---
Sample Date		Client Info		09 Apr 2024	---	---
Machine Age	hrs	Client Info		12992	---	---
Oil Age	hrs	Client Info		0	---	---
Filter Age	hrs	Client Info		0	---	---
Oil Changed		Client Info		N/A	---	---
Filter Changed		Client Info		Changed	---	---
Sample Status				ABNORMAL	---	---
Iron	ppm	ASTM D5185(m)	>20	19	---	---
Chromium	ppm	ASTM D5185(m)	>10	1	---	---
Nickel	ppm	ASTM D5185(m)	>10	0	---	---
Titanium	ppm	ASTM D5185(m)		0	---	---
Silver	ppm	ASTM D5185(m)		0	---	---
Aluminum	ppm	ASTM D5185(m)	>10	1	---	---
Lead	ppm	ASTM D5185(m)	>10	0	---	---
Copper	ppm	ASTM D5185(m)	>75	1	---	---
Tin	ppm	ASTM D5185(m)	>10	0	---	---
Vanadium	ppm	ASTM D5185(m)		0	---	---
White Metal	scalar	Visual*	NONE	NONE	---	---
Yellow Metal	scalar	Visual*	NONE	NONE	---	---
Silicon	ppm	ASTM D5185(m)	>20	2	---	---
Potassium	ppm	ASTM D5185(m)	>20	1	---	---
Water		WC Method	>0.1	NEG	---	---
Particles >4µm		ASTM D7647	>5000	▲ 28867	---	---
Particles >6µm		ASTM D7647	>1300	▲ 3283	---	---
Particles >14µm		ASTM D7647	>160	● 320	---	---
Particles >21µm		ASTM D7647	>40	● 77	---	---
Particles >38µm		ASTM D7647	>10	3	---	---
Particles >71µm		ASTM D7647	>3	1	---	---
Oil Cleanliness		ISO 4406 (c)	>19/17/14	▲ 22/19/15	---	---
Silt	scalar	Visual*	NONE	NONE	---	---
Debris	scalar	Visual*	NONE	VLITE	---	---
Sand/Dirt	scalar	Visual*	NONE	NONE	---	---
Appearance	scalar	Visual*	NORML	NORML	---	---
Odor	scalar	Visual*	NORML	NORML	---	---
Emulsified Water	scalar	Visual*	>0.1	NEG	---	---
Sodium	ppm	ASTM D5185(m)		1	---	---
Boron	ppm	ASTM D5185(m)		<1	---	---
Barium	ppm	ASTM D5185(m)		<1	---	---
Molybdenum	ppm	ASTM D5185(m)		0	---	---
Manganese	ppm	ASTM D5185(m)		0	---	---
Magnesium	ppm	ASTM D5185(m)		2	---	---
Calcium	ppm	ASTM D5185(m)		196	---	---
Phosphorus	ppm	ASTM D5185(m)		372	---	---
Zinc	ppm	ASTM D5185(m)		475	---	---
Sulfur	ppm	ASTM D5185(m)		974	---	---
Visc @ 40°C	cSt	ASTM D7279(m)		32.3	---	---

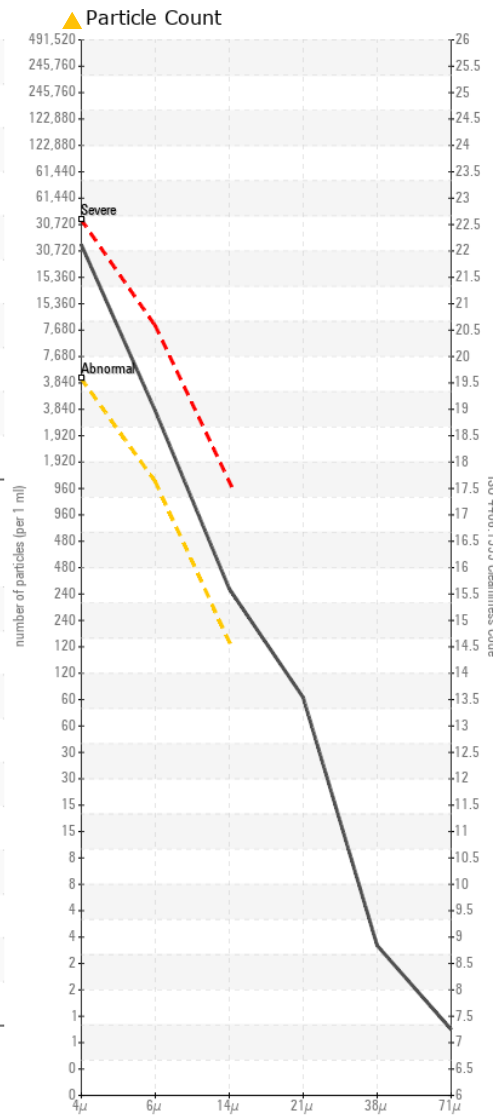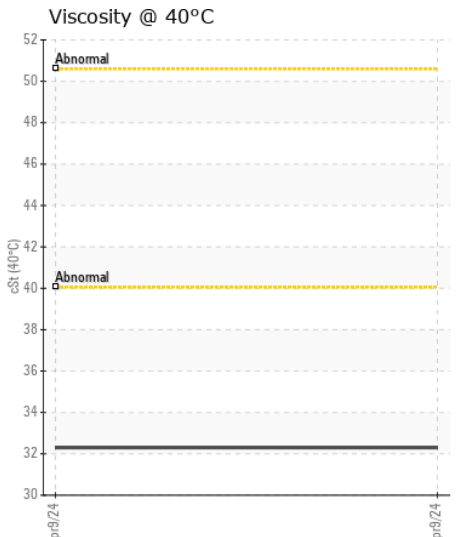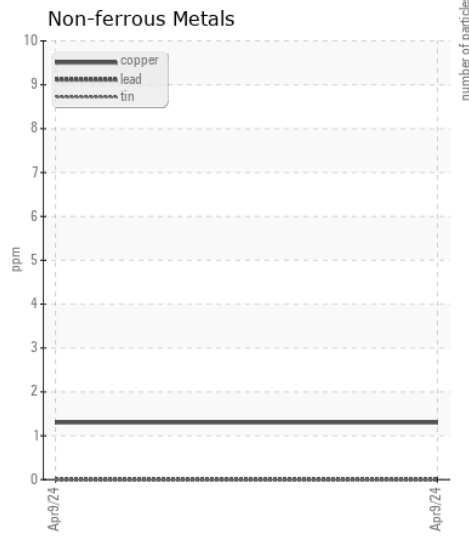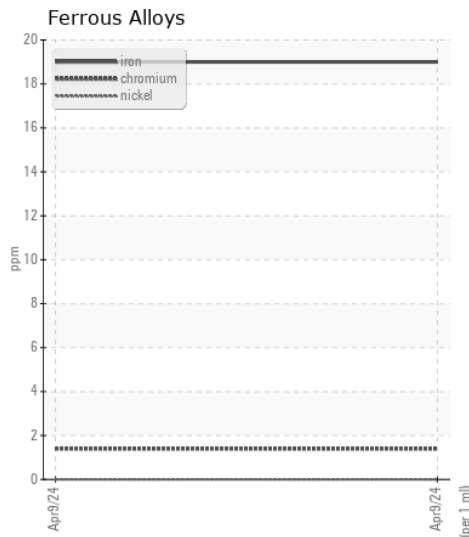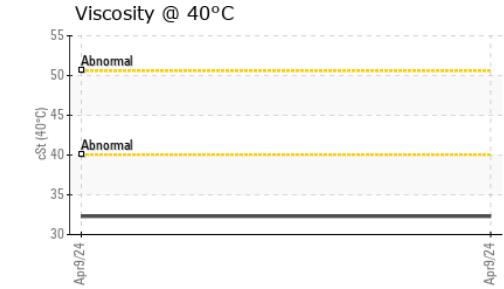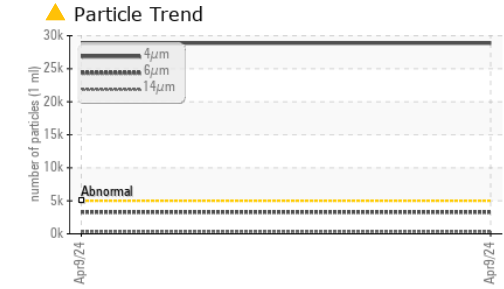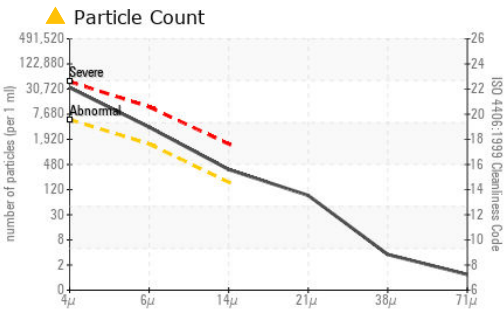

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : GFL0093670
Lab Number : 02628488
Unique Number : 5761620
Test Package : MOB 1 (Additional Tests: PrtCount)

GFL Environmental - 769 - Drummondville CD
 1005 rue Rhea
 Drummondville, QC
 CA J2B 8A9
 Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

T:
F: