



WEAR	<b>NORMAL</b>
CONTAMINATION	<b>ABNORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Area  
**(L953440)**  
Machine Id  
**822055**  
Component  
**Hydraulic System**  
Fluid  
**PETRO CANADA HYDREX MV 32 (--- GAL)**

**RECOMMENDATION**

Nous avons pris note que le filtre a été remplacé au moment de l'échantillonnage. Nous vous recommandons d'échantillonner de nouveau dès que possible afin de contrôler la situation.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>GFL0081647</b>	---	---
Sample Date		Client Info		<b>11 Apr 2024</b>	---	---
Machine Age	hrs	Client Info		<b>1843</b>	---	---
Oil Age	hrs	Client Info		<b>0</b>	---	---
Filter Age	hrs	Client Info		<b>1200</b>	---	---
Oil Changed		Client Info		<b>Filtered</b>	---	---
Filter Changed		Client Info		<b>Changed</b>	---	---
Sample Status				<b>ABNORMAL</b>	---	---

**WEAR**

Les taux d'usure de tous les composants sont normaux.

Iron	ppm	ASTM D5185(m)	>40	<b>8</b>	---	---
Chromium	ppm	ASTM D5185(m)	>5	<b>0</b>	---	---
Nickel	ppm	ASTM D5185(m)	>2	<b>0</b>	---	---
Titanium	ppm	ASTM D5185(m)	>2	<b>0</b>	---	---
Silver	ppm	ASTM D5185(m)		<b>1</b>	---	---
Aluminum	ppm	ASTM D5185(m)	>8	<b>&lt;1</b>	---	---
Lead	ppm	ASTM D5185(m)	>5	<b>0</b>	---	---
Copper	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	---	---
Tin	ppm	ASTM D5185(m)	>2	<b>0</b>	---	---
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	---	---
White Metal	scalar	Visual*	NONE	<b>NONE</b>	---	---
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	---	---

**CONTAMINATION**








Il y a une quantité modérée de particules (de 4 à 14 microns) dans l'huile.

Silicon	ppm	ASTM D5185(m)	>20	<b>0</b>	---	---
Potassium	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	---	---
Water		WC Method	>0.1	<b>NEG</b>	---	---
Particles >4µm		ASTM D7647	>5000	<b>▲ 25396</b>	---	---
Particles >6µm		ASTM D7647	>1300	<b>468</b>	---	---
Particles >14µm		ASTM D7647	>160	<b>8</b>	---	---
Particles >21µm		ASTM D7647	>40	<b>3</b>	---	---
Particles >38µm		ASTM D7647	>10	<b>1</b>	---	---
Particles >71µm		ASTM D7647	>3	<b>1</b>	---	---
Oil Cleanliness		ISO 4406 (c)	>19/17/14	<b>▲ 22/16/10</b>	---	---
Silt	scalar	Visual*	NONE	<b>NONE</b>	---	---
Debris	scalar	Visual*	NONE	<b>NONE</b>	---	---
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	---	---
Appearance	scalar	Visual*	NORML	<b>NORML</b>	---	---
Odor	scalar	Visual*	NORML	<b>NORML</b>	---	---
Emulsified Water	scalar	Visual*	>0.1	<b>NEG</b>	---	---

**FLUID CONDITION**

l'huile peut encore servir si la contamination peut être réduite à un niveau acceptable.

Sodium	ppm	ASTM D5185(m)		<b>1</b>	---	---
Boron	ppm	ASTM D5185(m)	0	<b>3</b>	---	---
Barium	ppm	ASTM D5185(m)	0	<b>0</b>	---	---
Molybdenum	ppm	ASTM D5185(m)	0	<b>&lt;1</b>	---	---
Manganese	ppm	ASTM D5185(m)	1	<b>0</b>	---	---
Magnesium	ppm	ASTM D5185(m)	0	<b>38</b>	---	---
Calcium	ppm	ASTM D5185(m)	50	<b>99</b>	---	---
Phosphorus	ppm	ASTM D5185(m)	330	<b>345</b>	---	---
Zinc	ppm	ASTM D5185(m)	430	<b>437</b>	---	---
Sulfur	ppm	ASTM D5185(m)	760	<b>875</b>	---	---
Visc @ 40°C	cSt	ASTM D7279(m)	31.9	<b>32.2</b>	---	---

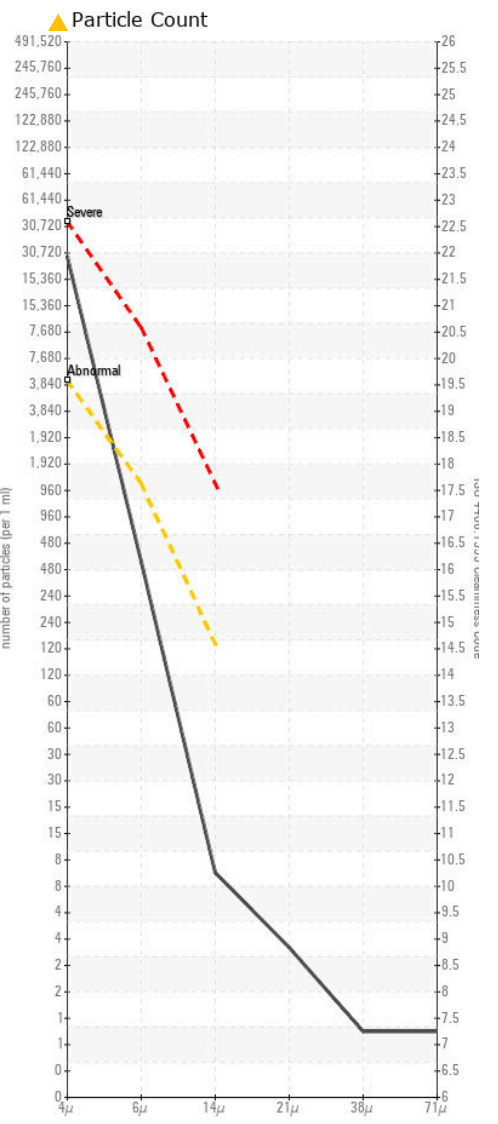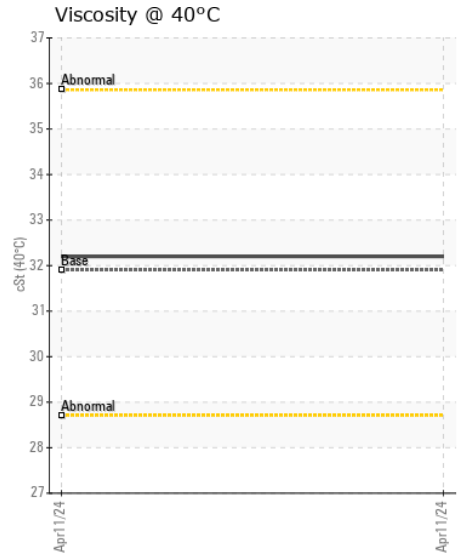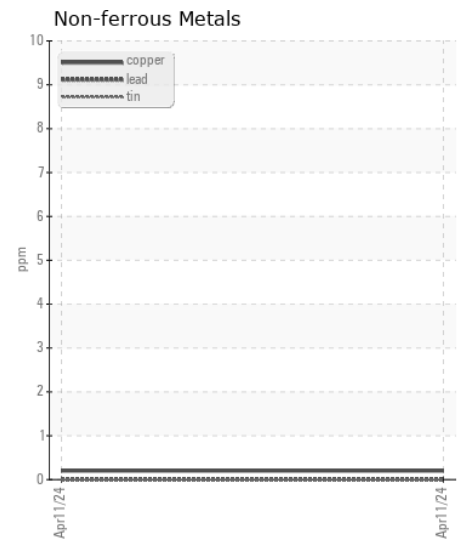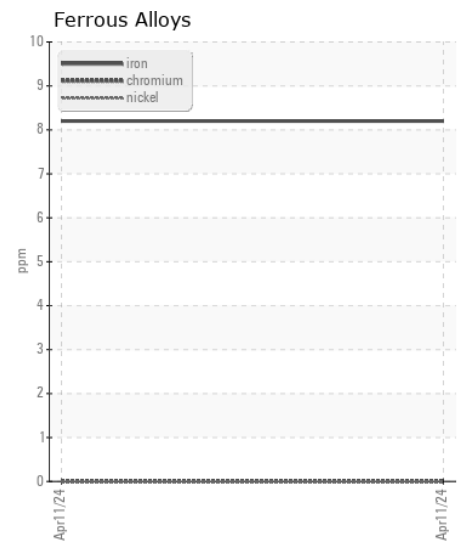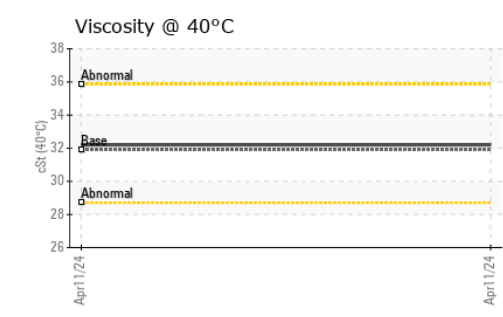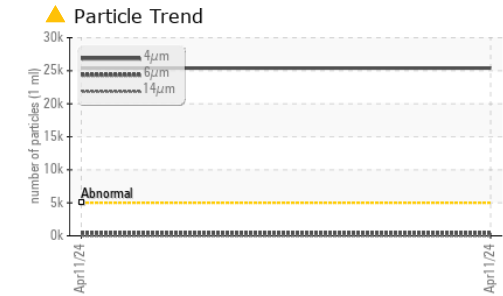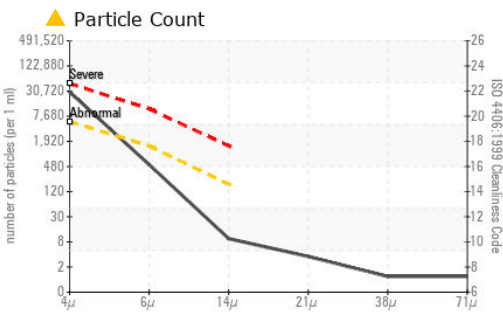

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : GFL0081647 **Received** : 15 Apr 2024  
**Lab Number** : 02628884 **Tested** : 16 Apr 2024  
**Unique Number** : 5762016 **Diagnosed** : 16 Apr 2024 - Wes Davis  
**Test Package** : MOB 1 ( Additional Tests: PrtCount )

**GFL Environmental - 774**  
 169 Route 117  
 Mont-Tremblant, QC  
 CA J8E 1A1  
 Contact: Stephane Filteau  
 sfilteau@matrec.ca  
 T:  
 F:

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.