



WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>ABNORMAL</b>

Area

**[85591]**

Machine Id

**103 PUGSLEY AVE RICHMOND HILL YORK REGION YORK REGION**

Component

**Diesel Engine**

Fluid

**ESSO XD-3 EXTRA 15W40 (--- GAL)**

**RECOMMENDATION**

The oil change at the time of sampling has been noted. Resample at the next service interval to monitor. No other corrective action is recommended at this time.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>PN0006048</b>	---	---
Sample Date		Client Info		<b>09 Apr 2024</b>	---	---
Machine Age	hrs	Client Info		<b>329</b>	---	---
Oil Age	hrs	Client Info		<b>0</b>	---	---
Filter Age	hrs	Client Info		<b>0</b>	---	---
Oil Changed		Client Info		<b>Changed</b>	---	---
Filter Changed		Client Info		<b>Not Changd</b>	---	---
Sample Status				<b>ABNORMAL</b>	---	---

**WEAR**

Metal levels are typical for a new component breaking in.

Iron	ppm	ASTM D5185(m)	>100	<b>4</b>	---	---
Chromium	ppm	ASTM D5185(m)	>20	<b>0</b>	---	---
Nickel	ppm	ASTM D5185(m)	>2	<b>0</b>	---	---
Titanium	ppm	ASTM D5185(m)	>2	<b>0</b>	---	---
Silver	ppm	ASTM D5185(m)	>2	<b>0</b>	---	---
Aluminum	ppm	ASTM D5185(m)	>25	<b>&lt;1</b>	---	---
Lead	ppm	ASTM D5185(m)	>40	<b>0</b>	---	---
Copper	ppm	ASTM D5185(m)	>330	<b>1</b>	---	---
Tin	ppm	ASTM D5185(m)	>15	<b>&lt;1</b>	---	---
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	---	---
White Metal	scalar	Visual*	NONE	<b>NONE</b>	---	---
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	---	---

**CONTAMINATION**












Light fuel dilution occurring. No other contaminants were detected in the oil.

Silicon	ppm	ASTM D5185(m)	>25	<b>6</b>	---	---
Potassium	ppm	ASTM D5185(m)	>20	<b>0</b>	---	---
Fuel	%	ASTM D7593*	>5	<b>1.6</b>	---	---
Water		WC Method	>0.2	<b>NEG</b>	---	---
Glycol		WC Method		<b>NEG</b>	---	---
Soot %	%	ASTM D7844*	>3	<b>0</b>	---	---
Nitration	Abs/cm	ASTM D7624*	>20	<b>5.7</b>	---	---
Sulfation	Abs/.1mm	ASTM D7415*	>30	<b>22.6</b>	---	---
Silt	scalar	Visual*	NONE	<b>NONE</b>	---	---
Debris	scalar	Visual*	NONE	<b>NONE</b>	---	---
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	---	---
Appearance	scalar	Visual*	NORML	<b>NORML</b>	---	---
Odor	scalar	Visual*	NORML	<b>NORML</b>	---	---
Emulsified Water	scalar	Visual*	>0.2	<b>NEG</b>	---	---

**FLUID CONDITION**

Viscosity of sample indicates oil is within SAE 30 range, advise investigate. The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)	>192	<b>3</b>	---	---
Boron	ppm	ASTM D5185(m)		<b>55</b>	---	---
Barium	ppm	ASTM D5185(m)		<b>0</b>	---	---
Molybdenum	ppm	ASTM D5185(m)		<b>40</b>	---	---
Manganese	ppm	ASTM D5185(m)		<b>&lt;1</b>	---	---
Magnesium	ppm	ASTM D5185(m)		<b>521</b>	---	---
Calcium	ppm	ASTM D5185(m)	3780	<b>1669</b>	---	---
Phosphorus	ppm	ASTM D5185(m)	1370	<b>930</b>	---	---
Zinc	ppm	ASTM D5185(m)	1500	<b>1061</b>	---	---
Sulfur	ppm	ASTM D5185(m)	3800	<b>2459</b>	---	---
Oxidation	Abs/.1mm	ASTM D7414*	>25	<b>20.5</b>	---	---
Visc @ 100°C	cSt	ASTM D7279(m)	15.4	<b>▲ 11.0</b>	---	---

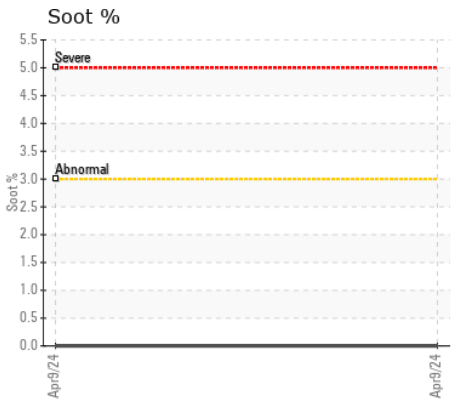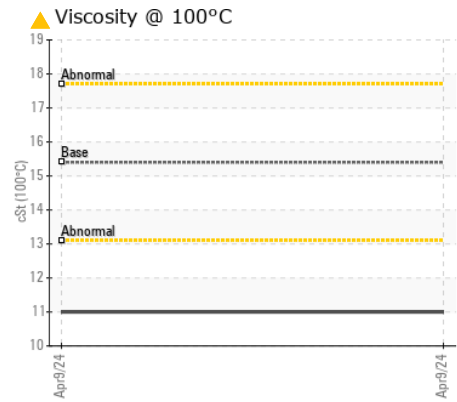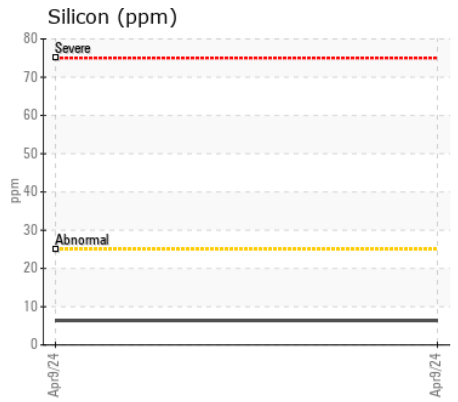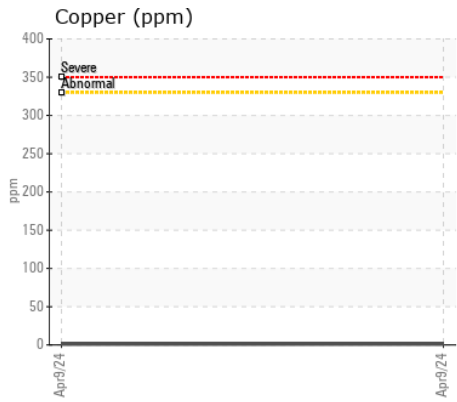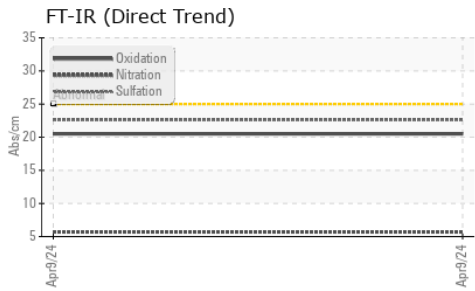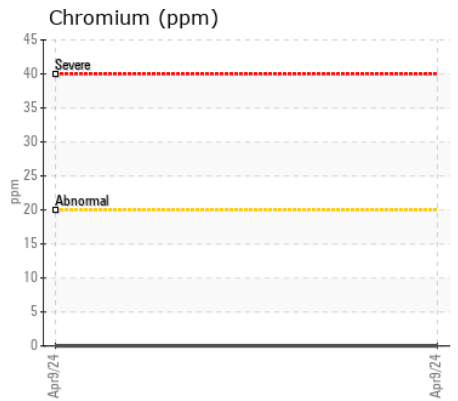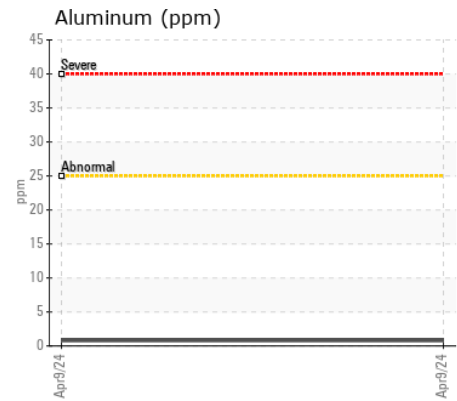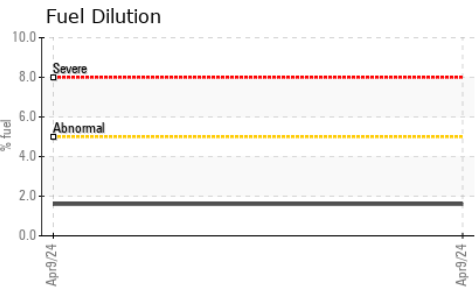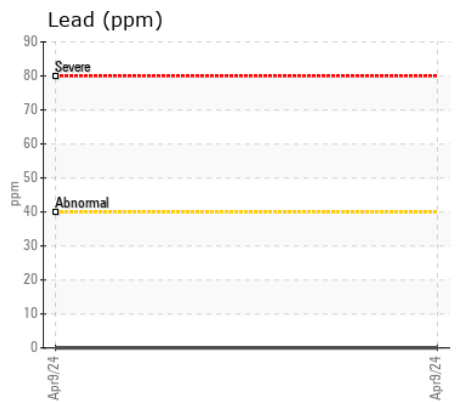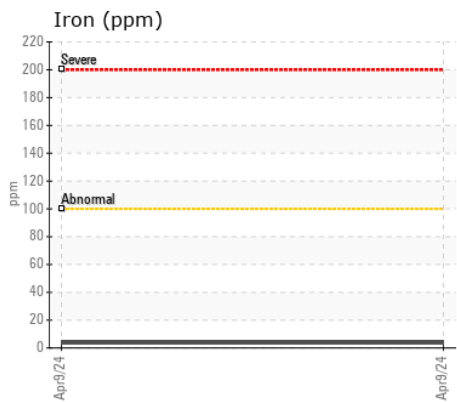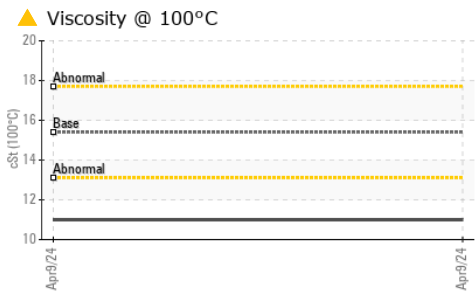

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : PN0006048 **Received** : 17 Apr 2024  
**Lab Number** : 02629489 **Tested** : 18 Apr 2024  
**Unique Number** : 5762621 **Diagnosed** : 18 Apr 2024 - Kevin Marson  
**Test Package** : MOB 1 ( Additional Tests: FuelDilution, PercentFuel, Visual )

**POWER STATION INC.**  
 1050 JAYSON COURT  
 MISSISSAUGA, ON  
 CA L4W 2V5  
 Contact: Brett Kinkley  
 Bkinkley@pwrstn.com  
 T:  
 F: (905)565-8544

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.