



LIEBHERR

OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL



Machine Id
LIEBHERR LH22M 158368-1250
Component
Front Differential
Fluid
{not provided} (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor. The fluid was not specified, however, a fluid match indicates that this fluid is SAE 80 Tractor TDH Fluid. Please confirm the oil type and grade, and specify the brand of the oil on your next sample.

WEAR

All component wear rates are normal.










CONTAMINATION

There is no indication of any contamination in the oil.

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		LH0284727	---	---
Sample Date		Client Info		10 Apr 2024	---	---
Machine Age	hrs	Client Info		500	---	---
Oil Age	hrs	Client Info		0	---	---
Filter Age	hrs	Client Info		0	---	---
Oil Changed		Client Info		N/A	---	---
Filter Changed		Client Info		N/A	---	---
Sample Status				NORMAL	---	---
Iron	ppm	ASTM D5185(m)	>150	20	---	---
Chromium	ppm	ASTM D5185(m)	>5	0	---	---
Nickel	ppm	ASTM D5185(m)	>10	0	---	---
Titanium	ppm	ASTM D5185(m)		0	---	---
Silver	ppm	ASTM D5185(m)		0	---	---
Aluminum	ppm	ASTM D5185(m)	>5	<1	---	---
Lead	ppm	ASTM D5185(m)	>5	0	---	---
Copper	ppm	ASTM D5185(m)	>125	1	---	---
Tin	ppm	ASTM D5185(m)	>5	0	---	---
Vanadium	ppm	ASTM D5185(m)		0	---	---
White Metal	scalar	Visual*	NONE	NONE	---	---
Yellow Metal	scalar	Visual*	NONE	NONE	---	---
Silicon	ppm	ASTM D5185(m)	>20	9	---	---
Potassium	ppm	ASTM D5185(m)	>20	<1	---	---
Water		WC Method	>0.2	NEG	---	---
Silt	scalar	Visual*	NONE	NONE	---	---
Debris	scalar	Visual*	NONE	NONE	---	---
Sand/Dirt	scalar	Visual*	NONE	NONE	---	---
Appearance	scalar	Visual*	NORML	NORML	---	---
Odor	scalar	Visual*	NORML	NORML	---	---
Emulsified Water	scalar	Visual*	>0.2	NEG	---	---
Sodium	ppm	ASTM D5185(m)		15	---	---
Boron	ppm	ASTM D5185(m)		106	---	---
Barium	ppm	ASTM D5185(m)		2	---	---
Molybdenum	ppm	ASTM D5185(m)		0	---	---
Manganese	ppm	ASTM D5185(m)		10	---	---
Magnesium	ppm	ASTM D5185(m)		11	---	---
Calcium	ppm	ASTM D5185(m)		3648	---	---
Phosphorus	ppm	ASTM D5185(m)		1139	---	---
Zinc	ppm	ASTM D5185(m)		1419	---	---
Sulfur	ppm	ASTM D5185(m)		2815	---	---
Visc @ 40°C	cSt	ASTM D7279(m)		65.1	---	---

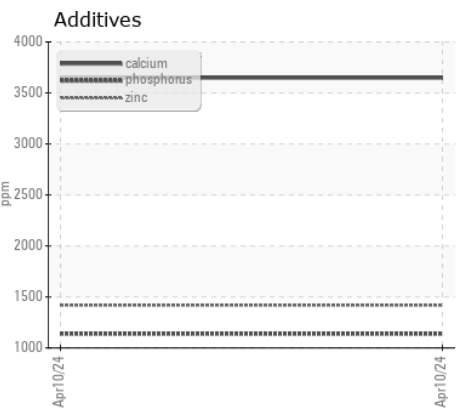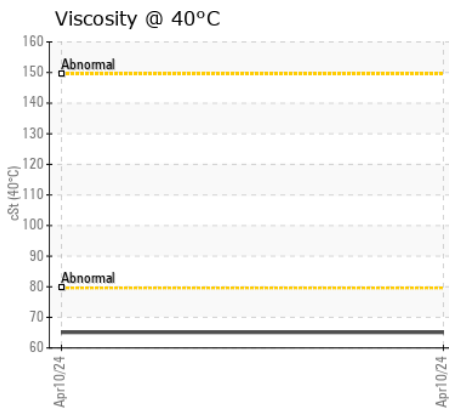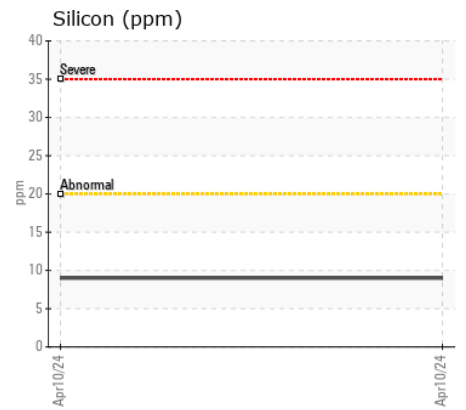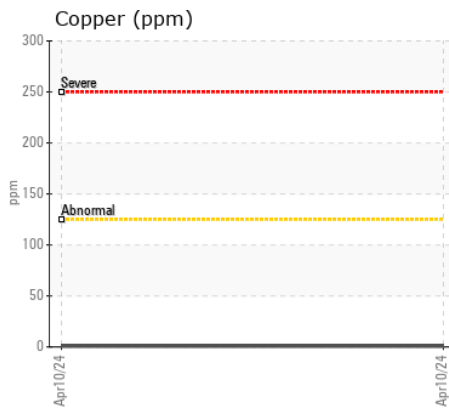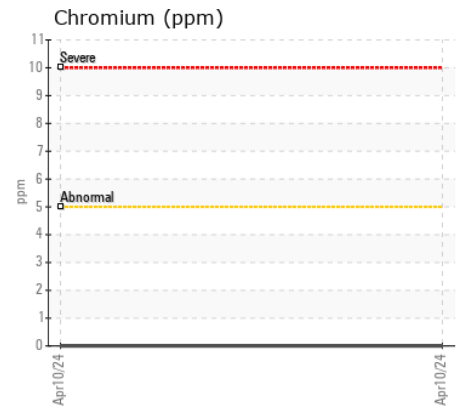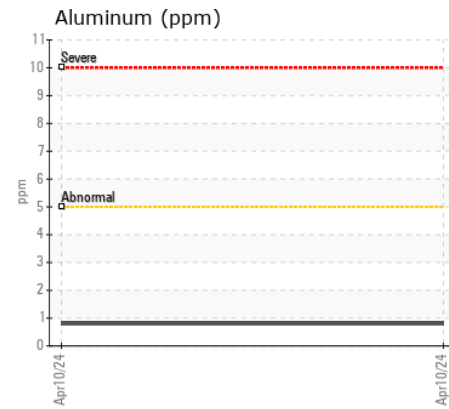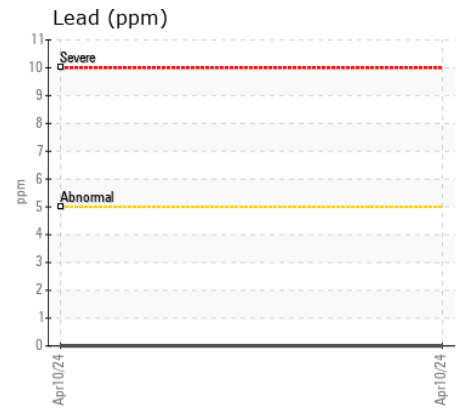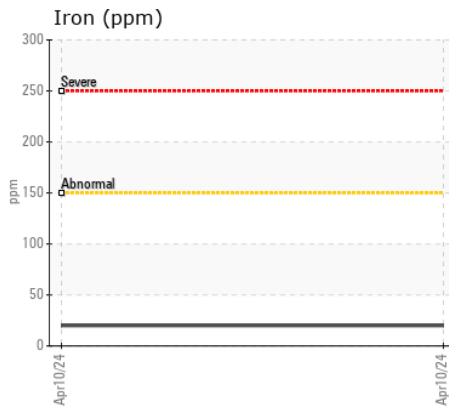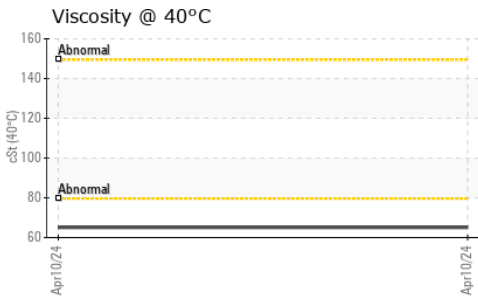

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : LH0284727
Lab Number : 02629725
Unique Number : 5762857
Test Package : MOBCE (Additional Tests: Visual)
Received : 17 Apr 2024
Tested : 17 Apr 2024
Diagnosed : 17 Apr 2024 - Wes Davis

BELLEMARE RECYCLAGE - SABLE DES FORGES INC
 8750 BOUL INDUSTRIEL
 TROIS-RIVIERES, QC
 CA G9A 5E1
 Contact: Sacha Bellemare
 sachabellemare@groupebellemare.com
 T: (819)296-3767
 F: (819)296-1116

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.