



# LIEBHERR

## OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Machine Id  
**LIEBHERR LH22M 158368-1250**  
Component  
**Rear Right Wheel Hub**  
Fluid  
**{not provided} (--- GAL)**

### RECOMMENDATION

Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>LH0284725</b>	---	---
Sample Date		Client Info		<b>10 Apr 2024</b>	---	---
Machine Age	hrs	Client Info		<b>500</b>	---	---
Oil Age	hrs	Client Info		<b>0</b>	---	---
Filter Age	hrs	Client Info		<b>0</b>	---	---
Oil Changed		Client Info		<b>N/A</b>	---	---
Filter Changed		Client Info		<b>N/A</b>	---	---
Sample Status				<b>NORMAL</b>	---	---

### WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>650	<b>15</b>	---	---
Chromium	ppm	ASTM D5185(m)	>4	<b>0</b>	---	---
Nickel	ppm	ASTM D5185(m)	>4	<b>0</b>	---	---
Titanium	ppm	ASTM D5185(m)	>4	<b>0</b>	---	---
Silver	ppm	ASTM D5185(m)		<b>0</b>	---	---
Aluminum	ppm	ASTM D5185(m)	>25	<b>&lt;1</b>	---	---
Lead	ppm	ASTM D5185(m)	>4	<b>0</b>	---	---
Copper	ppm	ASTM D5185(m)	>60	<b>4</b>	---	---
Tin	ppm	ASTM D5185(m)	>4	<b>0</b>	---	---
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	---	---
White Metal	scalar	Visual*	NONE	<b>VLITE</b>	---	---
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	---	---

### CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>75	<b>5</b>	---	---
Potassium	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	---	---
Water		WC Method	>0.2	<b>NEG</b>	---	---
Silt	scalar	Visual*	NONE	<b>NONE</b>	---	---
Debris	scalar	Visual*	NONE	<b>NONE</b>	---	---
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	---	---
Appearance	scalar	Visual*	NORML	<b>NORML</b>	---	---
Odor	scalar	Visual*	NORML	<b>NORML</b>	---	---
Emulsified Water	scalar	Visual*	>0.2	<b>NEG</b>	---	---

### FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		<b>15</b>	---	---
Boron	ppm	ASTM D5185(m)		<b>104</b>	---	---
Barium	ppm	ASTM D5185(m)		<b>1</b>	---	---
Molybdenum	ppm	ASTM D5185(m)		<b>0</b>	---	---
Manganese	ppm	ASTM D5185(m)		<b>5</b>	---	---
Magnesium	ppm	ASTM D5185(m)		<b>10</b>	---	---
Calcium	ppm	ASTM D5185(m)		<b>3499</b>	---	---
Phosphorus	ppm	ASTM D5185(m)		<b>1138</b>	---	---
Zinc	ppm	ASTM D5185(m)		<b>1406</b>	---	---
Sulfur	ppm	ASTM D5185(m)		<b>2758</b>	---	---
Visc @ 40°C	cSt	ASTM D7279(m)		<b>65.0</b>	---	---

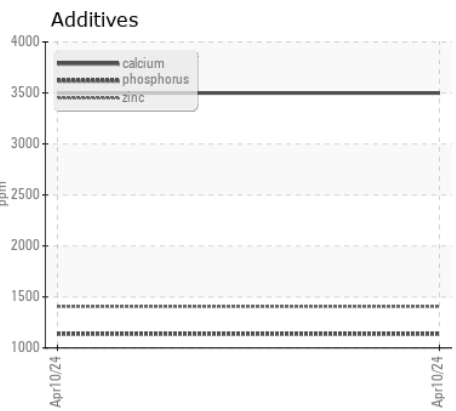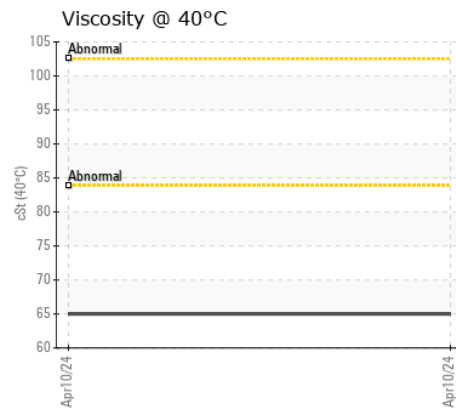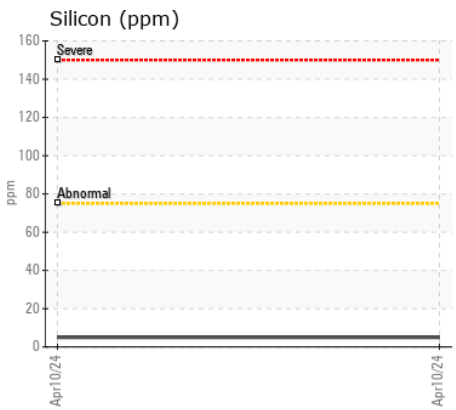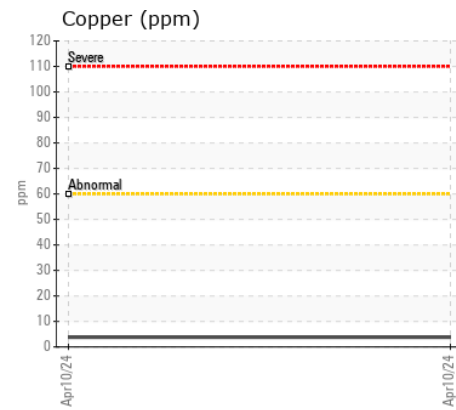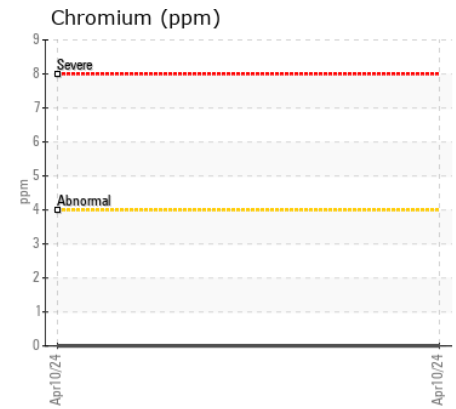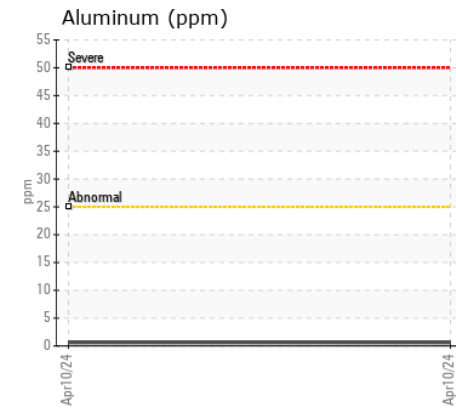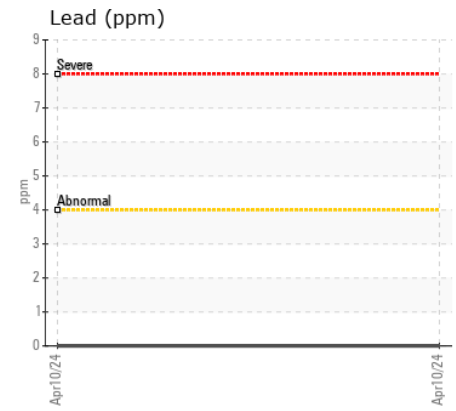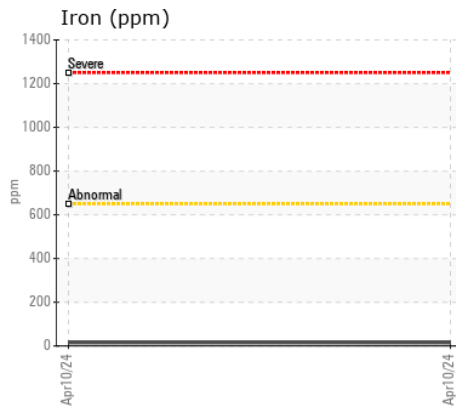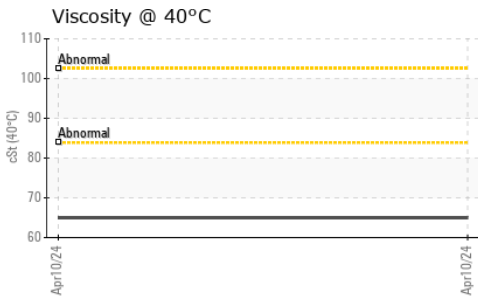

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : LH0284725  
**Lab Number** : 02629729  
**Unique Number** : 5762861  
**Test Package** : MOBCE ( Additional Tests: Visual )

**BELLEMARE RECYCLAGE - SABLE DES FORGES INC**  
 8750 BOUL INDUSTRIEL  
 TROIS-RIVIERES, QC  
 CA G9A 5E1  
 Contact: Sacha Bellemare  
 sachabellemare@groupebellemare.com  
 T: (819)296-3767  
 F: (819)296-1116

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.