



LIEBHERR

OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL



Machine Id
LIEBHERR LH22M 158368-1250
Component
Front Right Wheel Hub
Fluid
{not provided} (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		LH0284723	---	---
Sample Date		Client Info		10 Apr 2024	---	---
Machine Age	hrs	Client Info		500	---	---
Oil Age	hrs	Client Info		0	---	---
Filter Age	hrs	Client Info		0	---	---
Oil Changed		Client Info		N/A	---	---
Filter Changed		Client Info		N/A	---	---
Sample Status				NORMAL	---	---

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>650	47	---	---
Chromium	ppm	ASTM D5185(m)	>4	<1	---	---
Nickel	ppm	ASTM D5185(m)	>4	0	---	---
Titanium	ppm	ASTM D5185(m)	>4	0	---	---
Silver	ppm	ASTM D5185(m)		0	---	---
Aluminum	ppm	ASTM D5185(m)	>25	<1	---	---
Lead	ppm	ASTM D5185(m)	>4	0	---	---
Copper	ppm	ASTM D5185(m)	>60	11	---	---
Tin	ppm	ASTM D5185(m)	>4	0	---	---
Vanadium	ppm	ASTM D5185(m)		0	---	---
White Metal	scalar	Visual*	NONE	NONE	---	---
Yellow Metal	scalar	Visual*	NONE	NONE	---	---

CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>75	5	---	---
Potassium	ppm	ASTM D5185(m)	>20	<1	---	---
Water		WC Method	>0.2	NEG	---	---
Silt	scalar	Visual*	NONE	VLITE	---	---
Debris	scalar	Visual*	NONE	VLITE	---	---
Sand/Dirt	scalar	Visual*	NONE	NONE	---	---
Appearance	scalar	Visual*	NORML	NORML	---	---
Odor	scalar	Visual*	NORML	NORML	---	---
Emulsified Water	scalar	Visual*	>0.2	NEG	---	---

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		15	---	---
Boron	ppm	ASTM D5185(m)		104	---	---
Barium	ppm	ASTM D5185(m)		3	---	---
Molybdenum	ppm	ASTM D5185(m)		0	---	---
Manganese	ppm	ASTM D5185(m)		1	---	---
Magnesium	ppm	ASTM D5185(m)		10	---	---
Calcium	ppm	ASTM D5185(m)		3477	---	---
Phosphorus	ppm	ASTM D5185(m)		1144	---	---
Zinc	ppm	ASTM D5185(m)		1378	---	---
Sulfur	ppm	ASTM D5185(m)		2851	---	---
Visc @ 40°C	cSt	ASTM D7279(m)		65.1	---	---

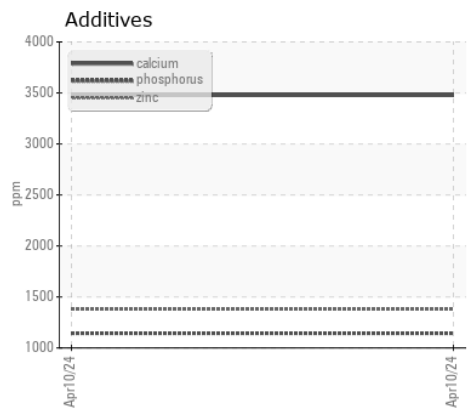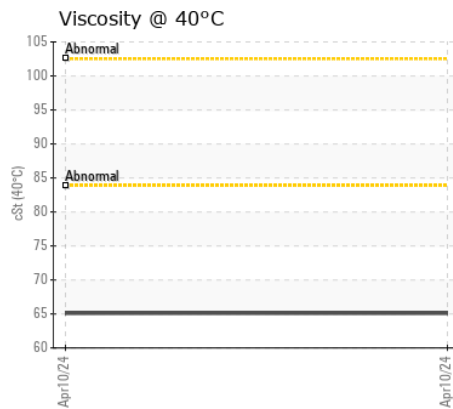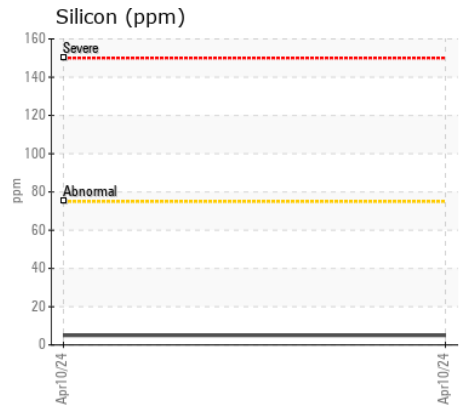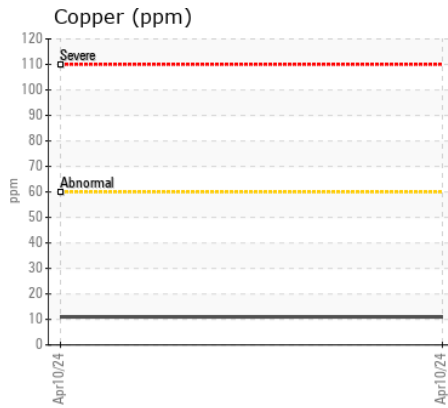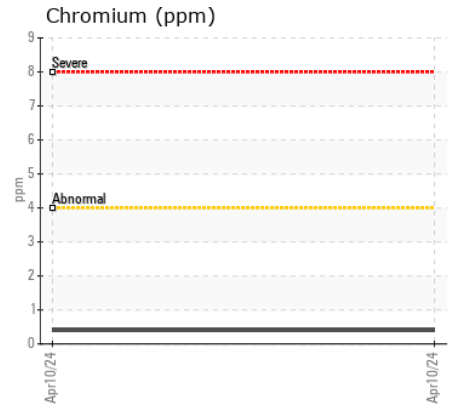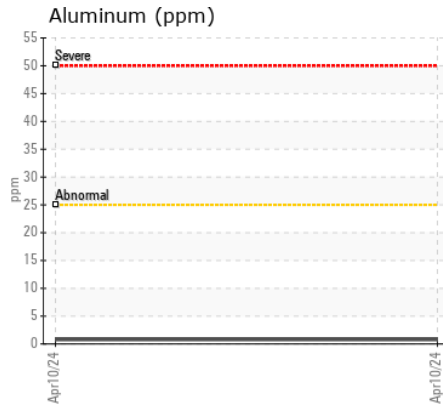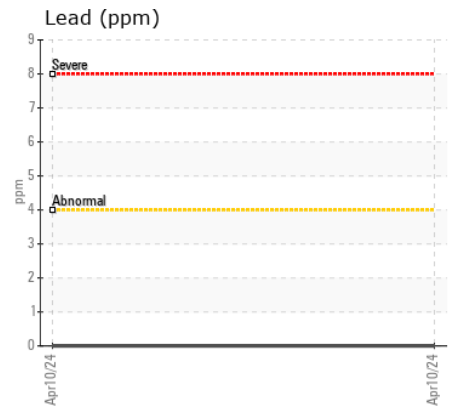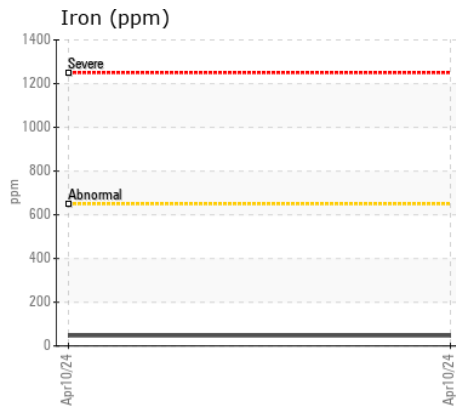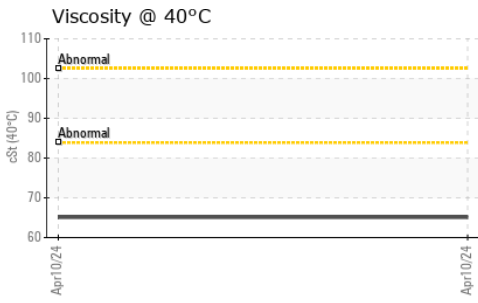

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : LH0284723 **Received** : 17 Apr 2024
Lab Number : 02629731 **Tested** : 17 Apr 2024
Unique Number : 5762863 **Diagnosed** : 17 Apr 2024 - Kevin Marson
Test Package : MOBCE (Additional Tests: Visual)

BELLEMARE RECYCLAGE - SABLE DES FORGES INC
 8750 BOUL INDUSTRIEL
 TROIS-RIVIERES, QC
 CA G9A 5E1
 Contact: Sacha Bellemare
 sachabellemare@groupebellemare.com
 T: (819)296-3767
 F: (819)296-1116

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.