



# LIEBHERR

## OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Area  
**(352940)**  
Machine Id  
**LIEBHERR LH40M 123939-1215**  
Component  
**Rear Left Wheel Hub**  
Fluid  
**GEAR OIL SAE 75W90 (--- GAL)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>LH0286712</b>	LH0251521	LH0227271
Sample Date		Client Info		<b>16 Apr 2024</b>	20 Jan 2023	28 Mar 2022
Machine Age	hrs	Client Info		<b>2235</b>	975	402
Oil Age	hrs	Client Info		<b>0</b>	0	0
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Changed</b>	Changed	Changed
Filter Changed		Client Info		<b>N/A</b>	N/A	N/A
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

### WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>650	<b>13</b>	12	17
Chromium	ppm	ASTM D5185(m)	>4	<b>0</b>	0	<1
Nickel	ppm	ASTM D5185(m)	>4	<b>0</b>	<1	0
Titanium	ppm	ASTM D5185(m)	>4	<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)		<b>0</b>	0	<1
Aluminum	ppm	ASTM D5185(m)	>25	<b>0</b>	<1	<1
Lead	ppm	ASTM D5185(m)	>4	<b>0</b>	<1	<1
Copper	ppm	ASTM D5185(m)	>60	<b>30</b>	20	13
Tin	ppm	ASTM D5185(m)	>4	<b>0</b>	0	0
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
White Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	VLITE
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE

### CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>75	<b>&lt;1</b>	4	7
Potassium	ppm	ASTM D5185(m)	>20	<b>0</b>	1	1
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Silt	scalar	Visual*	NONE	<b>VLITE</b>	NONE	NONE
Debris	scalar	Visual*	NONE	<b>VLITE</b>	NONE	VLITE
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	Visual*	>0.2	<b>NEG</b>	NEG	NEG

### FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		<b>1</b>	4	6
Boron	ppm	ASTM D5185(m)	400	<b>309</b>	251	8
Barium	ppm	ASTM D5185(m)	200	<b>0</b>	0	1
Molybdenum	ppm	ASTM D5185(m)	12	<b>0</b>	<1	2
Manganese	ppm	ASTM D5185(m)		<b>&lt;1</b>	<1	<1
Magnesium	ppm	ASTM D5185(m)	12	<b>2</b>	1	3
Calcium	ppm	ASTM D5185(m)	150	<b>17</b>	49	201
Phosphorus	ppm	ASTM D5185(m)	1650	<b>1255</b>	1425	2202
Zinc	ppm	ASTM D5185(m)	125	<b>27</b>	26	39
Sulfur	ppm	ASTM D5185(m)	22500	<b>20427</b>	21385	23498
Visc @ 40°C	cSt	ASTM D7279(m)	109	<b>102</b>	111	151

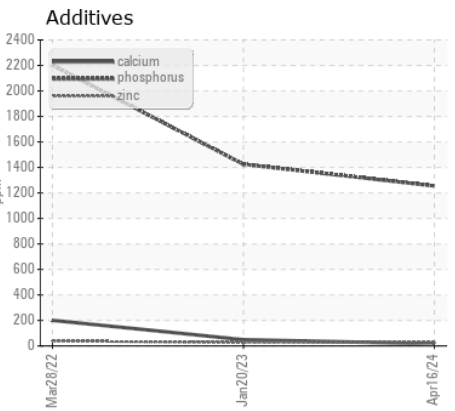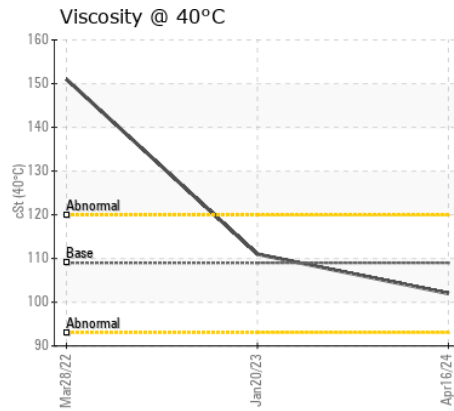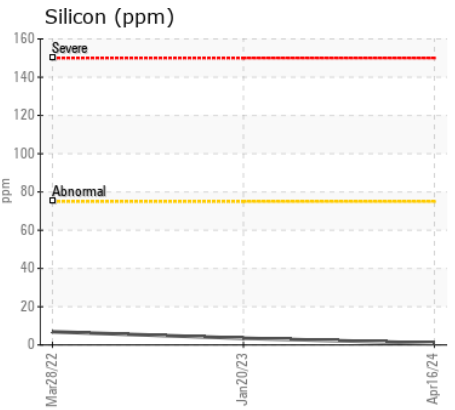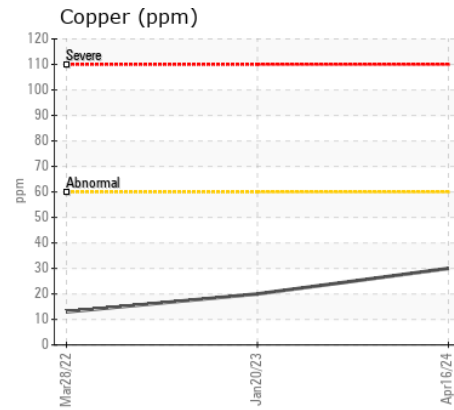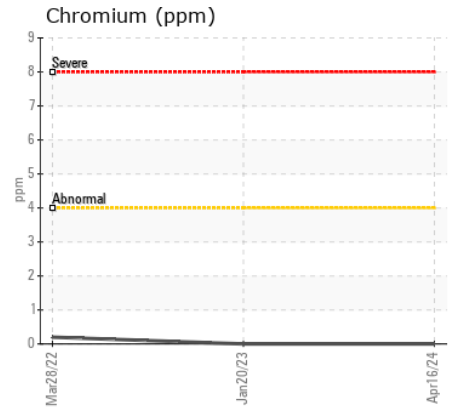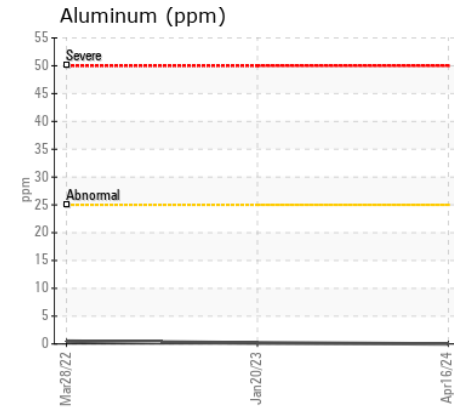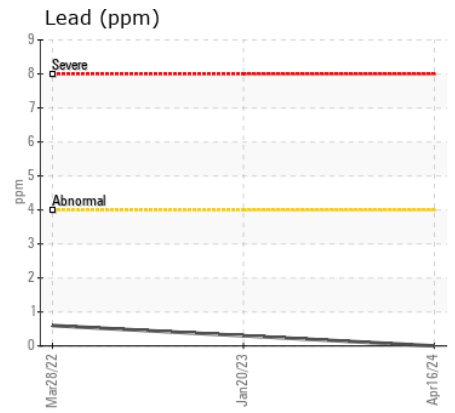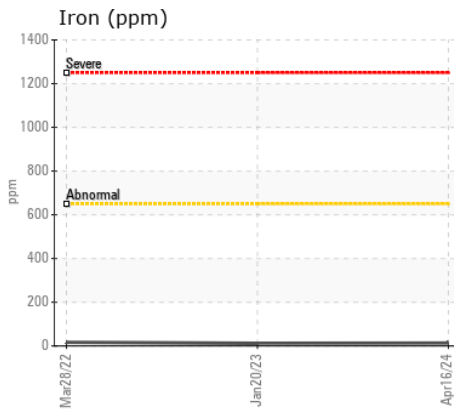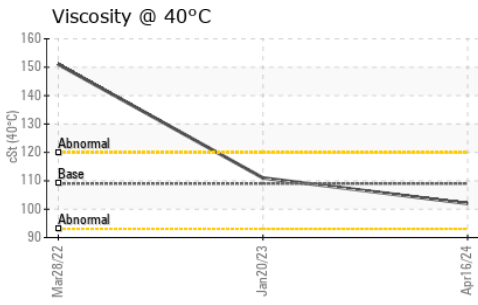

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : LH0286712 **Received** : 17 Apr 2024  
**Lab Number** : 02629773 **Tested** : 18 Apr 2024  
**Unique Number** : 5762905 **Diagnosed** : 18 Apr 2024 - Wes Davis  
**Test Package** : MOB 1

**PORT PERRY SALVAGE**  
 132 REACH INDUSTRIAL PARK  
 PORT PERRY, ON  
 CA L9L 1B2  
 Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.

T:  
F: