

OIL ANALYSIS REPORT

WEAR CONTAMINATION FLUID CONDITION

NORMAL NORMAL

Area


(CFIOA) OREA AIRWAYS [53191]


[CFIOA] FAIRCHILD SA227AT P-44372 (S/N AT-492)


Right Jet Turbine


EASTMAN TURBO OIL 2380 (--- GAL)


RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
This is a baseline read-out on the submitted sample.	Sample Number		Client Info		GT57676	GT57691	GT57689
	Sample Date		Client Info		15 Apr 2024	30 Mar 2024	12 Mar 2024
	Machine Age	hrs	Client Info		0	0	0
	Oil Age	hrs	Client Info		502	423	347
	Filter Age	hrs	Client Info		72	76	92
	Oil Changed		Client Info		N/A	N/A	N/A
	Filter Changed		Client Info		N/A	N/A	N/A
	Sample Status				NORMAL		
WEAR	Iron	ppm	ASTM D5185(m)	>8	0	0	0
	Chromium	ppm	ASTM D5185(m)	>2	0	0	0
	Nickel	ppm	ASTM D5185(m)	>2	0	0	0
	Silver	ppm	ASTM D5185(m)	>2	0	0	0
	Aluminum	ppm	ASTM D5185(m)	>2	<1	<1	<1
	Lead	ppm	ASTM D5185(m)	>3	<1	0	<1
	Copper	ppm	ASTM D5185(m)	>3	0	0	0
CONTAMINATION	Water		WC Method	>0.1	NEG	NEG	NEG
FLUID CONDITION	Magnesium	ppm	ASTM D5185(m)	0	0	0	0
	Acid Number (AN)	mg KOH/g	ASTM D974*	0.43	1.36	1.25	1.29
	Visc @ 40°C	cSt	ASTM D7279(m)	24.2	24.3	24.9	

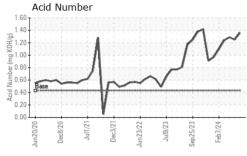


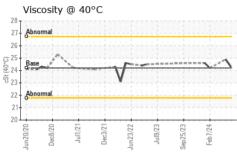

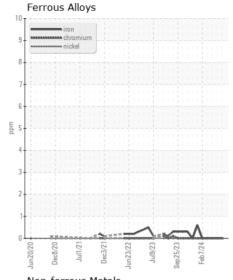

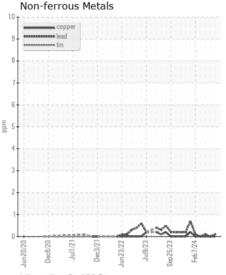

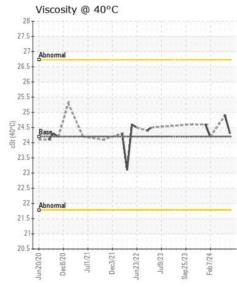

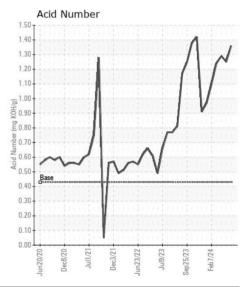



CALA ISO 17025:2017 Accredited Laboratory

Report Id: HONPHO [WCAMIS] 02630053 (Generated: 04/19/2024 11:23:50) Rev: 1

Laboratory Sample No.

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : GT57676 Lab Number : 02630053

Received **Tested** Unique Number : 5763185

Diagnosed

: 18 Apr 2024 : 18 Apr 2024 : 18 Apr 2024 - Wes Davis

Honeywell Engines 111 S. 34th Street, 301 Receiving, Attn: SOAP Program PHOENIX, AZ

US 85034 Contact: GARRETT

Test Package : G331 (Additional Tests: ICP) To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

T: F: (602)365-2676