



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	ATTENTION
FLUID CONDITION	NORMAL

Area
Hydraulic System in Plant [413430067]
 Machine Id
Dehorner - Maximo #6154 (S/N 1000029327)
 Component
Hydraulic System
 Fluid
TOTAL FINA NEVASTANE FG AW 46 (20 GAL)

RECOMMENDATION

We recommend you service the filters on this component. Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		WC0918437	WC0886037	WC0852636
Sample Date		Client Info		12 Mar 2024	18 Dec 2023	20 Sep 2023
Machine Age	days	Client Info		0	0	0
Oil Age	days	Client Info		0	0	0
Filter Age	days	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Filter Changed		Client Info		N/A	N/A	N/A
Sample Status				ATTENTION	ABNORMAL	NORMAL

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>20	3	3	2
Chromium	ppm	ASTM D5185(m)	>20	0	0	0
Nickel	ppm	ASTM D5185(m)	>20	0	0	<1
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)		0	0	<1
Aluminum	ppm	ASTM D5185(m)	>20	0	<1	0
Lead	ppm	ASTM D5185(m)	>20	0	0	<1
Copper	ppm	ASTM D5185(m)	>20	6	6	7
Tin	ppm	ASTM D5185(m)	>20	0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
White Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE

CONTAMINATION










There is a light amount of silt (particulates < 14 microns in size) present in the oil.

Silicon	ppm	ASTM D5185(m)	>15	<1	1	2
Potassium	ppm	ASTM D5185(m)	>20	0	<1	<1
Water		WC Method	>0.05	NEG	NEG	NEG
Particles >4µm		ASTM D7647	>5000	7497	▲ 12585	4230
Particles >6µm		ASTM D7647	>1300	1932	▲ 3276	475
Particles >14µm		ASTM D7647	>160	129	● 268	40
Particles >21µm		ASTM D7647	>40	24	● 68	9
Particles >38µm		ASTM D7647	>10	0	4	1
Particles >71µm		ASTM D7647	>3	0	1	0
Oil Cleanliness		ISO 4406 (c)	>19/17/14	20/18/14	▲ 21/19/15	19/16/12
Silt	scalar	Visual*	NONE	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	VLITE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.05	NEG	.2%	NEG

FLUID CONDITION

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185(m)		0	0	<1
Boron	ppm	ASTM D5185(m)		<1	0	<1
Barium	ppm	ASTM D5185(m)		0	0	0
Molybdenum	ppm	ASTM D5185(m)		0	0	0
Manganese	ppm	ASTM D5185(m)		0	0	0
Magnesium	ppm	ASTM D5185(m)		<1	<1	0
Calcium	ppm	ASTM D5185(m)		0	<1	<1
Phosphorus	ppm	ASTM D5185(m)		169	173	174
Zinc	ppm	ASTM D5185(m)		49	47	38
Sulfur	ppm	ASTM D5185(m)		695	773	772
Acid Number (AN)	mg KOH/g	ASTM D974*		0.23	0.22	0.29
Visc @ 40°C	cSt	ASTM D7279(m)	46	44.6	45.0	42.2

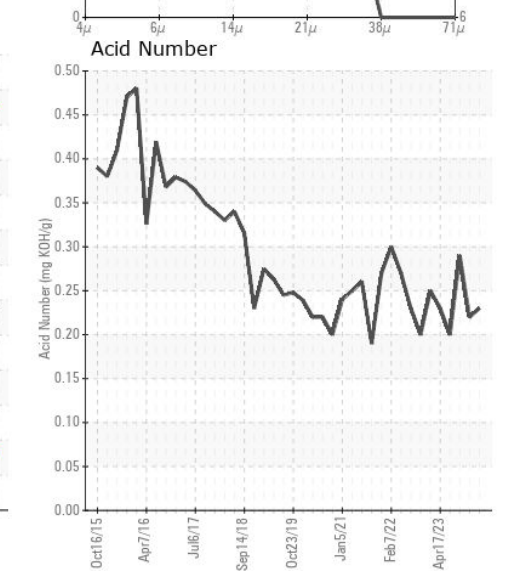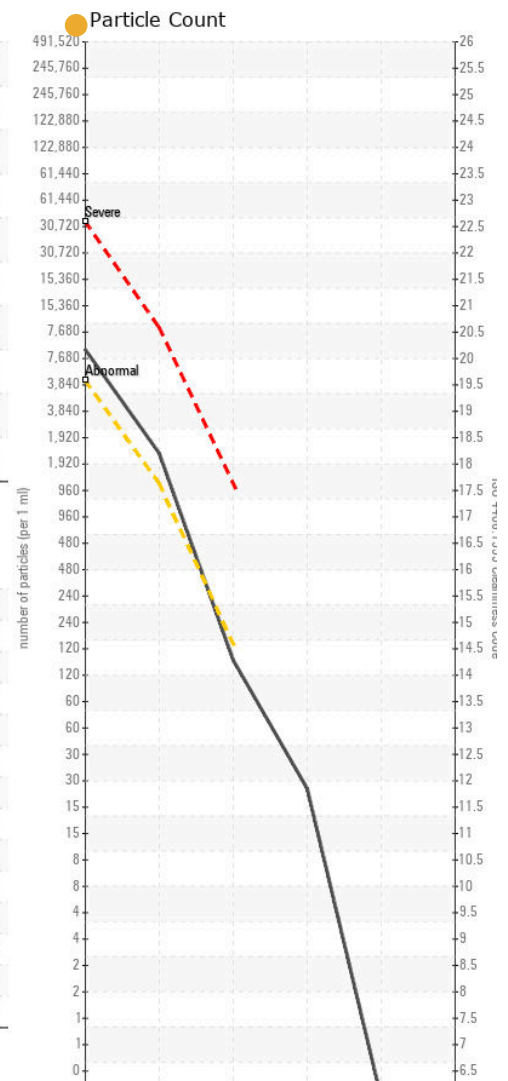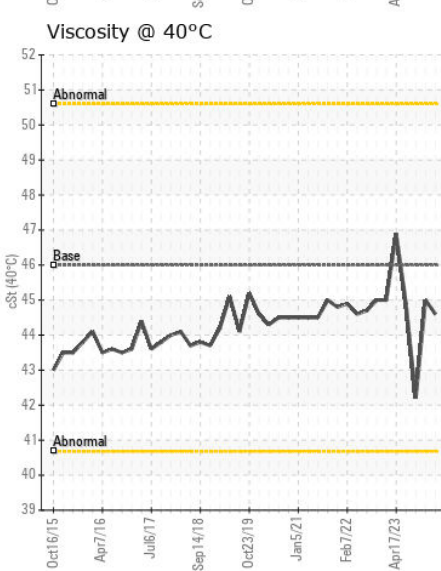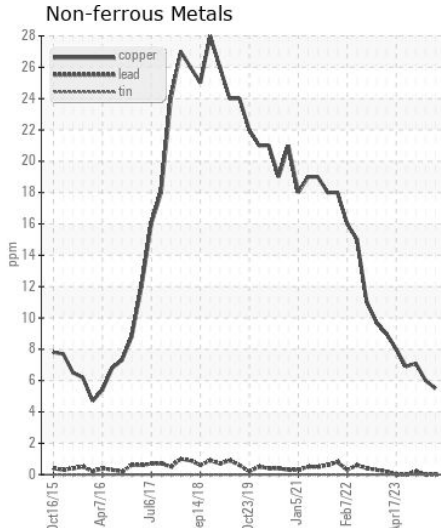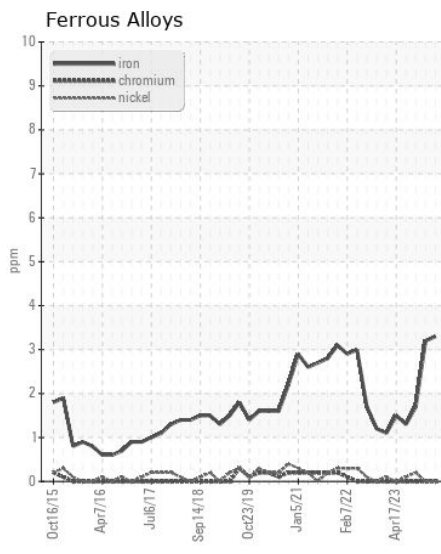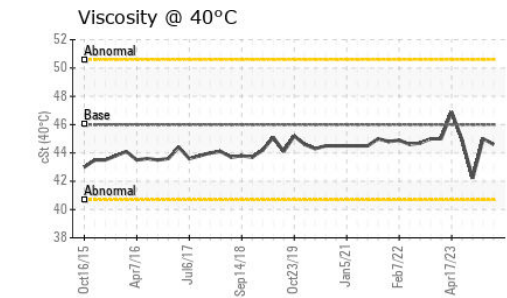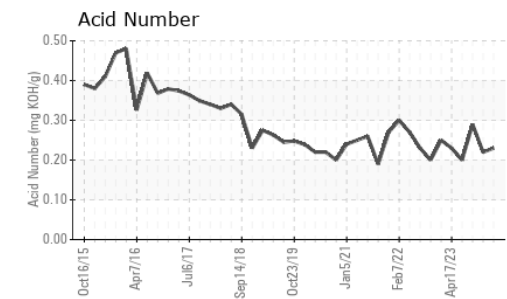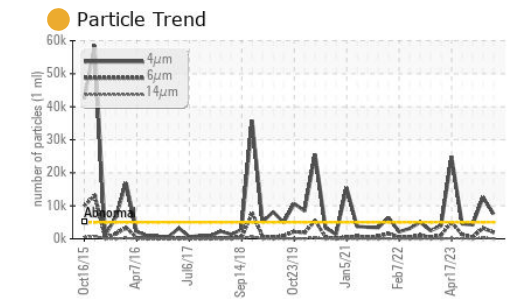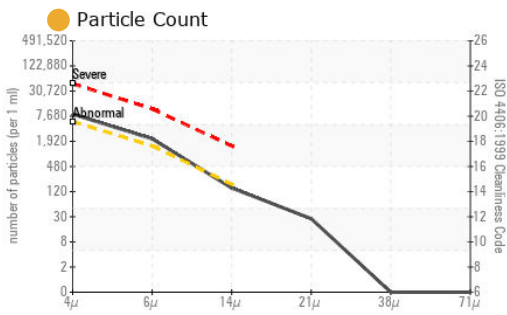

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0918437
Lab Number : 02630188
Unique Number : 5763320
Test Package : IND 2
Received : 19 Apr 2024
Tested : 22 Apr 2024
Diagnosed : 22 Apr 2024 - Wes Davis

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

Cargill Meat Solutions
 165 Dunlop Drive
 Guelph, ON
 CA N1L 1P4
 Contact: Jakub Posluszny
 jakub_posluszny@cargill.com
 T: (519)823-5200
 F: (519)823-5893