

Machine Id  
**110010**  
Component  
**Hydraulic System**  
Fluid  
**PETRO CANADA HYDREX AW 32 (--- LTR)**

**RECOMMENDATION**

Confirm the source of the lubricant being utilized for top-up/fill.  
Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>GFL0107906</b>	---	---
Sample Date		Client Info		<b>04 Apr 2024</b>	---	---
Machine Age	hrs	Client Info		<b>0</b>	---	---
Oil Age	hrs	Client Info		<b>0</b>	---	---
Filter Age	hrs	Client Info		<b>0</b>	---	---
Oil Changed		Client Info		<b>Not Chngd</b>	---	---
Filter Changed		Client Info		<b>Not Chngd</b>	---	---
Sample Status				<b>NORMAL</b>	---	---

**WEAR**

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>20	<b>5</b>	---	---
Chromium	ppm	ASTM D5185(m)	>10	<b>0</b>	---	---
Nickel	ppm	ASTM D5185(m)	>10	<b>&lt;1</b>	---	---
Titanium	ppm	ASTM D5185(m)		<b>0</b>	---	---
Silver	ppm	ASTM D5185(m)		<b>0</b>	---	---
Aluminum	ppm	ASTM D5185(m)	>10	<b>&lt;1</b>	---	---
Lead	ppm	ASTM D5185(m)	>10	<b>6</b>	---	---
Copper	ppm	ASTM D5185(m)	>75	<b>5</b>	---	---
Tin	ppm	ASTM D5185(m)	>10	<b>0</b>	---	---
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	---	---
White Metal	scalar	Visual*	NONE	<b>NONE</b>	---	---
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	---	---

**CONTAMINATION**









The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

Silicon	ppm	ASTM D5185(m)	>20	<b>9</b>	---	---
Potassium	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	---	---
Water		WC Method	>0.1	<b>NEG</b>	---	---
Particles >4µm		ASTM D7647	>5000	<b>411</b>	---	---
Particles >6µm		ASTM D7647	>1300	<b>135</b>	---	---
Particles >14µm		ASTM D7647	>160	<b>14</b>	---	---
Particles >21µm		ASTM D7647	>40	<b>4</b>	---	---
Particles >38µm		ASTM D7647	>10	<b>1</b>	---	---
Particles >71µm		ASTM D7647	>3	<b>0</b>	---	---
Oil Cleanliness		ISO 4406 (c)	>19/17/14	<b>16/14/11</b>	---	---
Silt	scalar	Visual*	NONE	<b>NONE</b>	---	---
Debris	scalar	Visual*	NONE	<b>NONE</b>	---	---
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	---	---
Appearance	scalar	Visual*	NORML	<b>NORML</b>	---	---
Odor	scalar	Visual*	NORML	<b>NORML</b>	---	---
Emulsified Water	scalar	Visual*	>0.1	<b>NEG</b>	---	---

**FLUID CONDITION**

Additive levels indicate the addition of a different brand, or type of oil.  
The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		<b>2</b>	---	---
Boron	ppm	ASTM D5185(m)	0	<b>24</b>	---	---
Barium	ppm	ASTM D5185(m)	0	<b>&lt;1</b>	---	---
Molybdenum	ppm	ASTM D5185(m)	0	<b>0</b>	---	---
Manganese	ppm	ASTM D5185(m)	0	<b>&lt;1</b>	---	---
Magnesium	ppm	ASTM D5185(m)	0	<b>11</b>	---	---
Calcium	ppm	ASTM D5185(m)	50	<b>1025</b>	---	---
Phosphorus	ppm	ASTM D5185(m)	330	<b>541</b>	---	---
Zinc	ppm	ASTM D5185(m)	430	<b>713</b>	---	---
Sulfur	ppm	ASTM D5185(m)	760	<b>1439</b>	---	---
Visc @ 40°C	cSt	ASTM D7279(m)	31.5	<b>33.0</b>	---	---

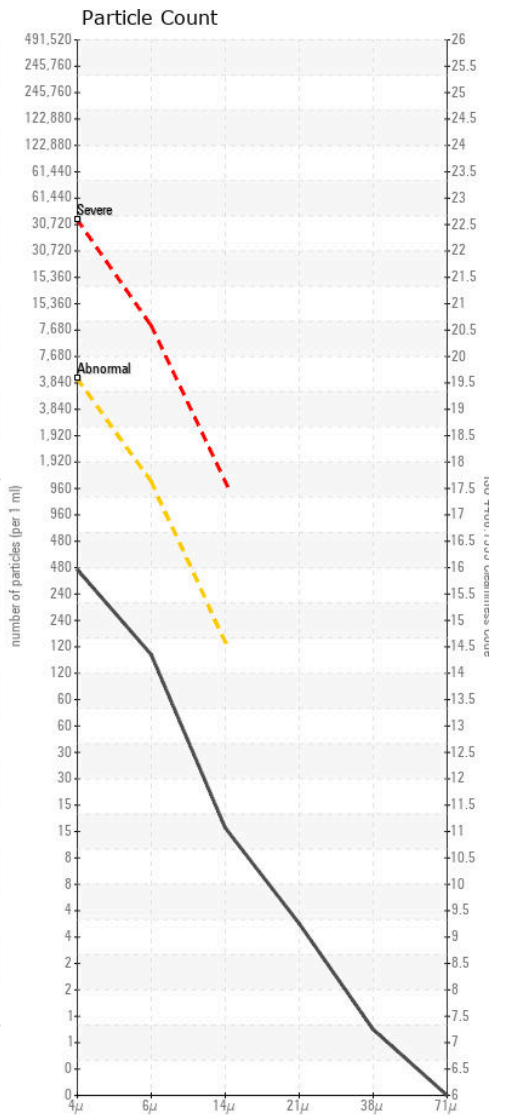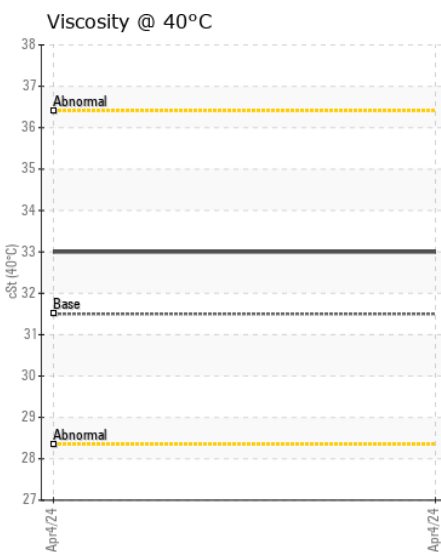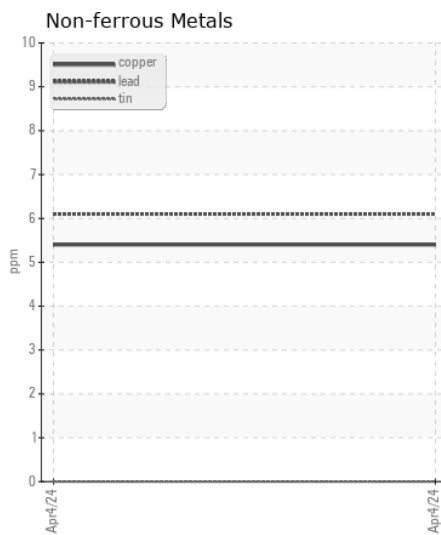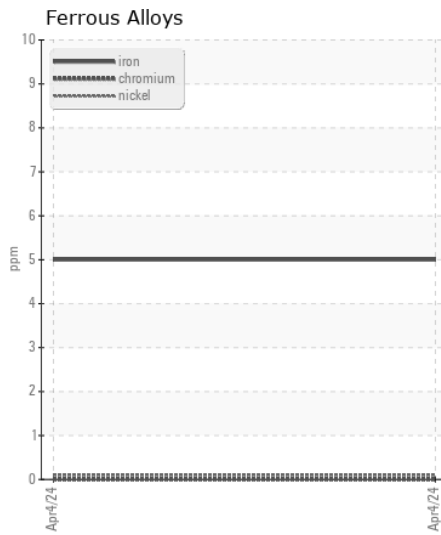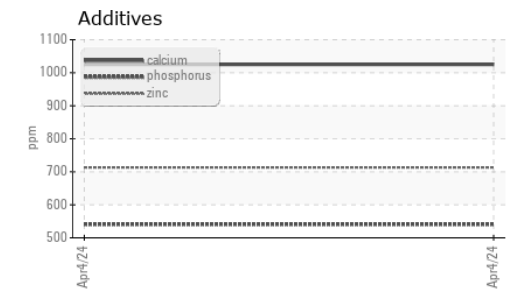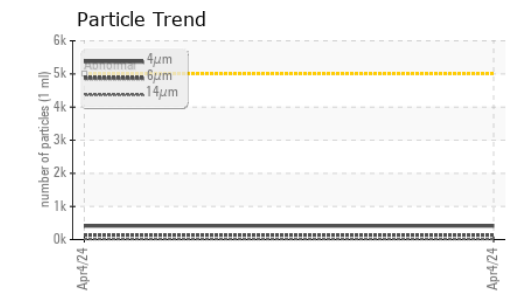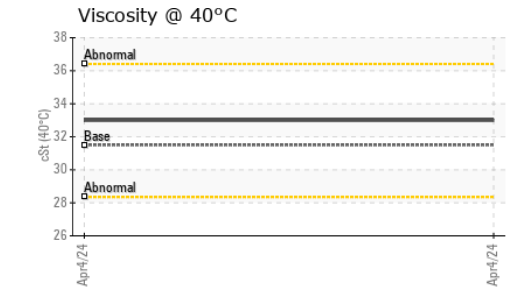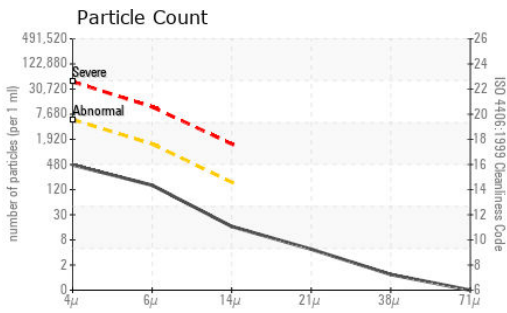

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : GFL0107906  
**Lab Number** : 02630238  
**Unique Number** : 5763370  
**Test Package** : MOB 1 ( Additional Tests: PrtCount )

**GFL Environmental - 310 - Winnipeg**  
 #360 – 555 Hervo Street,  
 Winnipeg, MB  
 CA R3T 3L6  
 Contact: Joshua Lourenco  
 jlourenco@gflenv.com  
 T: (204)987-9600  
 F:

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.