



# OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>

Area

[413260726]

Machine Id

1000110446 CENTRIFUGE POWER PACK

Component

Hydraulic System

Fluid

TOTAL FINA NEVASTANE FG AW 46 (20 GAL)

## RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>WC0918441</b>	WC0878445	WC0856701
Sample Date		Client Info		<b>12 Mar 2024</b>	16 Nov 2023	22 Oct 2023
Machine Age	mths	Client Info		<b>0</b>	0	0
Oil Age	mths	Client Info		<b>0</b>	0	0
Filter Age	mths	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>N/A</b>	N/A	N/A
Filter Changed		Client Info		<b>N/A</b>	N/A	N/A
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

## WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>20	<b>1</b>	<1	1
Chromium	ppm	ASTM D5185(m)	>20	<b>0</b>	0	0
Nickel	ppm	ASTM D5185(m)	>20	<b>0</b>	0	0
Titanium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)		<b>0</b>	<1	<1
Aluminum	ppm	ASTM D5185(m)	>20	<b>0</b>	0	0
Lead	ppm	ASTM D5185(m)	>20	<b>0</b>	0	<1
Copper	ppm	ASTM D5185(m)	>20	<b>1</b>	2	3
Tin	ppm	ASTM D5185(m)	>20	<b>0</b>	0	0
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
White Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE

## CONTAMINATION










The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

Silicon	ppm	ASTM D5185(m)	>15	<b>0</b>	<1	2
Potassium	ppm	ASTM D5185(m)	>20	<b>0</b>	0	<1
Water		WC Method	>0.05	<b>NEG</b>	NEG	NEG
Particles >4µm		ASTM D7647	>5000	<b>430</b>	274	3999
Particles >6µm		ASTM D7647	>1300	<b>116</b>	117	1257
Particles >14µm		ASTM D7647	>160	<b>6</b>	17	96
Particles >21µm		ASTM D7647	>40	<b>1</b>	6	18
Particles >38µm		ASTM D7647	>10	<b>0</b>	1	1
Particles >71µm		ASTM D7647	>3	<b>0</b>	0	0
Oil Cleanliness		ISO 4406 (c)	>19/17/14	<b>16/14/10</b>	15/14/11	19/17/14
Silt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	Visual*	>0.05	<b>NEG</b>	NEG	NEG

## FLUID CONDITION

The oil viscosity is higher than typical. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185(m)		<b>0</b>	<1	0
Boron	ppm	ASTM D5185(m)		<b>&lt;1</b>	<1	<1
Barium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185(m)		<b>0</b>	0	0
Manganese	ppm	ASTM D5185(m)		<b>0</b>	0	0
Magnesium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Calcium	ppm	ASTM D5185(m)		<b>0</b>	<1	<1
Phosphorus	ppm	ASTM D5185(m)		<b>118</b>	118	127
Zinc	ppm	ASTM D5185(m)		<b>12</b>	11	13
Sulfur	ppm	ASTM D5185(m)		<b>651</b>	469	558
Acid Number (AN)	mg KOH/g	ASTM D974*		<b>0.22</b>	0.21	0.29
Visc @ 40°C	cSt	ASTM D7279(m)	46	<b>55.8</b>	55.8	55.0

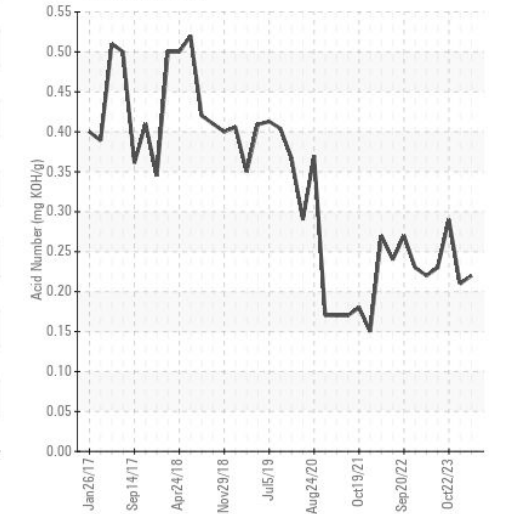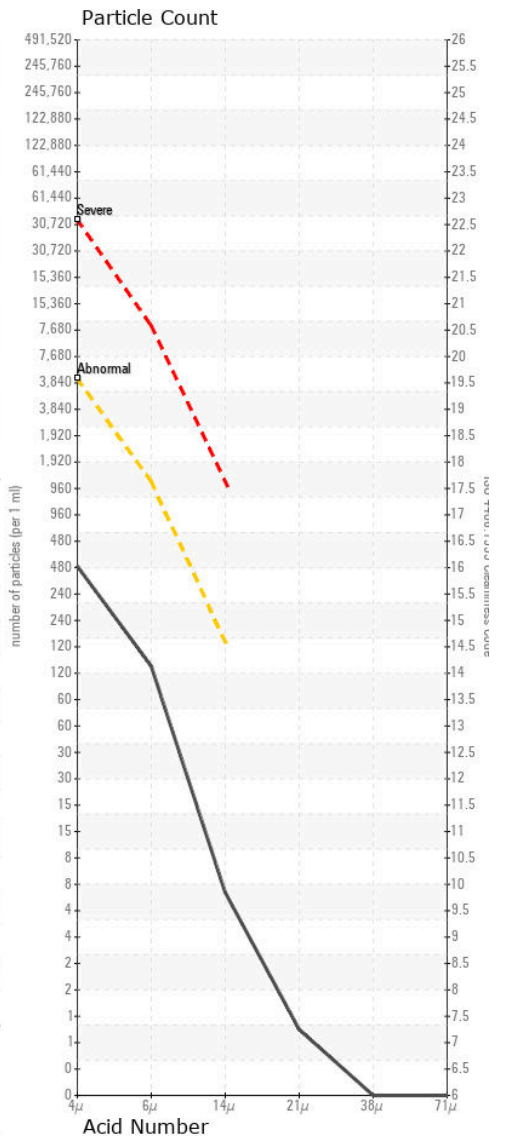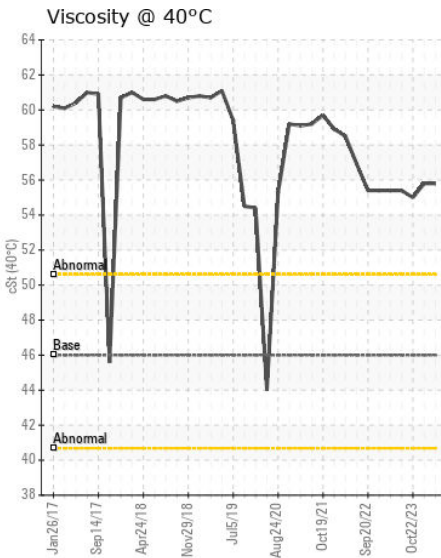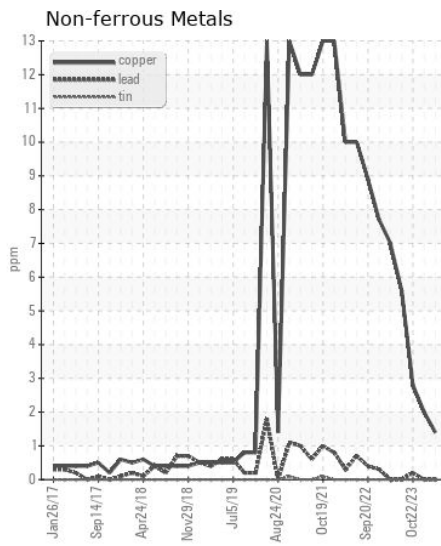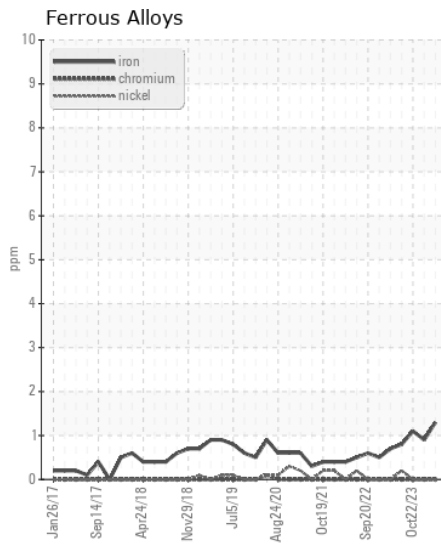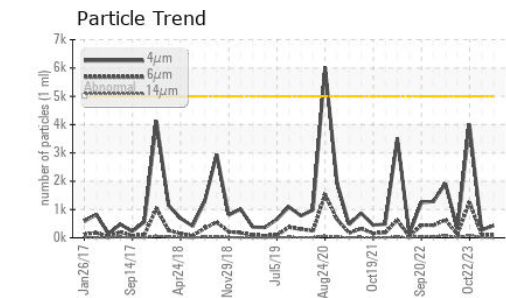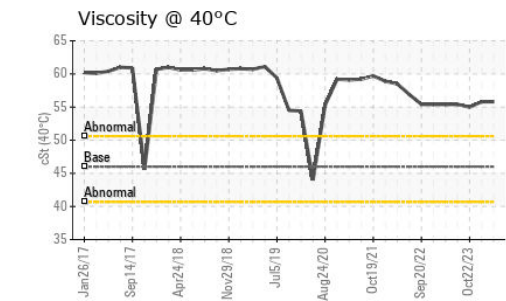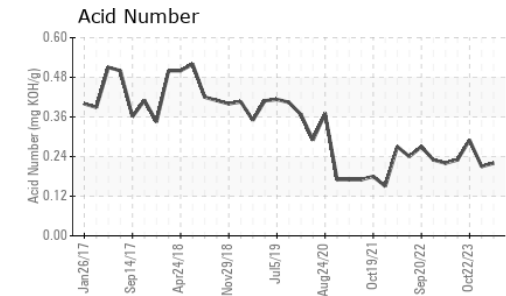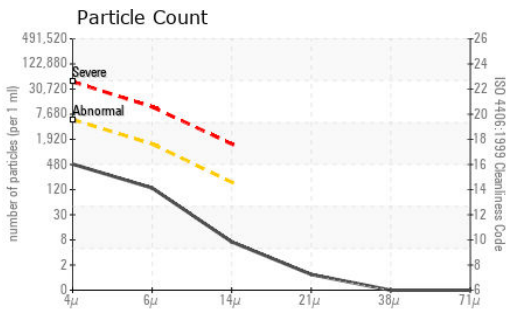

ISO 17025:2017  
Accredited  
Laboratory

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : WC0918441  
**Lab Number** : 02630359  
**Unique Number** : 5763491  
**Test Package** : IND 2

**Received** : 19 Apr 2024  
**Tested** : 22 Apr 2024  
**Diagnosed** : 22 Apr 2024 - Kevin Marson

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.

**Cargill Meat Solutions**

165 Dunlop Drive  
 Guelph, ON  
 CA N1L 1P4  
 Contact: Jakub Posluszny  
 jakub\_posluszny@cargill.com  
 T: (519)823-5200  
 F: (519)823-5893