



# OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>

Area

## Coolers Gear Drives [413628273]

Machine Id

### 3220-190 Cooler #1-2 Unloading Chain - Maximo #2992 #1000045451 (S/N 0221-07741-1419)

Component

## Gear Drive

Fluid

### KLUBER KLUBEROIL 4 UH1-460 N (--- GAL)

### RECOMMENDATION

Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>WC0912756</b>	WC0892330	WC0866035
Sample Date		Client Info		<b>11 Apr 2024</b>	26 Jan 2024	30 Oct 2023
Machine Age	hrs	Client Info		<b>0</b>	0	0
Oil Age	hrs	Client Info		<b>0</b>	0	0
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>N/A</b>	N/A	N/A
Filter Changed		Client Info		<b>N/A</b>	N/A	N/A
Sample Status				<b>NORMAL</b>	ABNORMAL	NORMAL

### WEAR

All component wear rates are normal.

PQ		ASTM D8184*		<b>0</b>	0	0
Iron	ppm	ASTM D5185(m)	>150	<b>8</b>	3	<1
Chromium	ppm	ASTM D5185(m)	>10	<b>0</b>	0	0
Nickel	ppm	ASTM D5185(m)	>10	<b>0</b>	<1	<1
Titanium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)		<b>0</b>	0	<1
Aluminum	ppm	ASTM D5185(m)	>25	<b>0</b>	<1	0
Lead	ppm	ASTM D5185(m)	>100	<b>0</b>	0	0
Copper	ppm	ASTM D5185(m)	>50	<b>&lt;1</b>	<1	<1
Tin	ppm	ASTM D5185(m)	>10	<b>0</b>	0	0
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
White Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE

### CONTAMINATION










The water content is negligible. There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>50	<b>32</b>	11	33
Potassium	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	<1	0
Water	%	ASTM D6304*	>0.1	<b>0.006</b>	---	---
ppm Water	ppm	ASTM D6304*	>1000	<b>64</b>	---	---
Silt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	Visual*	NONE	<b>VLITE</b>	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	Visual*	NORML	<b>HAZY</b>	NORML	NORML
Odor	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	Visual*	>0.1	<b>NEG</b>	NEG	NEG

### FLUID CONDITION

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185(m)		<b>&lt;1</b>	0	<1
Boron	ppm	ASTM D5185(m)		<b>&lt;1</b>	1	2
Barium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185(m)		<b>0</b>	0	0
Manganese	ppm	ASTM D5185(m)		<b>0</b>	0	0
Magnesium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Calcium	ppm	ASTM D5185(m)		<b>&lt;1</b>	2	<1
Phosphorus	ppm	ASTM D5185(m)		<b>532</b>	629	636
Zinc	ppm	ASTM D5185(m)		<b>3</b>	3	1
Sulfur	ppm	ASTM D5185(m)		<b>547</b>	602	768
Acid Number (AN)	mg KOH/g	ASTM D974*		<b>0.77</b>	0.94	1.19
Visc @ 40°C	cSt	ASTM D7279(m)	460	<b>426</b>	▲ 364	422

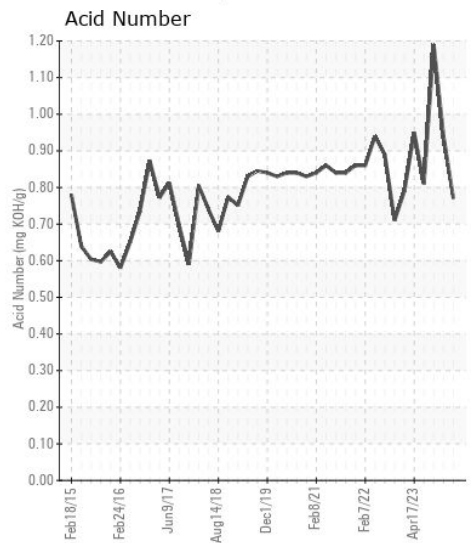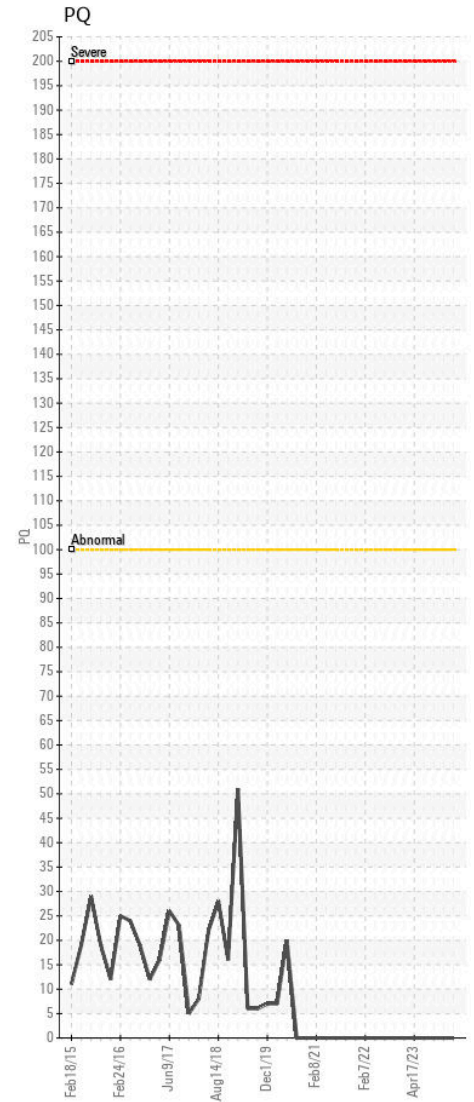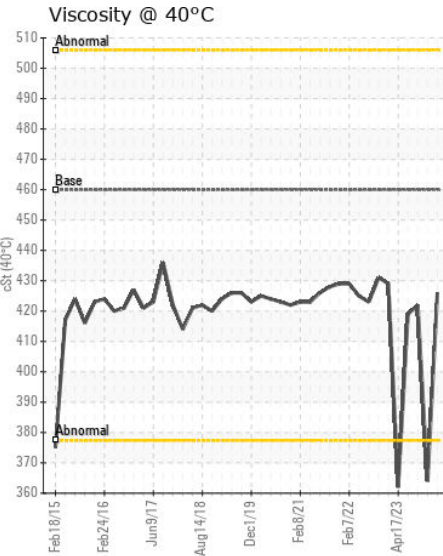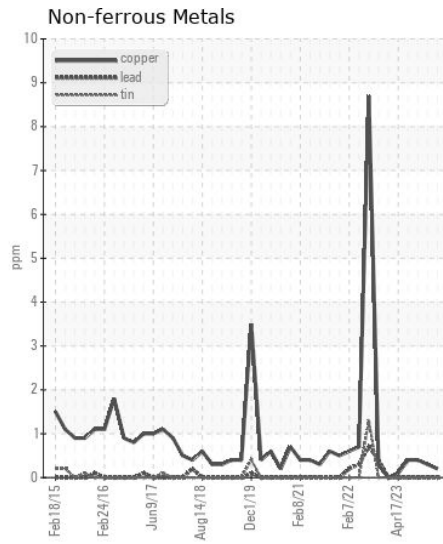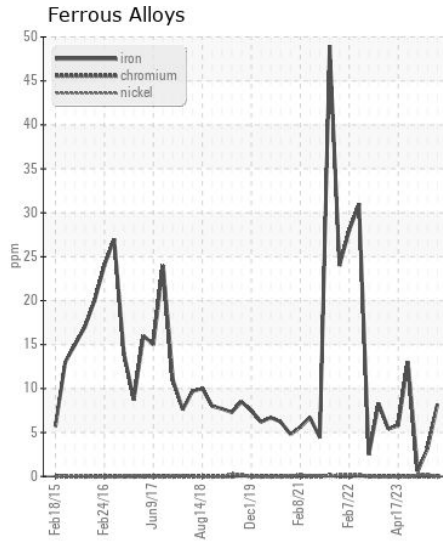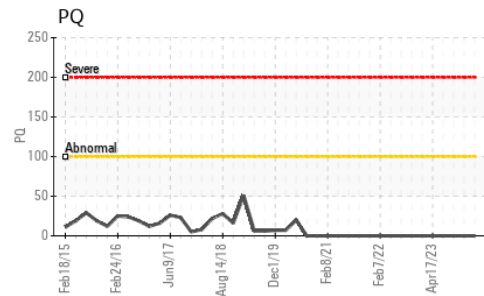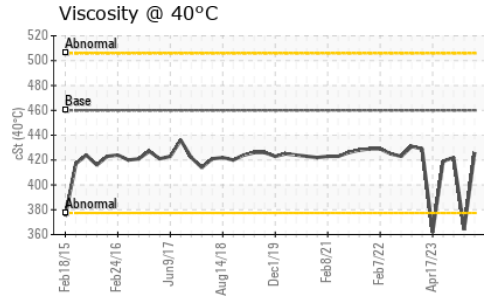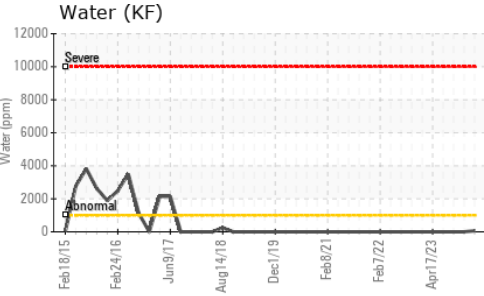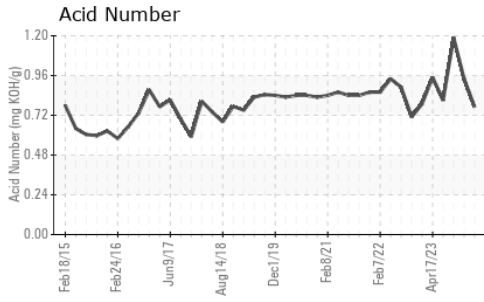

ISO 17025:2017  
Accredited  
Laboratory

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : WC0912756  
**Lab Number** : 02630400  
**Unique Number** : 5763532  
**Test Package** : IND 2 ( Additional Tests: KF, TAN Man )

**Received** : 19 Apr 2024  
**Tested** : 24 Apr 2024  
**Diagnosed** : 24 Apr 2024 - Kevin Marson

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.

**Cargill Meat Solutions**

165 Dunlop Drive  
 Guelph, ON  
 CA N1L 1P4  
 Contact: Jakub Posluszny  
 jakub\_posluszny@cargill.com  
 T: (519)823-5200  
 F: (519)823-5893