

Machine Id
813094
Component
Hydraulic System
Fluid
AW HYDRAULIC OIL ISO 32 (--- GAL)

RECOMMENDATION

Nous vous recommandons de vérifier tous les endroits par lesquels des contaminants peuvent pénétrer dans le système. Nous vous recommandons de remplacer le filtre et d'utiliser un système de filtrage hors-ligne afin d'améliorer la propreté du fluide. Le reniflard d'air doit être réparé. S'il n'est pas classé, nous vous recommandons de le remplacer par un reniflard à air adapté au micron et / ou au dessiccant. Si évalué, nous vous recommandons de réparer / remplacer le reniflard. Échantillonner de nouveau dans 30 à 45 jours afin de contrôler la situation. Le fluide n'était pas spécifié, toutefois, une comparaison avec d'autres fluides indique que ce fluide est du (GENERIC) AW HYDRAULIC OIL ISO 32. Veuillez confirmer.

WEAR

Les taux d'usure de tous les composants sont normaux.








CONTAMINATION

Il y a une quantité élevée de matières particulaires (2 à 100 µm de taille) présente dans l'huile.

FLUID CONDITION

L'huile peut encore servir si la contamination peut être réduite à un niveau acceptable.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		GFL0119611	---	---
Sample Date		Client Info		01 Apr 2024	---	---
Machine Age	hrs	Client Info		0	---	---
Oil Age	hrs	Client Info		2400	---	---
Filter Age	hrs	Client Info		0	---	---
Oil Changed		Client Info		Not Chngd	---	---
Filter Changed		Client Info		Not Chngd	---	---
Sample Status				SEVERE	---	---
Iron	ppm	ASTM D5185(m)	>20	4	---	---
Chromium	ppm	ASTM D5185(m)	>10	0	---	---
Nickel	ppm	ASTM D5185(m)	>10	0	---	---
Titanium	ppm	ASTM D5185(m)		0	---	---
Silver	ppm	ASTM D5185(m)		0	---	---
Aluminum	ppm	ASTM D5185(m)	>10	<1	---	---
Lead	ppm	ASTM D5185(m)	>10	0	---	---
Copper	ppm	ASTM D5185(m)	>75	2	---	---
Tin	ppm	ASTM D5185(m)	>10	0	---	---
Vanadium	ppm	ASTM D5185(m)		0	---	---
White Metal	scalar	Visual*	NONE	NONE	---	---
Yellow Metal	scalar	Visual*	NONE	NONE	---	---
Silicon	ppm	ASTM D5185(m)	>20	2	---	---
Potassium	ppm	ASTM D5185(m)	>20	1	---	---
Water		WC Method	>0.1	NEG	---	---
Particles >4µm		ASTM D7647	>5000	▲ 160857	---	---
Particles >6µm		ASTM D7647	>1300	▲ 93009	---	---
Particles >14µm		ASTM D7647	>160	▲ 9191	---	---
Particles >21µm		ASTM D7647	>40	▲ 1710	---	---
Particles >38µm		ASTM D7647	>10	▲ 63	---	---
Particles >71µm		ASTM D7647	>3	3	---	---
Oil Cleanliness		ISO 4406 (c)	>19/17/14	▲ 25/24/20	---	---
Silt	scalar	Visual*	NONE	NONE	---	---
Debris	scalar	Visual*	NONE	NONE	---	---
Sand/Dirt	scalar	Visual*	NONE	LIGHT	---	---
Appearance	scalar	Visual*	NORML	NORML	---	---
Odor	scalar	Visual*	NORML	NORML	---	---
Emulsified Water	scalar	Visual*	>0.1	NEG	---	---
Sodium	ppm	ASTM D5185(m)		1	---	---
Boron	ppm	ASTM D5185(m)	5	<1	---	---
Barium	ppm	ASTM D5185(m)	5	<1	---	---
Molybdenum	ppm	ASTM D5185(m)	5	0	---	---
Manganese	ppm	ASTM D5185(m)		0	---	---
Magnesium	ppm	ASTM D5185(m)	25	2	---	---
Calcium	ppm	ASTM D5185(m)	200	52	---	---
Phosphorus	ppm	ASTM D5185(m)	300	309	---	---
Zinc	ppm	ASTM D5185(m)	370	408	---	---
Sulfur	ppm	ASTM D5185(m)	2500	723	---	---
Visc @ 40°C	cSt	ASTM D7279(m)	32	31.1	---	---

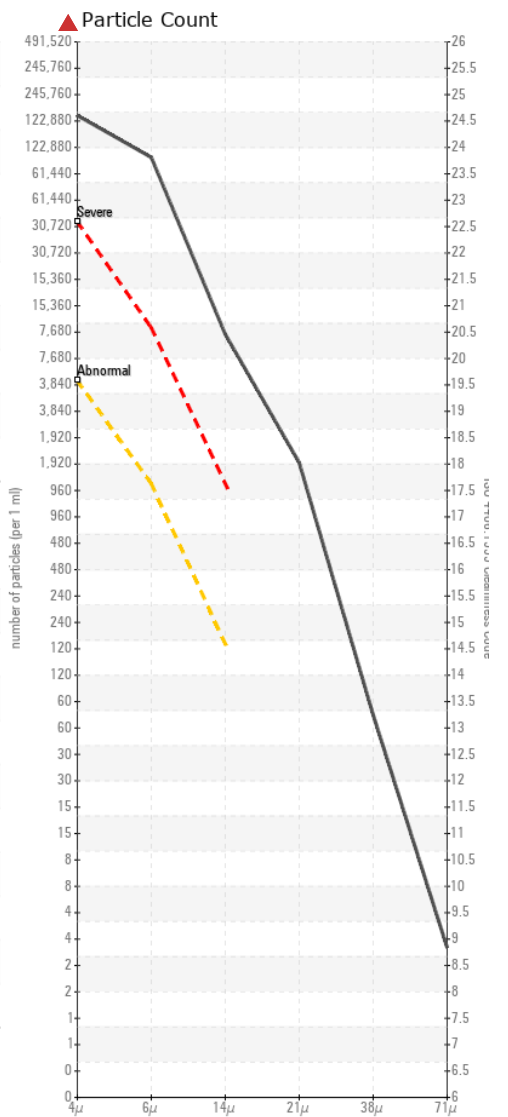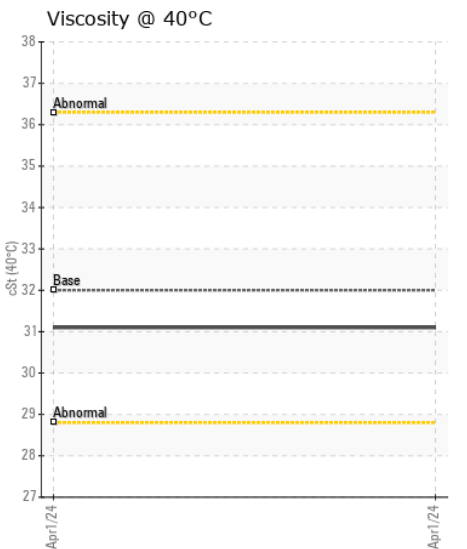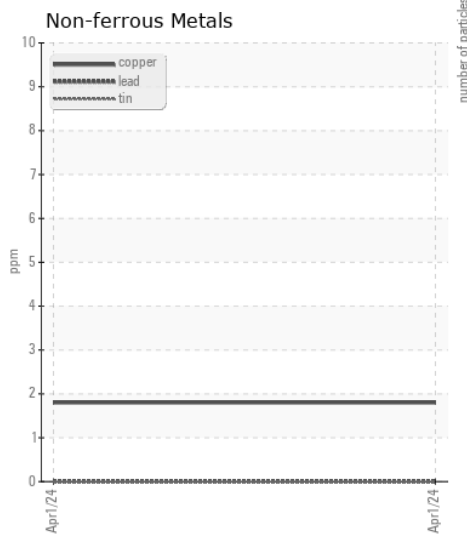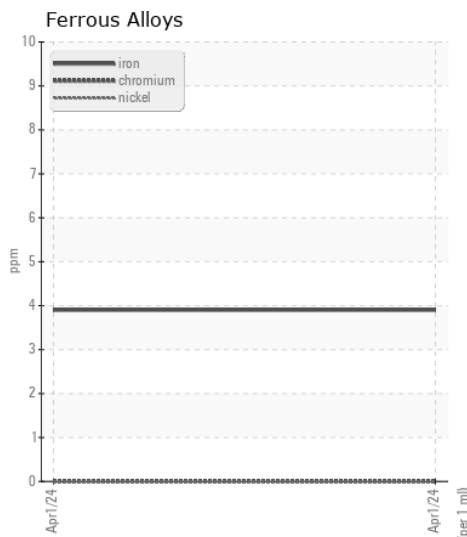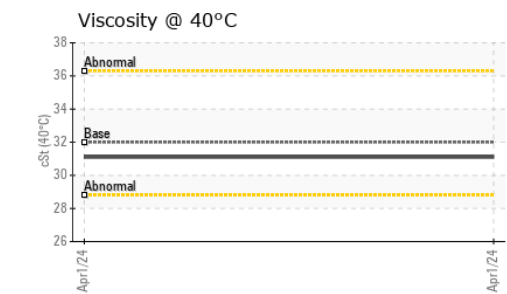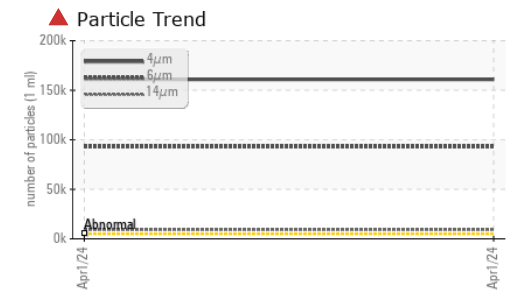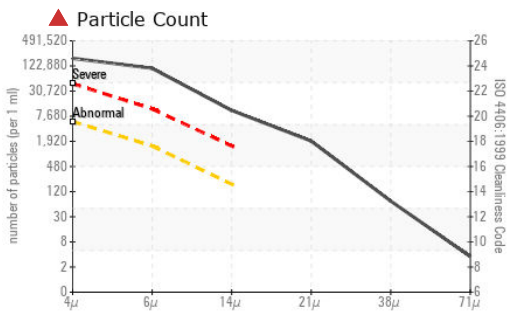

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : GFL0119611
Lab Number : 02630633
Unique Number : 5763765
Test Package : MOB 1 (Additional Tests: PrtCount)

GFL Environmental - 736 - Trois-Rivieres
 2920 Bellefeuille,
 Trois-Rivieres, QC
 CA G9A 5R5
 Contact: Jean Demontigny
 jdemontigny@matrec.ca
 T: (819)378-4881
 F:

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.