



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Machine Id
MAIN ENGINE 2 (S/N 15573)
 Component
2 Main Engine
 Fluid
CASTROL MHP 154 (3200 LTR)

RECOMMENDATION

Resample at the next service interval to monitor. Please contact your representative for information regarding the proper sampling kits for your service. NOTE: We recommend using MAR 3 test kits, this testkit includes Analytical Ferrography which provides a detailed morphological analysis of wear particles present in the fluid. this testkit includes BN to determine the suitability of the oil for continued use.

WEAR

Component wear rates appear to be normal (unconfirmed).

CONTAMINATION


There is no indication of any contamination in the oil.

FLUID CONDITION


The condition of the oil is acceptable for the time in service (unconfirmed).

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		WC0902414	WC0872101	WC0773443
Sample Date		Client Info		08 Apr 2024	09 Jan 2024	06 Oct 2023
Machine Age	hrs	Client Info		11303	10823	10272
Oil Age	hrs	Client Info		0	0	0
Filter Age	hrs	Client Info		0	2665	0
Oil Changed		Client Info		N/A	Not Changd	N/A
Filter Changed		Client Info		N/A	Not Changd	N/A
Sample Status				NORMAL	NORMAL	NORMAL
Iron	ppm	ASTM D5185(m)	>75	6	6	6
Chromium	ppm	ASTM D5185(m)	>8	0	0	0
Nickel	ppm	ASTM D5185(m)	>2	0	<1	0
Titanium	ppm	ASTM D5185(m)	>3	0	0	0
Silver	ppm	ASTM D5185(m)	>2	0	0	<1
Aluminum	ppm	ASTM D5185(m)	>15	1	2	2
Lead	ppm	ASTM D5185(m)	>18	0	<1	<1
Copper	ppm	ASTM D5185(m)	>80	<1	<1	<1
Tin	ppm	ASTM D5185(m)	>14	0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
White Metal	scalar	Visual*	NONE	NONE	NONE	VLITE
Yellow Metal	scalar	Visual*	NONE	NONE	VLITE	NONE
Silicon	ppm	ASTM D5185(m)	>20	7	8	7
Potassium	ppm	ASTM D5185(m)	>20	0	<1	<1
Fuel		WC Method	>4.0	<1.0	<1.0	<1.0
Water		WC Method	>0.1	NEG	NEG	NEG
Glycol		WC Method		NEG	NEG	NEG
Soot %	%	ASTM D7844*		0.1	0.2	0.2
Nitration	Abs/cm	ASTM D7624*	>20	9.7	9.7	9.6
Sulfation	Abs/.1mm	ASTM D7415*	>30	14.8	15.0	16.3
Silt	scalar	Visual*	NONE	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.1	NEG	NEG	NEG
Sodium	ppm	ASTM D5185(m)	>75	<1	<1	<1
Boron	ppm	ASTM D5185(m)		2	2	2
Barium	ppm	ASTM D5185(m)		0	0	<1
Molybdenum	ppm	ASTM D5185(m)		0	<1	<1
Manganese	ppm	ASTM D5185(m)		<1	<1	<1
Magnesium	ppm	ASTM D5185(m)		27	29	24
Calcium	ppm	ASTM D5185(m)		5323	5248	5588
Phosphorus	ppm	ASTM D5185(m)		880	905	948
Zinc	ppm	ASTM D5185(m)		969	999	1052
Sulfur	ppm	ASTM D5185(m)		8484	9516	9138
Oxidation	Abs/.1mm	ASTM D7414*	>25	7.9	7.9	8.3
Visc @ 100°C	cSt	ASTM D7279(m)	13.5	13.7	13.8	13.5


FT-IR (Direct Trend)

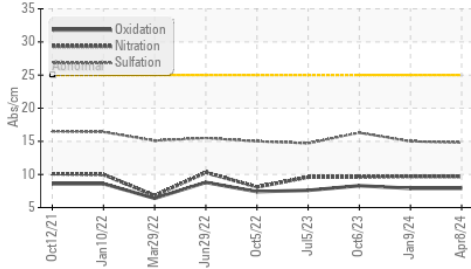


Ferrous Alloys

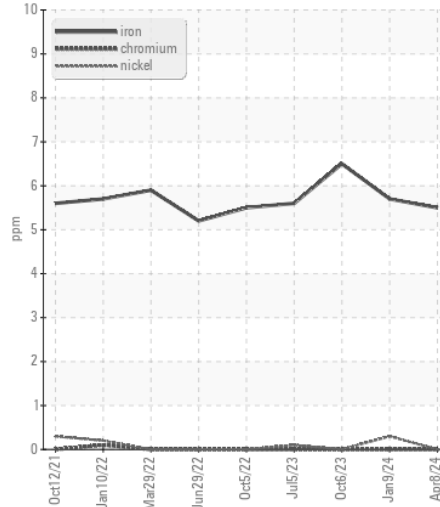


Viscosity @ 100°C

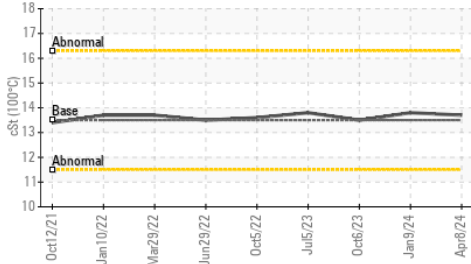

Non-ferrous Metals

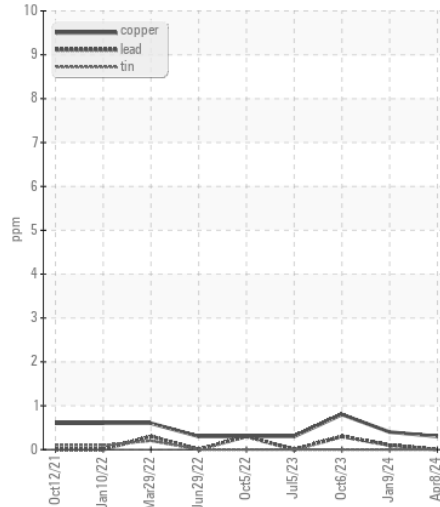

Viscosity @ 100°C

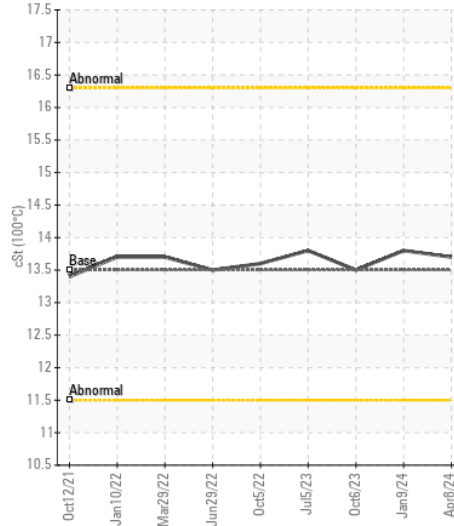

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0902414
Lab Number : 02630858
Unique Number : 5772011
Test Package : MAR 1
Received : 23 Apr 2024
Tested : 23 Apr 2024
Diagnosed : 23 Apr 2024 - Wes Davis

Horizon Maritime Services Ltd. - Horizon Arctic
 87 WATER STREET,, 2ND FLOOR
 ST.JOHNS, NL
 CA A1C 1A5
 Contact: Horizon Arctic Chief Engineer
 chiefeng.arctic@horizonvessel.com
 T: (709)702-4447
 F:

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.