



# LIEBHERR

## OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Machine Id  
**LIEBHERR A934C 057446-1007**  
Component  
**Rear Right Wheel Hub**  
Fluid  
**KLONDIKE FULL SYNTHETIC 75W90 (3 GAL)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>LH0276182</b>	LH0281183	LH0191985
Sample Date		Client Info		<b>21 Apr 2024</b>	22 Jan 2024	02 Dec 2022
Machine Age	hrs	Client Info		<b>26815</b>	26482	25052
Oil Age	hrs	Client Info		<b>0</b>	0	0
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Changed</b>	Changed	Changed
Filter Changed		Client Info		<b>N/A</b>	N/A	N/A
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

### WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>500	<b>13</b>	8	8
Chromium	ppm	ASTM D5185(m)	>4	<b>0</b>	0	0
Nickel	ppm	ASTM D5185(m)	>3	<b>0</b>	0	0
Titanium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)		<b>0</b>	0	0
Aluminum	ppm	ASTM D5185(m)	>15	<b>0</b>	<1	<1
Lead	ppm	ASTM D5185(m)	>4	<b>0</b>	<1	0
Copper	ppm	ASTM D5185(m)	>100	<b>2</b>	6	4
Tin	ppm	ASTM D5185(m)	>3	<b>0</b>	0	0
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
White Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE

### CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>65	<b>0</b>	<1	<1
Potassium	ppm	ASTM D5185(m)	>20	<b>0</b>	<1	0
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Silt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	Visual*	>0.2	<b>NEG</b>	.2%	NEG

### FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		<b>&lt;1</b>	0	1
Boron	ppm	ASTM D5185(m)		<b>32</b>	31	193
Barium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185(m)		<b>0</b>	0	0
Manganese	ppm	ASTM D5185(m)		<b>&lt;1</b>	0	<1
Magnesium	ppm	ASTM D5185(m)		<b>1</b>	2	<1
Calcium	ppm	ASTM D5185(m)		<b>19</b>	14	12
Phosphorus	ppm	ASTM D5185(m)		<b>759</b>	528	1711
Zinc	ppm	ASTM D5185(m)		<b>7</b>	11	9
Sulfur	ppm	ASTM D5185(m)		<b>17660</b>	17192	22645
Visc @ 40°C	cSt	ASTM D7279(m)	95	<b>108</b>	101	98.0

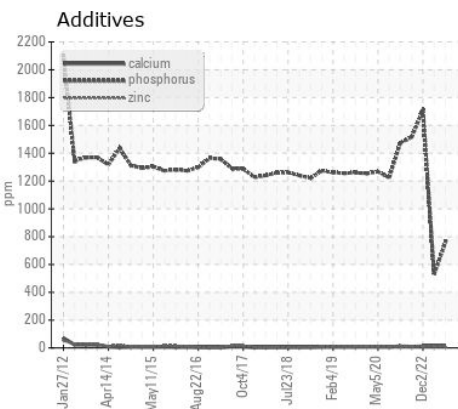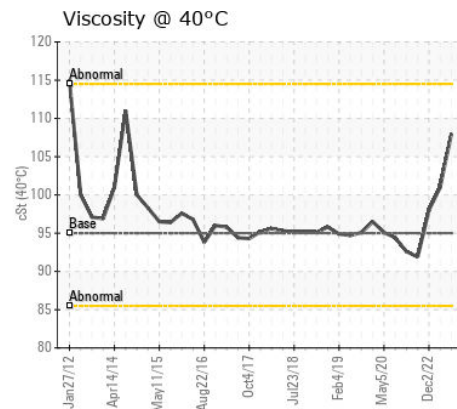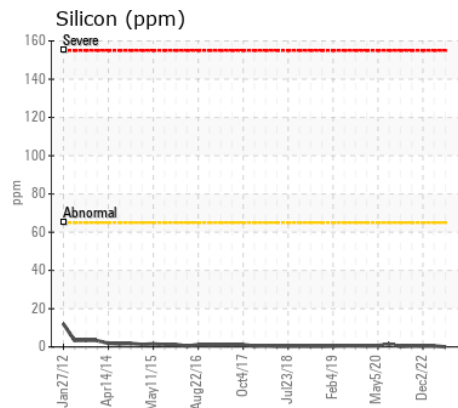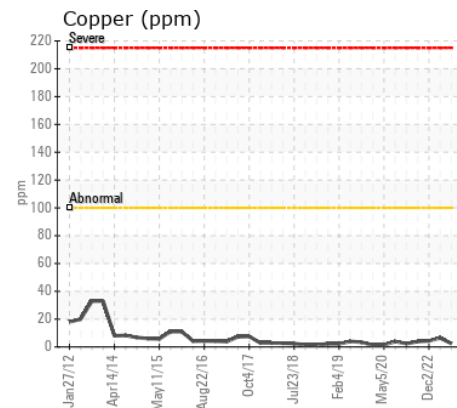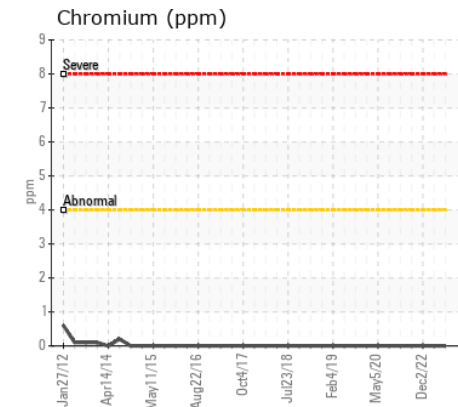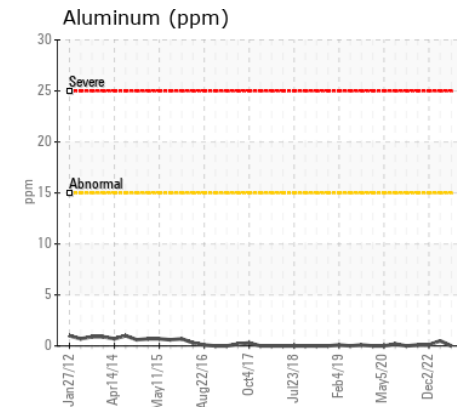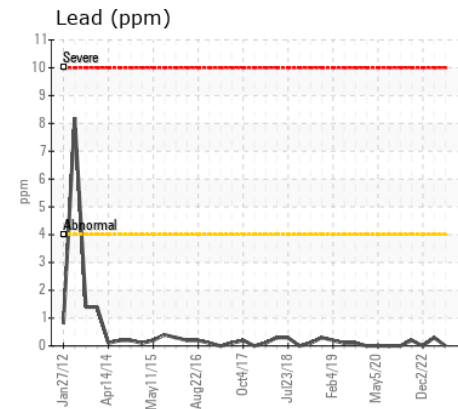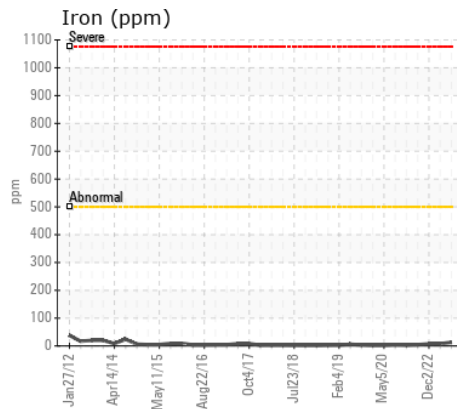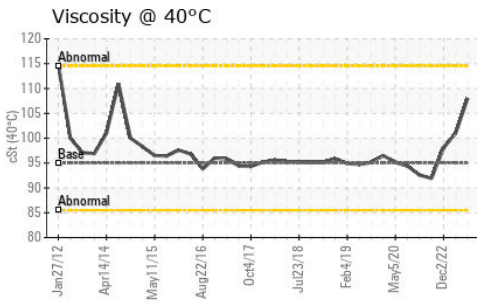

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : LH0276182  
**Lab Number** : 02631014  
**Unique Number** : 5772167  
**Test Package** : MOB 1  
**Received** : 23 Apr 2024  
**Tested** : 23 Apr 2024  
**Diagnosed** : 23 Apr 2024 - Wes Davis

**ABC RECYCLING**  
 8081 MEADOW AVE.  
 BURNABY, BC  
 CA V3N 2V9  
 Contact: John Anderson  
 john.anderson@abcrcycling.com  
 T: (778)988-9944  
 F:

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.