DB POWER Station

OIL ANALYSIS REPORT

[85908] MAIN ST DUNDALK NEXACOR 64-15961

Left Diesel Engine

ESSO XD-3 EXTRA 15W40 (8 LTR)

RECOMMENDATION

The oil change at the time of sampling has been noted. Resample at the next service interval to monitor. No other corrective action is recommended at this time.

T			
	_	-	

Area

Metal levels are typical for a new component breaking in.

CONTAMINATION

Light fuel dilution occurring. No other contaminants were detected in the oil.

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		PN0006097	PN0002463	PN0001173
Sample Date		Client Info		29 Apr 2024	01 Jun 2021	05 Apr 2020
Machine Age	hrs	Client Info		407	403	399
Oil Age	hrs	Client Info		0	0	0
Filter Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		Changed	Changed	Changed
Filter Changed		Client Info		Changed	Changed	Changed
Sample Status				MARGINAL	NORMAL	SEVERE
lron			. 100	<u></u>	2	12
Iron Chromium	ppm	ASTM D5185(m) ASTM D5185(m)	>100	3 0	2	<1
Nickel	ppm	()	>20 >4	0	0	<1
	ppm	ASTM D5185(m)	>4	0	0	<1
Titanium Silver	ppm	ASTM D5185(m)	>3	0	0	< 1
	ppm	ASTM D5185(m)		2	2	2
Aluminum Lead	ppm	ASTM D5185(m)	>20	2	2	
	ppm	ASTM D5185(m)	>40 >330	0 <1	÷	<1
Copper	ppm	ASTM D5185(m)		<1 0	<1 0	
Tin	ppm	ASTM D5185(m) ASTM D5185(m)	>15	0	-	<1 0
Vanadium White Metal	ppm	ASIM D5185(m) Visual*	NONE	U NONE	<1	0
	scalar		NONE	NONE		
Yellow Metal	scalar	Visual*	NONE	NONE		
Silicon	ppm	ASTM D5185(m)	>25	3	3	5
Potassium	ppm	ASTM D5185(m)	>20	<1	<1	<1
Fuel	%	ASTM D7593*	>5	4 .7	<1.0	1 1.6
Water		WC Method	>0.2	NEG	NEG	NEG
Glycol		WC Method		NEG	NEG	NEG
Soot %	%	ASTM D7844*	>3	0	0	0
Nitration	Abs/cm	ASTM D7624*	>20	5.6	6.8	7.9
Sulfation	Abs/.1mm	ASTM D7415*	>30	14.9	18.4	21.0
Silt	scalar	Visual*	NONE	NONE		
Debris	scalar	Visual*	NONE	NONE		
Sand/Dirt	scalar	Visual*	NONE	VLITE		
Appearance	scalar	Visual*	NORML	NORML		
Odor	scalar	Visual*	NORML	NORML		
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG	NEG
Sodium	ppm	ASTM D5185(m)	>192	1	3	<1
Boron	ppm	ASTM D5185(m)	2 TUL	47	63	17
Barium	ppm	ASTM D5185(m)		0	<1	<1
Molybdenum	ppm	ASTM D5185(m)		12	62	12
Manganese	ppm	ASTM D5185(m)		0	<1	<1
Magnesium	ppm	ASTM D5185(m)		46	136	161
Calcium	ppm	ASTM D5185(m)	3780	2094	1802	1759
Phosphorus	ppm	ASTM D5185(m)	1370	963	842	749
Zinc	ppm	ASTM D5185(m)	1500	1061	1005	864
Sulfur	ppm	ASTM D5185(m)	3800	2733	2821	2237
Oxidation	Abs/.1mm	ASTM D7414*	>25	9.6	13.3	13.0
Visc @ 100°C	cSt	ASTM D7279(m)	15.4	12.4	11.6	▲ 9.5

WEAR


CONTAMINATION


FLUID CONDITION

NORMAL

MARGINAL

NORMAL

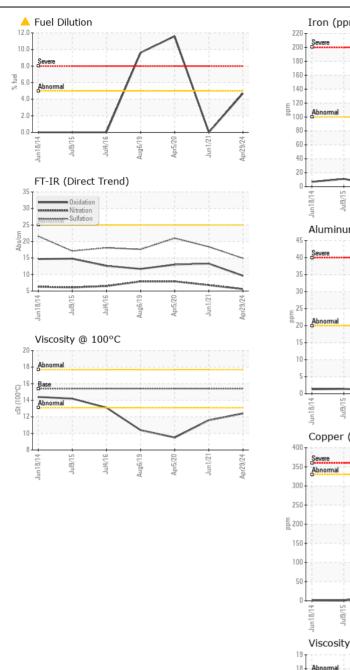

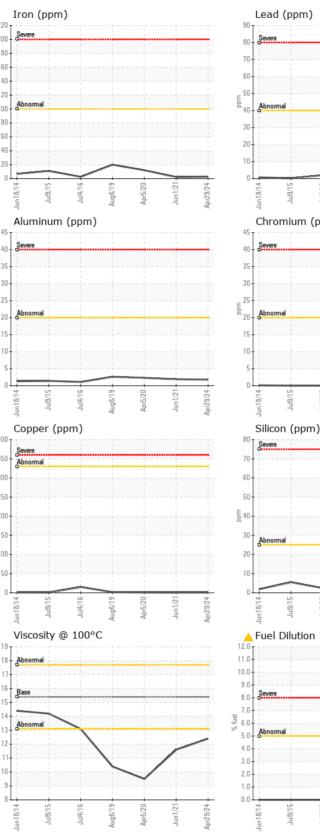

vpr29/24 ua6/19 Chromium (ppm) Aug6/19 Apr5/20 Jun1/21 Apr29/24 Jul4/16 POWER STATION INC. 1050 JAYSON COURT MISSISSAUGA, ON CA L4W 2V5

Accredited : 02 May 2024 - Wes Davis Unique Number : 5773642 Diagnosed Laboratory Test Package : MOB 1 (Additional Tests: FuelDilution, PercentFuel, Visual) To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9

Received

Tested

:01 May 2024

: 02 May 2024

10

15

12

C

: PN0006097

: 02632489

cSt (100°C)

Contact: Ryan Udall rudall@pwrstn.com T: (905)565-1621 F: (905)629-1499

CALA

ISO 17025:2017

Laboratory

Sample No.

Lab Number

Contact/Location: Ryan Udall - POWMIS Page 2 of 2