



# OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	ABNORMAL
FLUID CONDITION	NORMAL

Area  
**Hydraulic System in Plant [413667324]**  
 Machine Id  
**Hide Pullers Power Pac #2 - Maximo #6148 1000031253 (S/N 05581601)**  
 Component  
**Hydraulic System**  
 Fluid  
**KEYSTONE NEVASTANE AW ISO 46 (40 GAL)**

## RECOMMENDATION

We recommend you service the filters on this component. We recommend an early resample to monitor this condition.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>WC0931385</b>	WC0878441	WC0866033
Sample Date		Client Info		<b>27 Apr 2024</b>	30 Jan 2024	31 Oct 2023
Machine Age	hrs	Client Info		<b>0</b>	0	0
Oil Age	hrs	Client Info		<b>0</b>	0	0
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>N/A</b>	N/A	N/A
Filter Changed		Client Info		<b>N/A</b>	N/A	N/A
Sample Status				<b>ABNORMAL</b>	NORMAL	NORMAL

## WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>20	<b>1</b>	2	2
Chromium	ppm	ASTM D5185(m)	>20	<b>0</b>	0	0
Nickel	ppm	ASTM D5185(m)	>20	<b>0</b>	0	<1
Titanium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)		<b>0</b>	0	<1
Aluminum	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	<1	0
Lead	ppm	ASTM D5185(m)	>20	<b>0</b>	0	0
Copper	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	<1	<1
Tin	ppm	ASTM D5185(m)	>20	<b>0</b>	0	0
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
White Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE

## CONTAMINATION










There is a moderate amount of silt (particulates < 14 microns in size) present in the oil.

Silicon	ppm	ASTM D5185(m)	>15	<b>&lt;1</b>	2	2
Potassium	ppm	ASTM D5185(m)	>20	<b>0</b>	<1	0
Water		WC Method	>0.05	<b>NEG</b>	NEG	NEG
Particles >4µm		ASTM D7647	>5000	<b>8629</b>	2677	1023
Particles >6µm		ASTM D7647	>1300	<b>2971</b>	905	291
Particles >14µm		ASTM D7647	>160	<b>260</b>	90	37
Particles >21µm		ASTM D7647	>40	<b>66</b>	22	12
Particles >38µm		ASTM D7647	>10	<b>5</b>	2	1
Particles >71µm		ASTM D7647	>3	<b>0</b>	0	0
Oil Cleanliness		ISO 4406 (c)	>19/17/14	<b>20/19/15</b>	19/17/14	17/15/12
Silt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	Visual*	>0.05	<b>NEG</b>	NEG	NEG

## FLUID CONDITION

The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

Sodium	ppm	ASTM D5185(m)		<b>0</b>	0	<1
Boron	ppm	ASTM D5185(m)		<b>0</b>	0	<1
Barium	ppm	ASTM D5185(m)		<b>0</b>	0	<1
Molybdenum	ppm	ASTM D5185(m)		<b>0</b>	0	0
Manganese	ppm	ASTM D5185(m)		<b>&lt;1</b>	1	1
Magnesium	ppm	ASTM D5185(m)		<b>&lt;1</b>	<1	0
Calcium	ppm	ASTM D5185(m)		<b>0</b>	1	<1
Phosphorus	ppm	ASTM D5185(m)		<b>327</b>	317	288
Zinc	ppm	ASTM D5185(m)		<b>17</b>	21	17
Sulfur	ppm	ASTM D5185(m)		<b>339</b>	326	286
Acid Number (AN)	mg KOH/g	ASTM D974*		<b>0.21</b>	0.26	0.31
Visc @ 40°C	cSt	ASTM D7279(m)	46	<b>44.7</b>	45.3	46.4

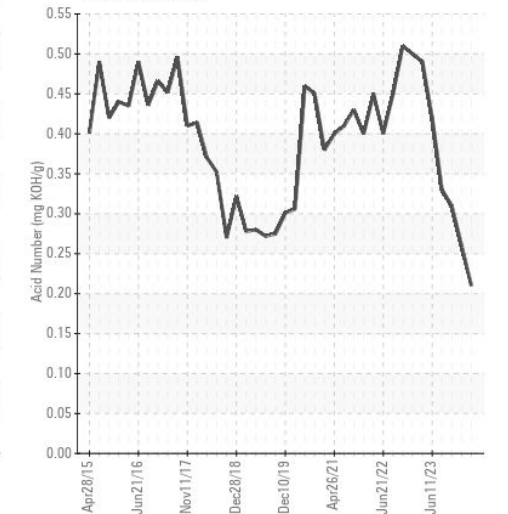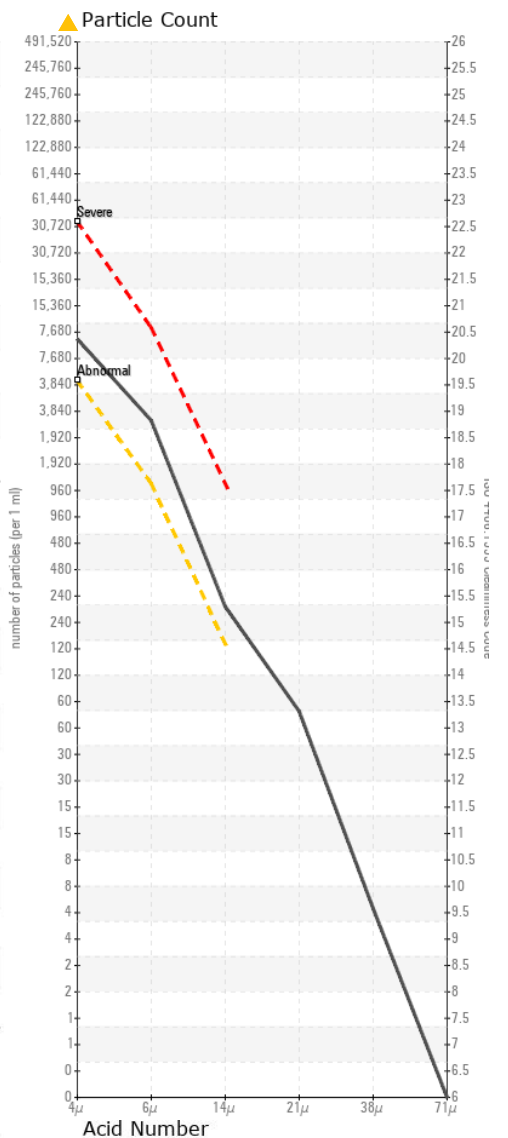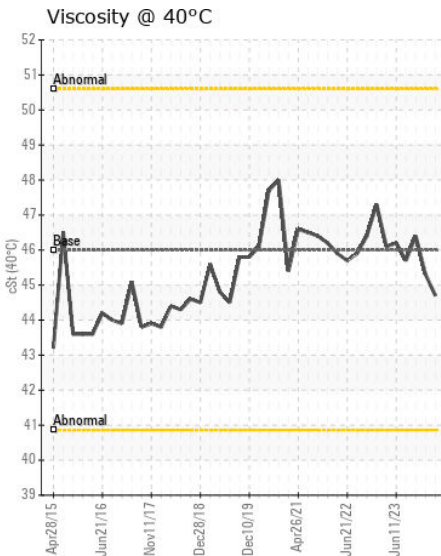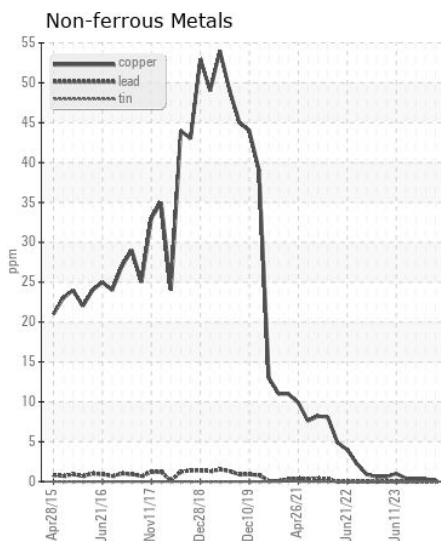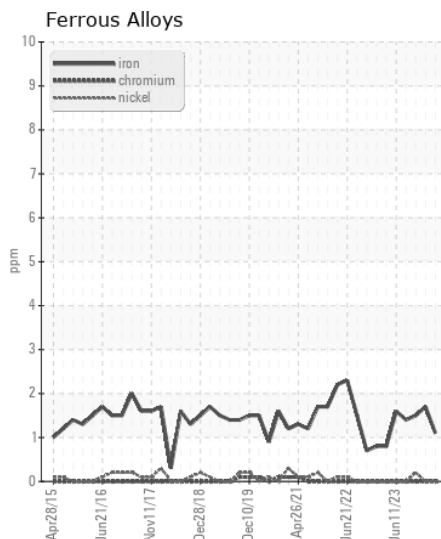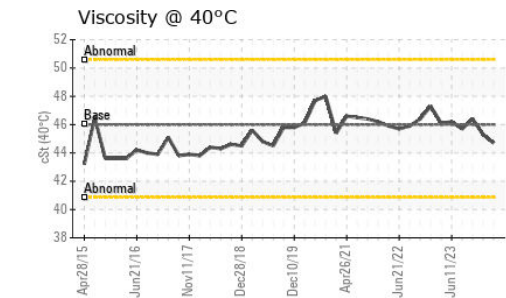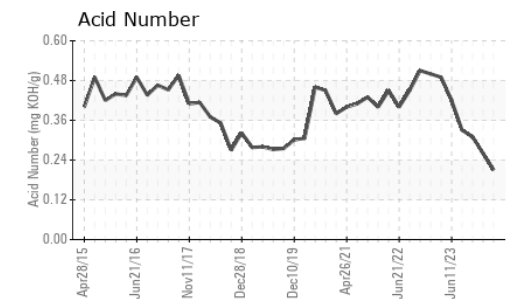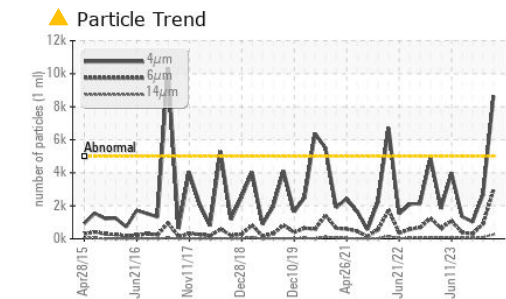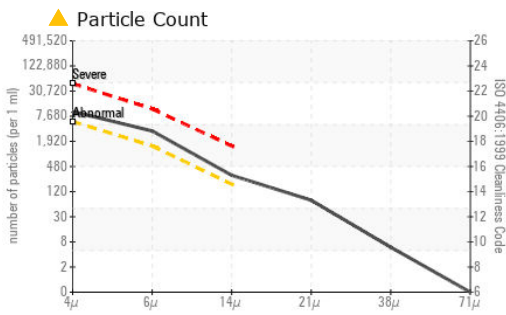

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : WC0931385  
**Lab Number** : 02633116  
**Unique Number** : 5774269  
**Test Package** : IND 2  
**Received** : 03 May 2024  
**Tested** : 06 May 2024  
**Diagnosed** : 06 May 2024 - Wes Davis

**Cargill Meat Solutions**  
 165 Dunlop Drive  
 Guelph, ON  
 CA N1L 1P4  
 Contact: Jakub Posluszny  
 jakub\_posluszny@cargill.com  
 T: (519)823-5200  
 F: (519)823-5893

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.