WEAR CONTAMINATION **FLUID CONDITION**


NORMAL NORMAL NORMAL

Machine Id

NO UNIT WC0895428

Gearbox

GEAR OIL LS 80W90 (LTR)							
Resample at the next service interval to monitor. The fluid was not specified, however, a fluid match indicates that this fluid is (GENERIC) GEAR OIL LS 80W90. Please confirm. Please specify the component make and model with your next sample.	Test	UOM	Method	Limit/Abn	Current	History1	History2
	Sample Number		Client Info		WC0895428		
	Sample Date		Client Info		02 May 2024		
	Machine Age	hrs	Client Info		0		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		N/A		
	Filter Changed		Client Info		N/A		
	Sample Status				NORMAL		
WEAR	Iron	ppm	ASTM D5185(m)	>200	94		
All component wear rates are normal.	Chromium	ppm	ASTM D5185(m)	>10	<1		
	Nickel	ppm	ASTM D5185(m)	>10	0		
	Titanium	ppm	ASTM D5185(m)		1		
	Silver	ppm	ASTM D5185(m)		0		
	Aluminum	ppm	ASTM D5185(m)	>25	3		
	Lead	ppm	ASTM D5185(m)	>50	2		
	Copper	ppm	ASTM D5185(m)	>200	80		
	Tin	ppm	ASTM D5185(m)	>10	0		
	Vanadium	ppm	ASTM D5185(m)		0		
	White Metal	scalar	Visual*	NONE	VLITE		
	Yellow Metal	scalar	Visual*	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185(m)	>50	5		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185(m)	>20	<1		
	Water		WC Method	>0.2	NEG		
	Silt	scalar	Visual*	NONE	NONE		
	Debris	scalar	Visual*	NONE	VLITE		
	Sand/Dirt	scalar	Visual*	NONE	VLITE		
	Appearance	scalar	Visual*	NORML	NORML		
	Odor	scalar	Visual*	NORML	NORML		
	Emulsified Water	scalar	Visual*	>0.2	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185(m)		3		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185(m)	150	240		
	Barium	ppm	ASTM D5185(m)		<1		
	Molybdenum	ppm	ASTM D5185(m)		0		
	Manganese	ppm	ASTM D5185(m)		2		
	Magnesium	ppm	()	10	3		
	Calcium	ppm	ASTM D5185(m)	70	79		
	Phosphorus	ppm	ASTM D5185(m)	2000	1110		
	Zinc	ppm	ASTM D5185(m)	50	40		
	Sulfur	ppm	ASTM D5185(m)	20000	557		
Papart Id: OVEDLID (MCAMIS) 02622200 (Caparated: 05/02/2004 16:47:05) Pays 1	Visc @ 40°C	cSt	ASTM D7279(m)	140	116		OVERLIR

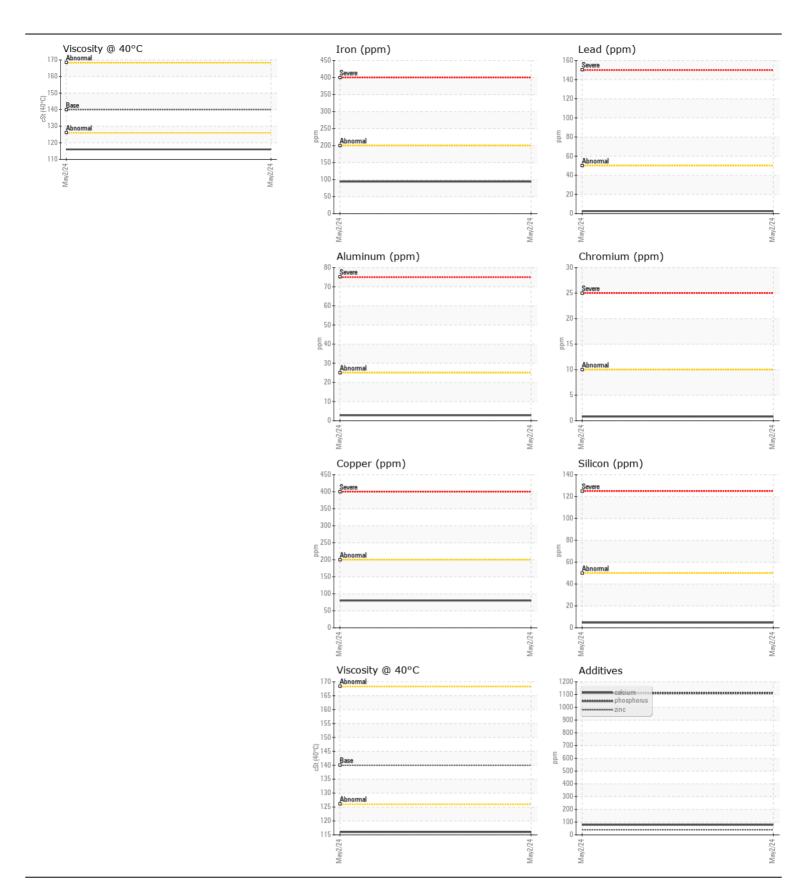



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No.

Lab Number : 02633209

Test Package : MOB 1

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : WC0895428 Unique Number : 5774362

Received : 03 May 2024 **Tested**

: 03 May 2024 Diagnosed

: 03 May 2024 - Wes Davis

CA L9H 5E2 Contact: Robert Hughes robert.hughes@ox-equipment.com T: (289)683-6037

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

F:

OX FLEET CARE

466 HIGHWAY 52

DUNDAS, ON