

**OIL ANALYSIS REPORT** 

WEAR CONTAMINATION FLUID CONDITION

NORMAL NORMAL

Area


## (C-FIOB) SKYCARE AIR AMBULANCE [53247]

[C-FIOB] METRO SA227AC P-44489C

Right Jet Turbine

EASTMAN TURBO OIL 2380 (--- GAL)

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
This is a baseline read-out on the submitted sample.	Sample Number		Client Info		GT57330	GT57683	GT57687
	Sample Date		Client Info		02 May 2024	15 Apr 2024	30 Mar 2024
	Machine Age	hrs	Client Info		0	0	0
	Oil Age	hrs	Client Info		627	555	486
	Filter Age	hrs	Client Info		63	72	76
	Oil Changed		Client Info		N/A	N/A	N/A
	Filter Changed		Client Info		N/A	N/A	N/A
	Sample Status				NORMAL		
WEAR	Iron	ppm	ASTM D5185(m)	>8	<1	<1	<1
	Chromium	ppm	ASTM D5185(m)	>2	0	0	0
	Nickel	ppm	ASTM D5185(m)	>2	0	0	0
	Silver	ppm	ASTM D5185(m)	>2	0	0	0
	Aluminum	ppm	ASTM D5185(m)	>2	<1	<1	<1
	Lead	ppm	ASTM D5185(m)	>3	<1	<1	<1
	Copper	ppm	ASTM D5185(m)	>3	<1	0	<1
CONTAMINATION	Water		WC Method	>0.1	NEG	NEG	NEG
FLUID CONDITION	Magnesium	ppm	ASTM D5185(m)	0	<1	<1	<1
	Acid Number (AN)	mg KOH/g	ASTM D974*	0.43	0.98	0.99	0.99
	Visc @ 40°C	cSt	ASTM D7279(m)	24.2	24.5	25.2	24.5

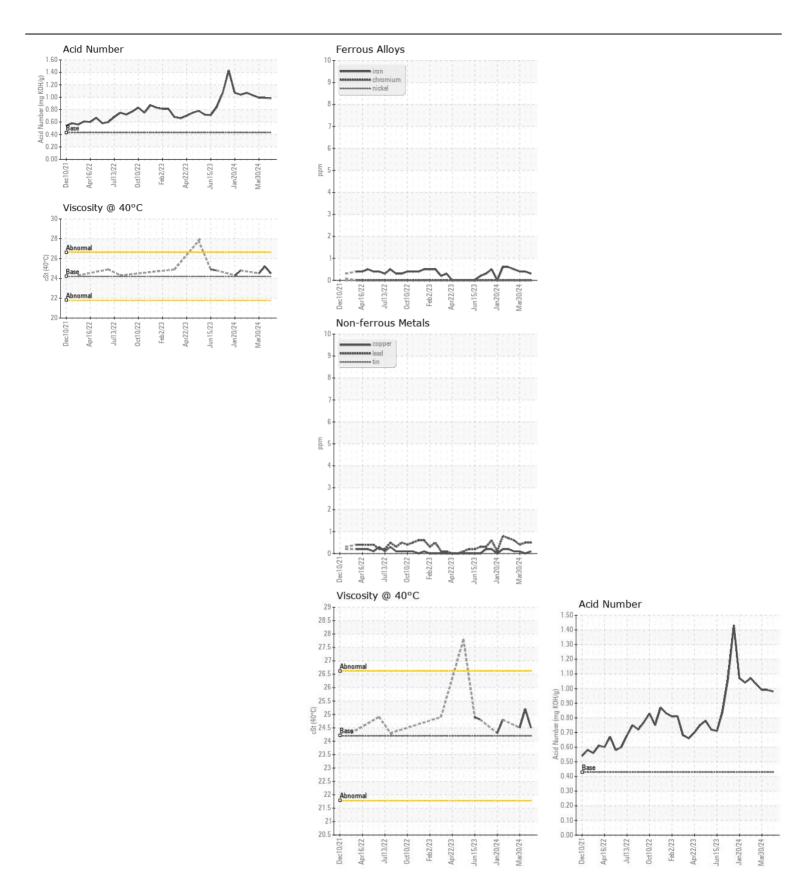



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No.

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : GT57330 Lab Number : 02633982

Unique Number : 5775135 Test Package: G331 (Additional Tests: ICP)

Received **Tested** Diagnosed

: 07 May 2024 : 07 May 2024

: 07 May 2024 - Wes Davis

**Honeywell Engines** 111 S. 34th Street, 301 Receiving, Attn: SOAP Program PHOENIX, AZ

US 85034 Contact: GARRETT

To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

T: F: (602)365-2676