



# LIEBHERR

## OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Area  
**(362878)**  
Machine Id  
**LIEBHERR LH80M 135287-1218**  
Component  
**Rear Right Wheel Hub**  
Fluid  
**GEAR OIL SAE 75W90 (--- GAL)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>LH0276233</b>	LH0284934	LH0277412
Sample Date		Client Info		<b>07 May 2024</b>	08 Feb 2024	23 Oct 2023
Machine Age	hrs	Client Info		<b>11139</b>	10128	8967
Oil Age	hrs	Client Info		<b>0</b>	0	0
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Changed</b>	Changed	Changed
Filter Changed		Client Info		<b>None</b>	None	None
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

### WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>650	<b>10</b>	6	4
Chromium	ppm	ASTM D5185(m)	>4	<b>0</b>	0	0
Nickel	ppm	ASTM D5185(m)	>4	<b>0</b>	<1	0
Titanium	ppm	ASTM D5185(m)	>4	<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)		<b>0</b>	0	<1
Aluminum	ppm	ASTM D5185(m)	>25	<b>0</b>	<1	0
Lead	ppm	ASTM D5185(m)	>4	<b>0</b>	<1	<1
Copper	ppm	ASTM D5185(m)	>60	<b>&lt;1</b>	2	1
Tin	ppm	ASTM D5185(m)	>4	<b>0</b>	0	0
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
White Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE

### CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>75	<b>&lt;1</b>	1	2
Potassium	ppm	ASTM D5185(m)	>20	<b>0</b>	<1	2
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Silt	scalar	Visual*	NONE	<b>NONE</b>	NONE	VLITE
Debris	scalar	Visual*	NONE	<b>NONE</b>	VLITE	NONE
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	Visual*	>0.2	<b>NEG</b>	NEG	NEG

### FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		<b>&lt;1</b>	<1	2
Boron	ppm	ASTM D5185(m)	400	<b>265</b>	273	318
Barium	ppm	ASTM D5185(m)	200	<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185(m)	12	<b>0</b>	0	0
Manganese	ppm	ASTM D5185(m)		<b>0</b>	0	0
Magnesium	ppm	ASTM D5185(m)	12	<b>2</b>	1	1
Calcium	ppm	ASTM D5185(m)	150	<b>14</b>	10	10
Phosphorus	ppm	ASTM D5185(m)	1650	<b>1162</b>	1174	1253
Zinc	ppm	ASTM D5185(m)	125	<b>10</b>	8	9
Sulfur	ppm	ASTM D5185(m)	22500	<b>21365</b>	20920	21530
Visc @ 40°C	cSt	ASTM D7279(m)	109	<b>100</b>	102	103

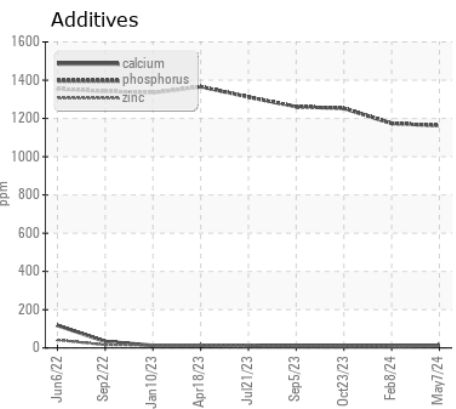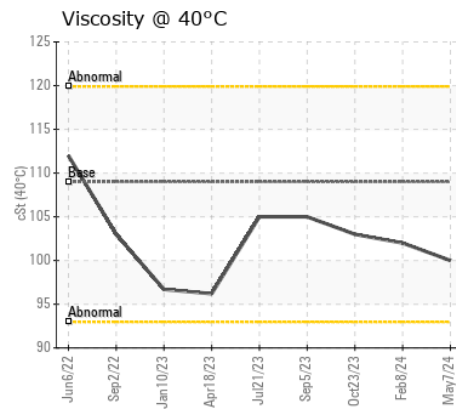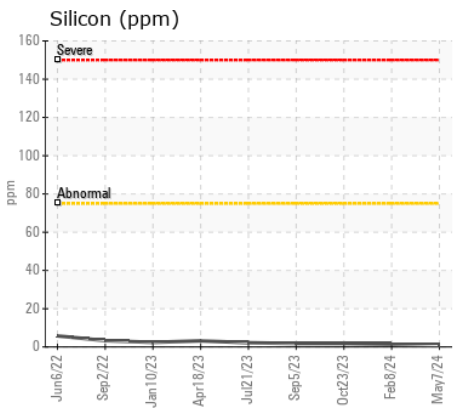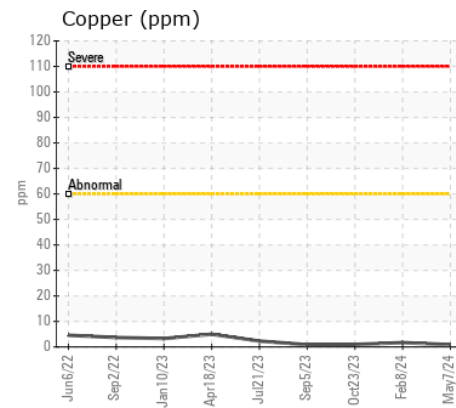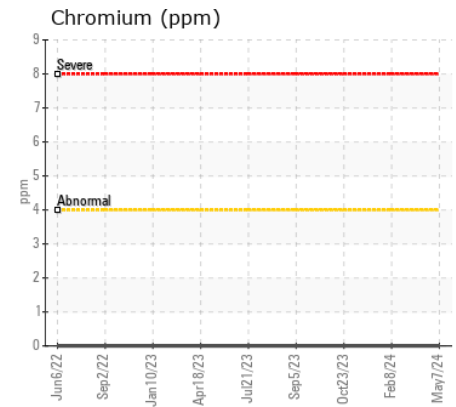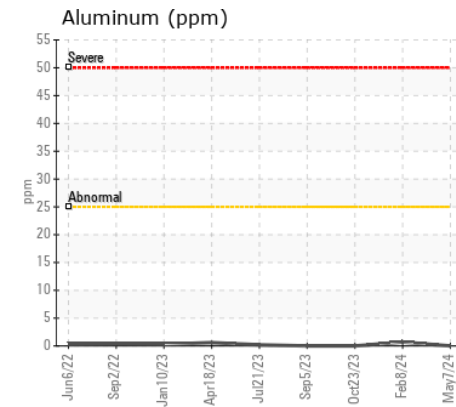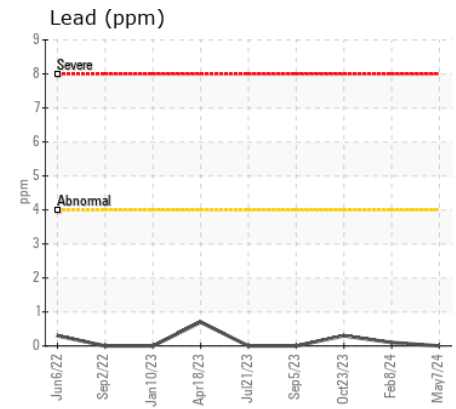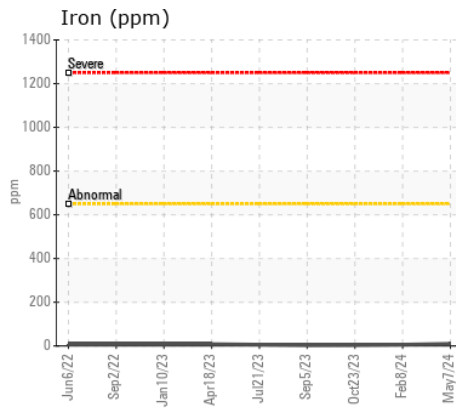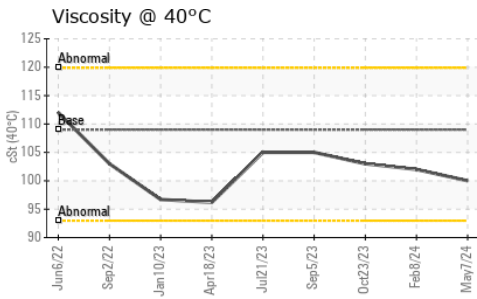

ISO 17025:2017  
Accredited  
Laboratory

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9

**Sample No.** : LH0276233

**Lab Number** : 02634153

**Unique Number** : 5775306

**Test Package** : MOB 1

**Received** : 08 May 2024

**Tested** : 08 May 2024

**Diagnosed** : 08 May 2024 - Kevin Marson

To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

Validity of results and interpretation are based on the sample and information as supplied.

**GERDAU AMERISTEEL**

1 GERDAU COURT

WHITBY, ON

CA L1N 5T1

Contact: Tyson Young

tyoung@gerdauameristeel.com

T: (905)668-8811

F: (905)668-6469