



Machine Id  
**217 JOHN ST. GEN ROOM CITY OF BARRIE PE6068T309879**  
 Component  
**Right Diesel Engine**  
 Fluid  
**ESSO XD-3 EXTRA 15W40 (20 LTR)**

**RECOMMENDATION**

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>PN0006149</b>	PN111146	PN990806
Sample Date		Client Info		<b>06 May 2024</b>	20 Apr 2018	21 Mar 2017
Machine Age	hrs	Client Info		<b>443</b>	275	265
Oil Age	hrs	Client Info		<b>21</b>	11	0
Filter Age	hrs	Client Info		<b>21</b>	11	0
Oil Changed		Client Info		<b>Changed</b>	Changed	Changed
Filter Changed		Client Info		<b>Changed</b>	Changed	Changed
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

**WEAR**

Metal levels are typical for a new component breaking in.

Iron	ppm	ASTM D5185(m)	>51	<b>2</b>	2	2
Chromium	ppm	ASTM D5185(m)	>11	<b>0</b>	0	0
Nickel	ppm	ASTM D5185(m)	>5	<b>0</b>	<1	<1
Titanium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)	>3	<b>0</b>	0	0
Aluminum	ppm	ASTM D5185(m)	>31	<b>2</b>	<1	1
Lead	ppm	ASTM D5185(m)	>26	<b>0</b>	0	<1
Copper	ppm	ASTM D5185(m)	>26	<b>&lt;1</b>	<1	<1
Tin	ppm	ASTM D5185(m)	>4	<b>0</b>	<1	0
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
White Metal	scalar	Visual*	NONE	<b>NONE</b>	---	---
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	---	---

**CONTAMINATION**











There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>22	<b>14</b>	4	6
Potassium	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	1	1
Fuel		WC Method	>2.1	<b>&lt;1.0</b>	<1.0	<1.0
Water		WC Method	>0.21	<b>NEG</b>	NEG	NEG
Glycol		WC Method		<b>NEG</b>	NEG	NEG
Soot %	%	ASTM D7844*	>3	<b>0</b>	0	0
Nitration	Abs/cm	ASTM D7624*	>20	<b>4.2</b>	4.5	6.8
Sulfation	Abs/.1mm	ASTM D7415*	>30	<b>19.2</b>	18.0	19.0
Silt	scalar	Visual*	NONE	<b>NONE</b>	---	---
Debris	scalar	Visual*	NONE	<b>VLITE</b>	---	---
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	---	---
Appearance	scalar	Visual*	NORML	<b>NORML</b>	---	---
Odor	scalar	Visual*	NORML	<b>NORML</b>	---	---
Emulsified Water	scalar	Visual*	>0.21	<b>NEG</b>	NEG	NEG

**FLUID CONDITION**

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)	>192	<b>1</b>	3	<1
Boron	ppm	ASTM D5185(m)		<b>430</b>	3	7
Barium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185(m)		<b>78</b>	58	12
Manganese	ppm	ASTM D5185(m)		<b>0</b>	0	<1
Magnesium	ppm	ASTM D5185(m)		<b>355</b>	911	203
Calcium	ppm	ASTM D5185(m)	3780	<b>1430</b>	1161	2002
Phosphorus	ppm	ASTM D5185(m)	1370	<b>1010</b>	1042	932
Zinc	ppm	ASTM D5185(m)	1500	<b>1183</b>	1228	1086
Sulfur	ppm	ASTM D5185(m)	3800	<b>2757</b>	2753	2743
Oxidation	Abs/.1mm	ASTM D7414*	>25	<b>12.5</b>	13.2	11.3
Visc @ 100°C	cSt	ASTM D7279(m)	15.4	<b>14.3</b>	14.9	13.8

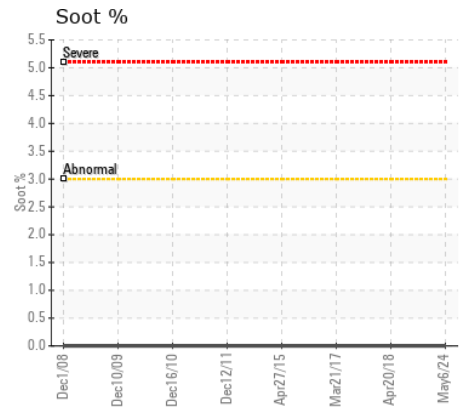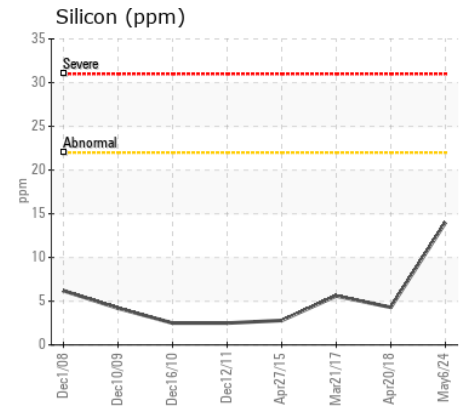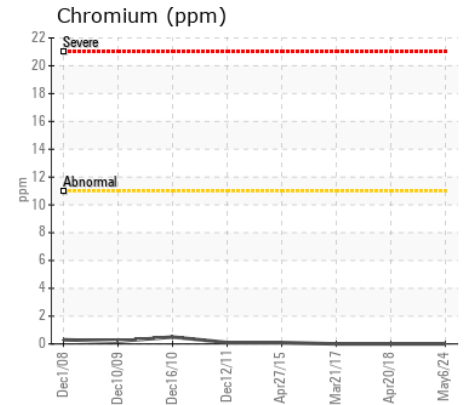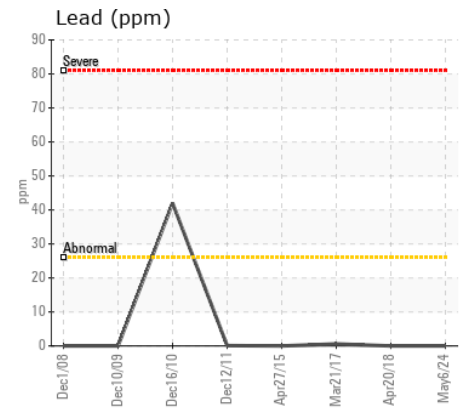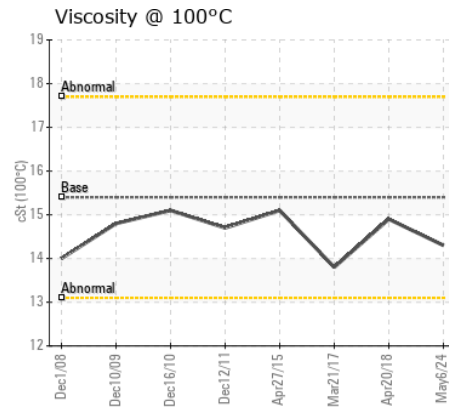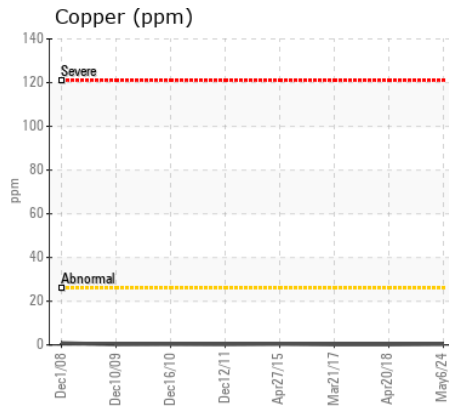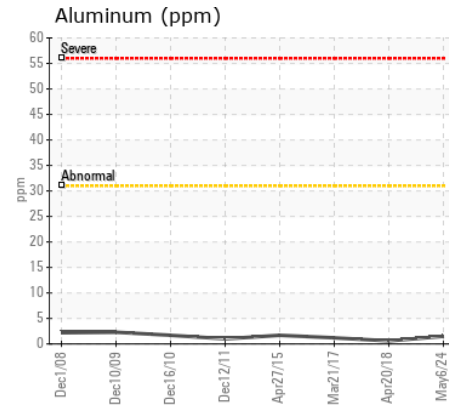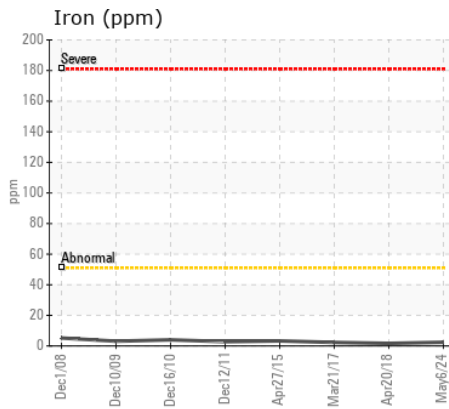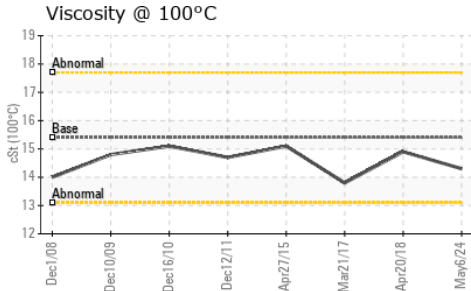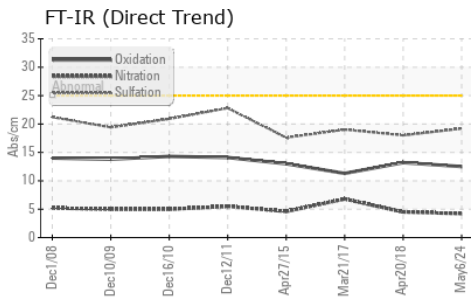

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : PN0006149 **Received** : 13 May 2024  
**Lab Number** : 02634895 **Tested** : 13 May 2024  
**Unique Number** : 5776048 **Diagnosed** : 13 May 2024 - Wes Davis  
**Test Package** : MOB 1 ( Additional Tests: Visual )

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.

**POWER STATION INC.**  
 1050 JAYSON COURT  
 MISSISSAUGA, ON  
 CA L4W 2V5  
 Contact: Ryan Udall  
 rudall@pwrstn.com  
 T: (905)565-1621  
 F: (905)629-1499