



WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>

Machine Id  
**713070**  
 Component  
**Transmission (Auto)**  
 Fluid  
**CASTROL TRANSYND 668 (--- GAL)**

**RECOMMENDATION**

Échantillonner de nouveau l'équipement au prochain intervalle de vidange afin d'en surveiller la condition.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>GFL0120717</b>	---	---
Sample Date		Client Info		<b>13 May 2024</b>	---	---
Machine Age	kms	Client Info		<b>14286</b>	---	---
Oil Age	kms	Client Info		<b>0</b>	---	---
Filter Age	kms	Client Info		<b>0</b>	---	---
Oil Changed		Client Info		<b>N/A</b>	---	---
Filter Changed		Client Info		<b>N/A</b>	---	---
Sample Status				<b>NORMAL</b>	---	---

**WEAR**

Les taux d'usure de tous les composants sont normaux.

Iron	ppm	ASTM D5185(m)	>160	<b>43</b>	---	---
Chromium	ppm	ASTM D5185(m)	>5	<b>0</b>	---	---
Nickel	ppm	ASTM D5185(m)	>5	<b>&lt;1</b>	---	---
Titanium	ppm	ASTM D5185(m)		<b>0</b>	---	---
Silver	ppm	ASTM D5185(m)	>5	<b>0</b>	---	---
Aluminum	ppm	ASTM D5185(m)	>50	<b>18</b>	---	---
Lead	ppm	ASTM D5185(m)	>50	<b>11</b>	---	---
Copper	ppm	ASTM D5185(m)	>225	<b>7</b>	---	---
Tin	ppm	ASTM D5185(m)	>10	<b>2</b>	---	---
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	---	---
White Metal	scalar	Visual*	NONE	<b>NONE</b>	---	---
Yellow Metal	scalar	Visual*	NONE	<b>VLITE</b>	---	---

**CONTAMINATION**










Il n'y a aucun indice de contamination dans le fluide.

Silicon	ppm	ASTM D5185(m)	>20	<b>4</b>	---	---
Potassium	ppm	ASTM D5185(m)	>20	<b>4</b>	---	---
Water		WC Method	>0.1	<b>NEG</b>	---	---
Silt	scalar	Visual*	NONE	<b>NONE</b>	---	---
Debris	scalar	Visual*	NONE	<b>VLITE</b>	---	---
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	---	---
Appearance	scalar	Visual*	NORML	<b>NORML</b>	---	---
Odor	scalar	Visual*	NORML	<b>NORML</b>	---	---
Emulsified Water	scalar	Visual*	>0.1	<b>NEG</b>	---	---

**FLUID CONDITION**

L'état de le fluide est acceptable pour la durée de service.

Sodium	ppm	ASTM D5185(m)		<b>5</b>	---	---
Boron	ppm	ASTM D5185(m)		<b>91</b>	---	---
Barium	ppm	ASTM D5185(m)		<b>&lt;1</b>	---	---
Molybdenum	ppm	ASTM D5185(m)		<b>0</b>	---	---
Manganese	ppm	ASTM D5185(m)		<b>1</b>	---	---
Magnesium	ppm	ASTM D5185(m)		<b>1</b>	---	---
Calcium	ppm	ASTM D5185(m)		<b>75</b>	---	---
Phosphorus	ppm	ASTM D5185(m)		<b>255</b>	---	---
Zinc	ppm	ASTM D5185(m)		<b>7</b>	---	---
Sulfur	ppm	ASTM D5185(m)		<b>1008</b>	---	---
Visc @ 40°C	cSt	ASTM D7279(m)	33	<b>35.2</b>	---	---

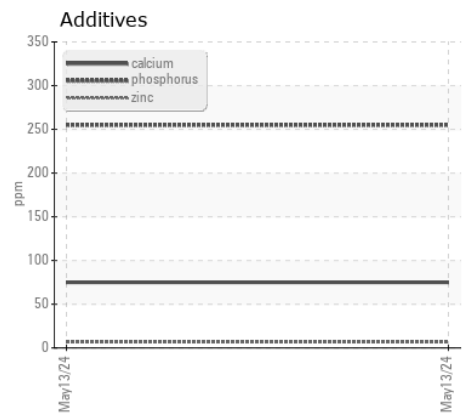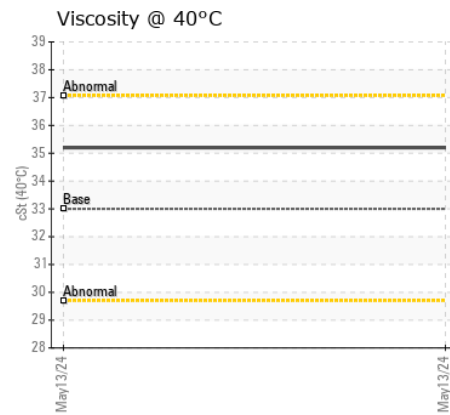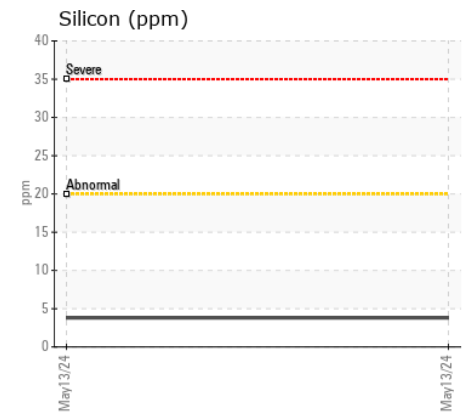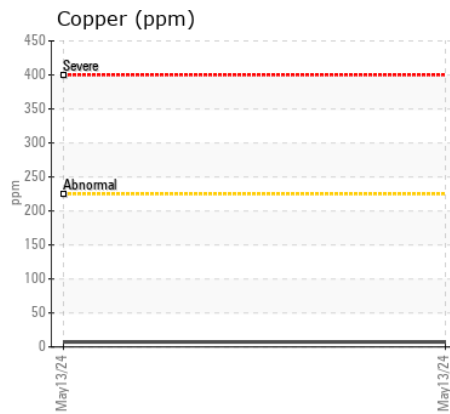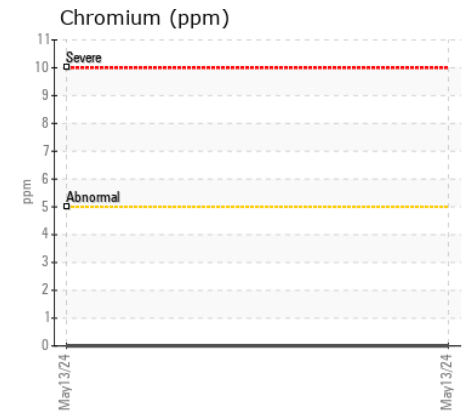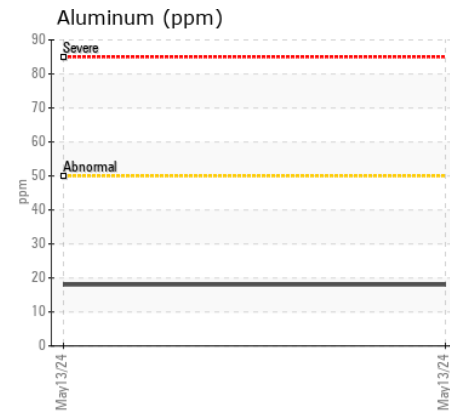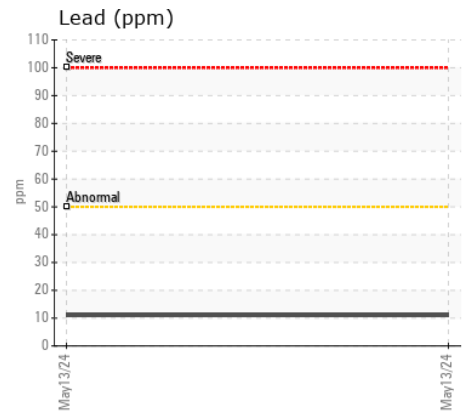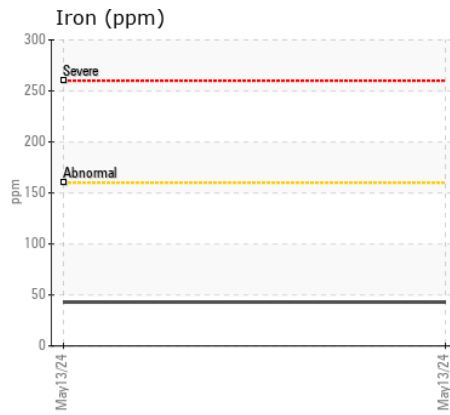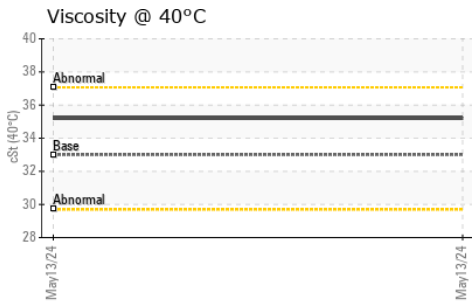

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : GFL0120717  
**Lab Number** : 02636967  
**Unique Number** : 5786129  
**Test Package** : MOB 1  
**Received** : 22 May 2024  
**Tested** : 22 May 2024  
**Diagnosed** : 22 May 2024 - Wes Davis

**GFL Environmental - 747 - GMA - Solid Waste**  
 4 Chemin du Tremblay,  
 Boucherville, QC  
 CA J4B 6Z5  
 Contact: Steve Voyer  
 svoyer@matrec.ca

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.

T:  
F: