



WEAR	<b>NORMAL</b>
CONTAMINATION	<b>MARGINAL</b>
FLUID CONDITION	<b>NORMAL</b>

Machine Id  
**OE1873**  
Component  
**Diesel Engine**  
Fluid  
**PETRO CANADA DURON SHP 15W40 (34 LTR)**

**RECOMMENDATION**

No corrective action is recommended at this time. Confirm the source of the lubricant being utilized for top-up/fill. Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>GFL0113396</b>	---	---
Sample Date		Client Info		<b>22 May 2024</b>	---	---
Machine Age	hrs	Client Info		<b>0</b>	---	---
Oil Age	hrs	Client Info		<b>0</b>	---	---
Filter Age	hrs	Client Info		<b>0</b>	---	---
Oil Changed		Client Info		<b>N/A</b>	---	---
Filter Changed		Client Info		<b>N/A</b>	---	---
Sample Status				<b>MARGINAL</b>	---	---

**WEAR**

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>100	<b>17</b>	---	---
Chromium	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	---	---
Nickel	ppm	ASTM D5185(m)	>50	<b>0</b>	---	---
Titanium	ppm	ASTM D5185(m)	>2	<b>0</b>	---	---
Silver	ppm	ASTM D5185(m)	>2	<b>0</b>	---	---
Aluminum	ppm	ASTM D5185(m)	>50	<b>3</b>	---	---
Lead	ppm	ASTM D5185(m)	>40	<b>4</b>	---	---
Copper	ppm	ASTM D5185(m)	>330	<b>81</b>	---	---
Tin	ppm	ASTM D5185(m)	>15	<b>0</b>	---	---
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	---	---
White Metal	scalar	Visual*	NONE	<b>NONE</b>	---	---
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	---	---

**CONTAMINATION**













Light fuel dilution occurring. No other contaminants were detected in the oil.

Silicon	ppm	ASTM D5185(m)	>25	<b>2</b>	---	---
Potassium	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	---	---
Fuel	%	ASTM D7593*	>5	<b>3.9</b>	---	---
Water		WC Method	>0.2	<b>NEG</b>	---	---
Glycol		WC Method		<b>NEG</b>	---	---
Soot %	%	ASTM D7844*	>3	<b>0.3</b>	---	---
Nitration	Abs/cm	ASTM D7624*	>20	<b>9.8</b>	---	---
Sulfation	Abs/.1mm	ASTM D7415*	>30	<b>20.8</b>	---	---
Silt	scalar	Visual*	NONE	<b>NONE</b>	---	---
Debris	scalar	Visual*	NONE	<b>NONE</b>	---	---
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	---	---
Appearance	scalar	Visual*	NORML	<b>NORML</b>	---	---
Odor	scalar	Visual*	NORML	<b>NORML</b>	---	---
Emulsified Water	scalar	Visual*	>0.2	<b>NEG</b>	---	---

**FLUID CONDITION**

Additive levels indicate the addition of a different brand, or type of oil. The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		<b>2</b>	---	---
Boron	ppm	ASTM D5185(m)	0	<b>29</b>	---	---
Barium	ppm	ASTM D5185(m)	0	<b>0</b>	---	---
Molybdenum	ppm	ASTM D5185(m)	60	<b>73</b>	---	---
Manganese	ppm	ASTM D5185(m)	0	<b>0</b>	---	---
Magnesium	ppm	ASTM D5185(m)	1010	<b>260</b>	---	---
Calcium	ppm	ASTM D5185(m)	1070	<b>1887</b>	---	---
Phosphorus	ppm	ASTM D5185(m)	1150	<b>934</b>	---	---
Zinc	ppm	ASTM D5185(m)	1270	<b>1142</b>	---	---
Sulfur	ppm	ASTM D5185(m)	2060	<b>2618</b>	---	---
Oxidation	Abs/.1mm	ASTM D7414*	>25	<b>16.3</b>	---	---
Visc @ 100°C	cSt	ASTM D7279(m)	15.4	<b>12.6</b>	---	---

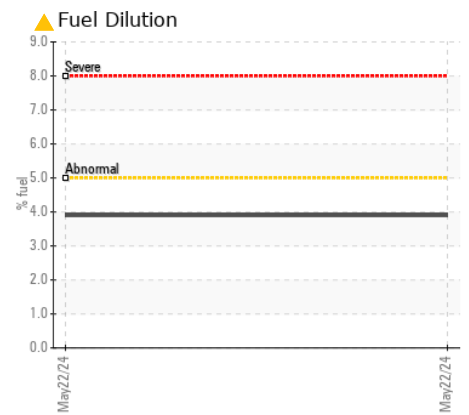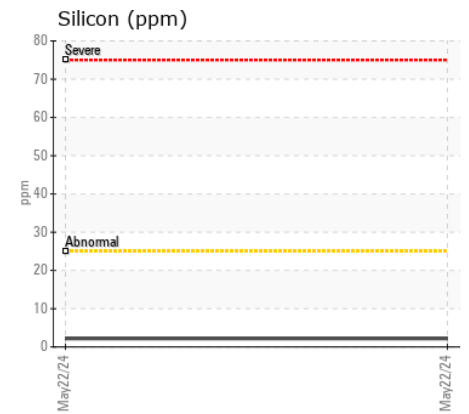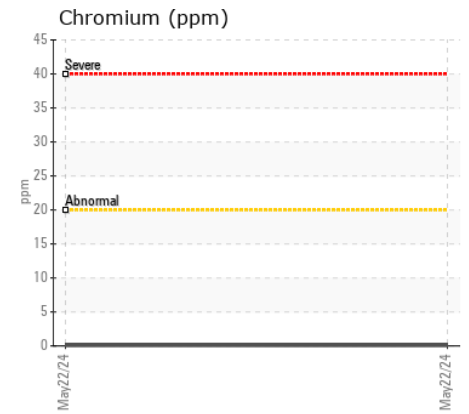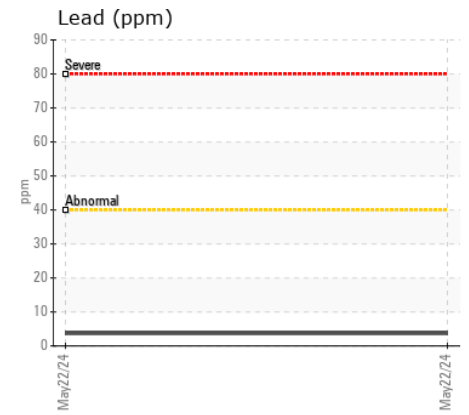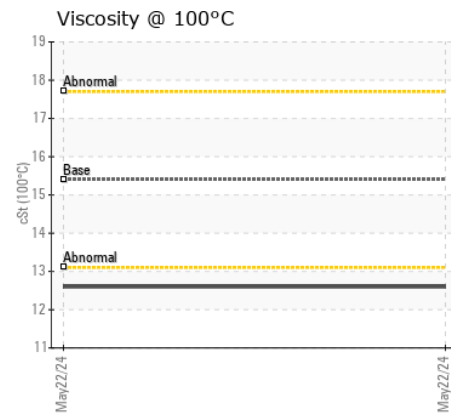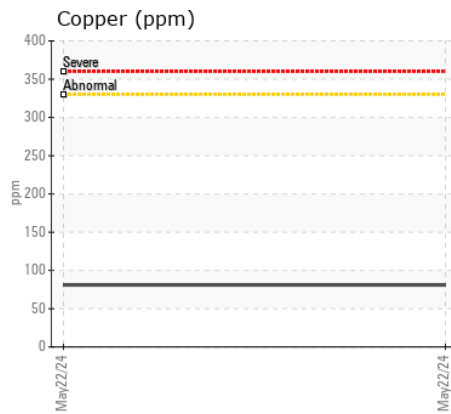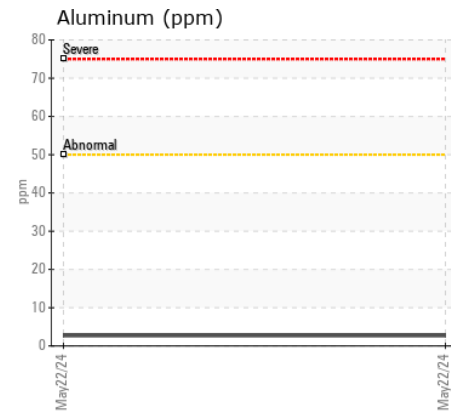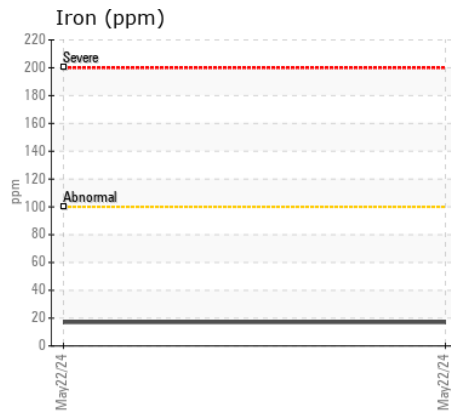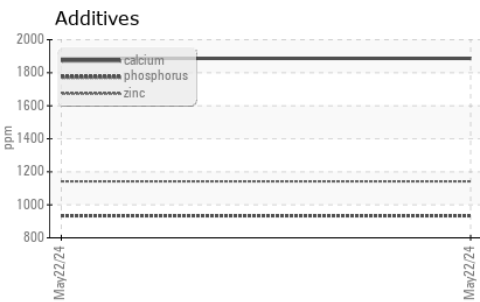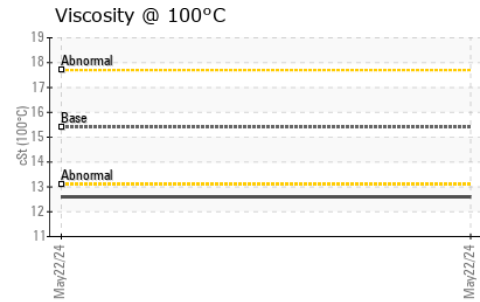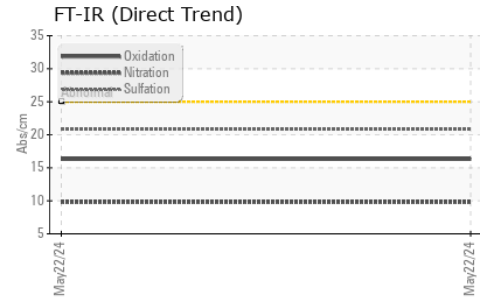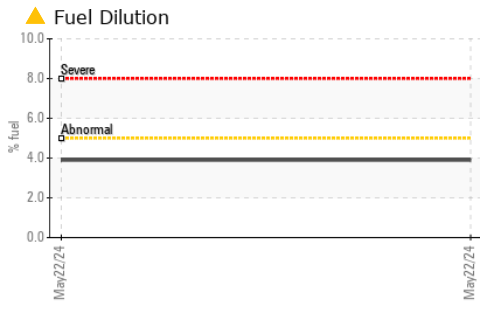

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : GFL0113396 **Received** : 23 May 2024  
**Lab Number** : 02637082 **Tested** : 24 May 2024  
**Unique Number** : 5786244 **Diagnosed** : 24 May 2024 - Wes Davis  
**Test Package** : MOB 1 ( Additional Tests: FuelDilution, PercentFuel, Visual )

**GFL Environmental - 720 - Lafleche - Landfill**  
 17125 Lafleche Road,  
 Moose Creek, ON  
 CA K0C 1W0  
 Contact: Charles Bergeron  
 cbergeron@gflenv.com  
 T: (613)538-4853  
 F:

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.