



# LIEBHERR

## OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Machine Id  
**LIEBHERR R930 052446-1716**

Component  
**Splitter Box**

Fluid  
**PETRO CANADA TRAXON SYNTHETIC 75W90 (--- GAL)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>LH0286577</b>	LH0274330	LH0202861
Sample Date		Client Info		<b>16 May 2024</b>	10 Nov 2023	12 Jun 2023
Machine Age	hrs	Client Info		<b>3969</b>	3497	2977
Oil Age	hrs	Client Info		<b>0</b>	0	0
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Changed</b>	Changed	Changed
Filter Changed		Client Info		<b>N/A</b>	N/A	N/A
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

### WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>100	<b>19</b>	18	16
Chromium	ppm	ASTM D5185(m)	>5	<b>0</b>	0	0
Nickel	ppm	ASTM D5185(m)	>5	<b>0</b>	<1	0
Titanium	ppm	ASTM D5185(m)		<b>4</b>	1	<1
Silver	ppm	ASTM D5185(m)		<b>0</b>	<1	0
Aluminum	ppm	ASTM D5185(m)	>20	<b>1</b>	<1	<1
Lead	ppm	ASTM D5185(m)	>30	<b>0</b>	<1	0
Copper	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	<1	<1
Tin	ppm	ASTM D5185(m)	>10	<b>0</b>	0	0
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
White Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE

### CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>30	<b>6</b>	4	3
Potassium	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	<1	0
Water		WC Method	>0.1	<b>NEG</b>	NEG	NEG
Silt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	Visual*	>0.1	<b>NEG</b>	NEG	NEG

### FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)	>25	<b>2</b>	2	2
Boron	ppm	ASTM D5185(m)	328	<b>218</b>	244	206
Barium	ppm	ASTM D5185(m)	1	<b>&lt;1</b>	<1	0
Molybdenum	ppm	ASTM D5185(m)		<b>0</b>	0	<1
Manganese	ppm	ASTM D5185(m)		<b>0</b>	0	<1
Magnesium	ppm	ASTM D5185(m)	1	<b>16</b>	10	8
Calcium	ppm	ASTM D5185(m)	7	<b>155</b>	82	41
Phosphorus	ppm	ASTM D5185(m)	1145	<b>1135</b>	1288	1457
Zinc	ppm	ASTM D5185(m)	3	<b>104</b>	62	34
Sulfur	ppm	ASTM D5185(m)	17909	<b>18956</b>	20486	22186
Visc @ 40°C	cSt	ASTM D7279(m)	99.6	<b>97.3</b>	107	120

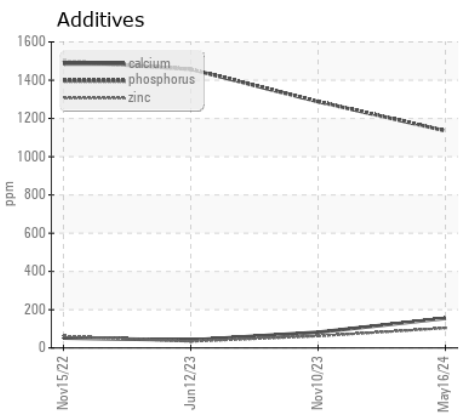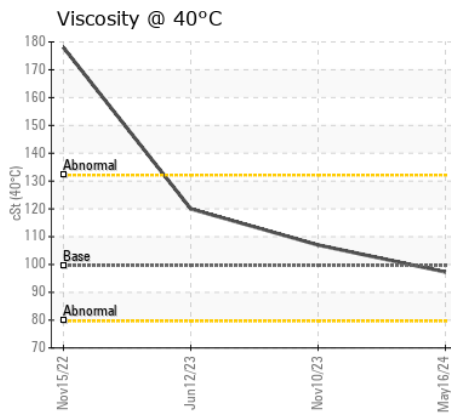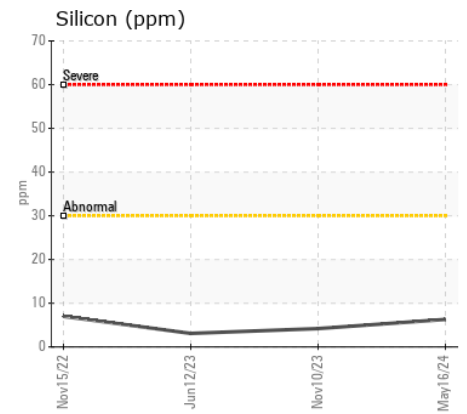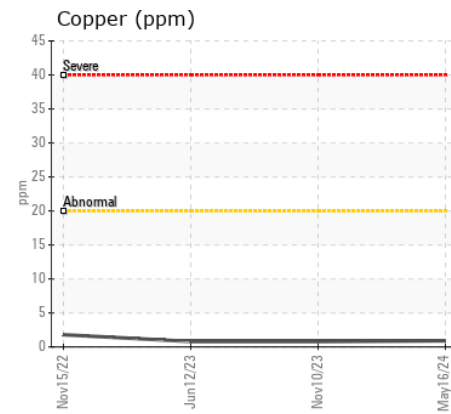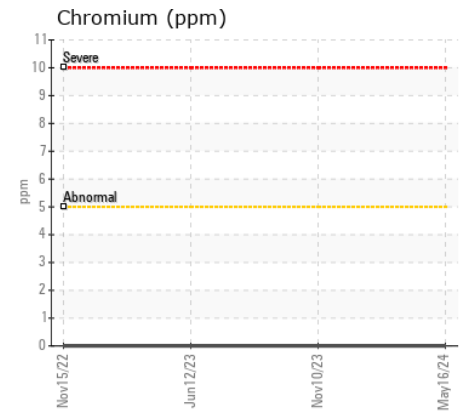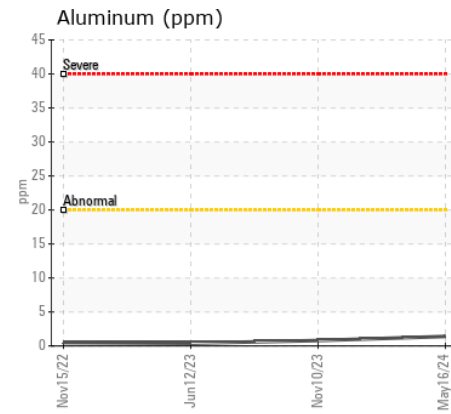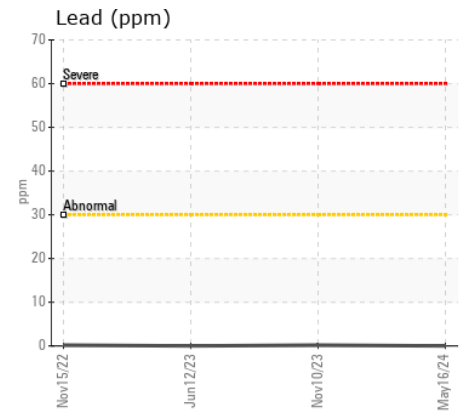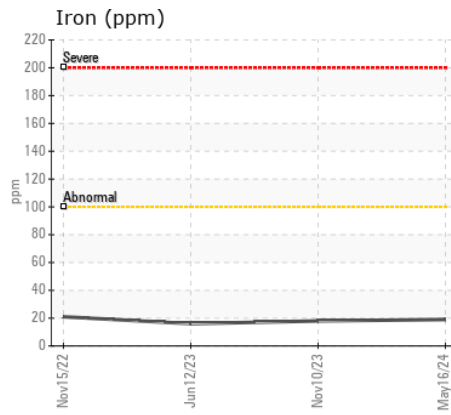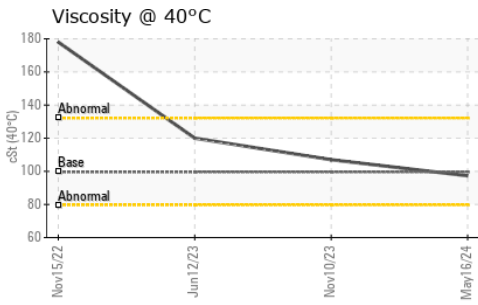

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : LH0286577  
**Lab Number** : 02637283  
**Unique Number** : 5786445  
**Test Package** : MOB 1  
**Received** : 23 May 2024  
**Tested** : 23 May 2024  
**Diagnosed** : 23 May 2024 - Wes Davis

**THOMAS CAVANAGH CONSTRUCTION LTD**  
 RR # 2, 9094 CAVANAGH ROAD  
 ASHTON, ON  
 CA K0A 1B0  
 Contact: Keith

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.

T: (613)257-4995  
 F: (613)253-0071