

**OIL ANALYSIS REPORT** 

WEAR CONTAMINATION FLUID CONDITION

NORMAL NORMAL NORMAL

Area


## SKYCARE AIR AMBULANCE [53292]


**FAIRCHILD SA227 P-44470C (S/N AC632)** 


Right Jet Turbine


EASTMAN TURBO OIL 2380 (--- GAL)


<u></u>							
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
This is a baseline read-out on the submitted sample.	Sample Number		Client Info		GT57808	GT57806	GT57814
	Sample Date		Client Info		19 May 2024	07 May 2024	15 Apr 2024
	Machine Age	hrs	Client Info		0	0	0
	Oil Age	hrs	Client Info		170	111	38
	Filter Age	hrs	Client Info		60	72	38
	Oil Changed		Client Info		N/A	N/A	N/A
	Filter Changed		Client Info		N/A	N/A	N/A
	Sample Status				NORMAL		NORMAL
WEAR	Iron	ppm	ASTM D5185(m)	>8	0	0	0
	Chromium	ppm	ASTM D5185(m)	>2	0	0	0
	Nickel	ppm	ASTM D5185(m)	>2	0	0	0
	Silver	ppm	ASTM D5185(m)	>2	0	0	0
	Aluminum	ppm	ASTM D5185(m)	>2	<1	<1	<1
	Lead	ppm	ASTM D5185(m)	>3	<1	<1	<1
	Copper	ppm	ASTM D5185(m)	>3	0	0	0
CONTAMINATION	Water		WC Method	>0.1	NEG	NEG	NEG
FLUID CONDITION	Magnesium	ppm	ASTM D5185(m)	0	0	0	0
	Acid Number (AN)	mg KOH/g	ASTM D974*	0.43	0.58	0.53	0.57
	Visc @ 40°C	cSt	ASTM D7279(m)	24.2	23.9		24.6

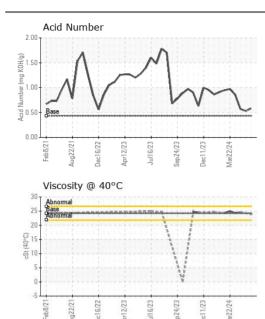

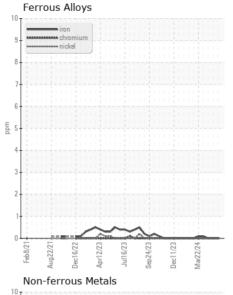

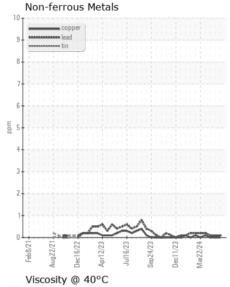

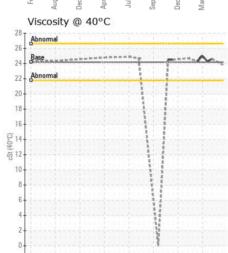

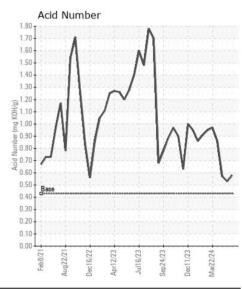



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No.

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : GT57808 Lab Number : 02637344 Unique Number : 5786506

Received **Tested** Diagnosed

Apr12/23

: 23 May 2024 : 23 May 2024

Dec11/23

: 23 May 2024 - Wes Davis

111 S. 34th Street, 301 Receiving, Attn: SOAP Program

PHOENIX, AZ US 85034 Contact: GARRETT

Test Package : G331 ( Additional Tests: ICP ) To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

T: F: (602)365-2676

**Honeywell Engines**