



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Area
{UNASSIGNED}

Machine Id
Storage Tank No. 57 Steering Gear (S/N Tk57)

Component
Hydraulic System

Fluid
CASTROL HYSPIN AWH-M ISO 32 (720 LTR)

RECOMMENDATION

Resample at the next service interval to monitor. Please specify the component make and model with your next sample. Please contact your representative for information regarding the proper sampling kits for your service. NOTE: We recommend using MAR 2 test kits, this testkit includes Particle Count to determine the ISO cleanliness of the fluid. this testkit includes AN to determine the suitability of the oil for continued use. (Customer Sample Comment: Storage Tank)

WEAR

All component wear rates are normal.





CONTAMINATION

There is no indication of any contamination in the component(unconfirmed).

FLUID CONDITION

The condition of the oil is acceptable for the time in service (unconfirmed).

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		WC0787194	---	---
Sample Date		Client Info		20 Mar 2024	---	---
Machine Age	hrs	Client Info		0	---	---
Oil Age	hrs	Client Info		0	---	---
Filter Age	hrs	Client Info		0	---	---
Oil Changed		Client Info		N/A	---	---
Filter Changed		Client Info		N/A	---	---
Sample Status				NORMAL	---	---
Iron	ppm	ASTM D5185(m)	>20	0	---	---
Chromium	ppm	ASTM D5185(m)	>10	0	---	---
Nickel	ppm	ASTM D5185(m)	>10	0	---	---
Titanium	ppm	ASTM D5185(m)		0	---	---
Silver	ppm	ASTM D5185(m)		0	---	---
Aluminum	ppm	ASTM D5185(m)	>10	0	---	---
Lead	ppm	ASTM D5185(m)	>10	0	---	---
Copper	ppm	ASTM D5185(m)	>75	<1	---	---
Tin	ppm	ASTM D5185(m)	>10	0	---	---
Vanadium	ppm	ASTM D5185(m)		0	---	---
White Metal	scalar	Visual*	NONE	NONE	---	---
Yellow Metal	scalar	Visual*	NONE	NONE	---	---
Silicon	ppm	ASTM D5185(m)	>20	0	---	---
Potassium	ppm	ASTM D5185(m)	>20	<1	---	---
Water		WC Method	>0.1	NEG	---	---
Silt	scalar	Visual*	NONE	NONE	---	---
Debris	scalar	Visual*	NONE	VLITE	---	---
Sand/Dirt	scalar	Visual*	NONE	NONE	---	---
Appearance	scalar	Visual*	NORML	NORML	---	---
Odor	scalar	Visual*	NORML	NORML	---	---
Emulsified Water	scalar	Visual*	>0.1	NEG	---	---
Sodium	ppm	ASTM D5185(m)		<1	---	---
Boron	ppm	ASTM D5185(m)		<1	---	---
Barium	ppm	ASTM D5185(m)		0	---	---
Molybdenum	ppm	ASTM D5185(m)		0	---	---
Manganese	ppm	ASTM D5185(m)		0	---	---
Magnesium	ppm	ASTM D5185(m)		<1	---	---
Calcium	ppm	ASTM D5185(m)		78	---	---
Phosphorus	ppm	ASTM D5185(m)		434	---	---
Zinc	ppm	ASTM D5185(m)		277	---	---
Sulfur	ppm	ASTM D5185(m)		2811	---	---
Visc @ 40°C	cSt	ASTM D7279(m)	32.0	32.1	---	---

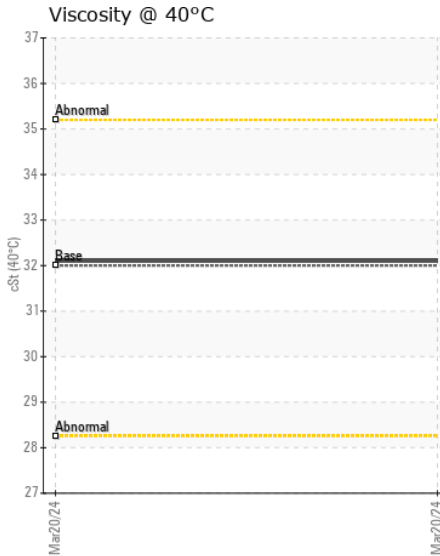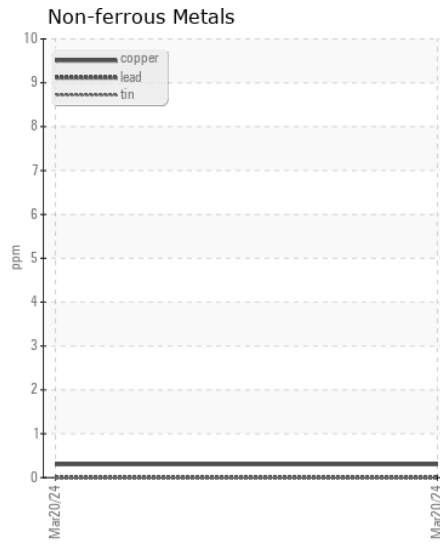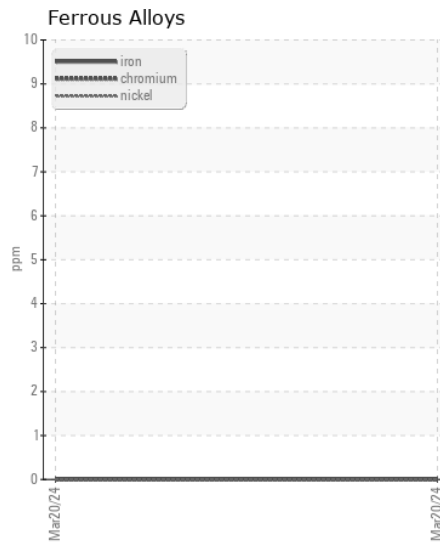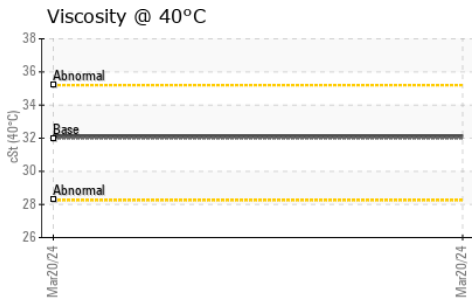

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0787194
Lab Number : 02638483
Unique Number : 5787645
Test Package : MAR 1

Horizon Maritime Services Ltd. - K.J. Gardner
 101 Research Drive, Main Floor
 Dartmouth, NS
 CA B2Y 4T6
 Contact: Chief engineer
 cheng.kjgardner@kotugcanada.ca
 T: (250)208-7255
 F:

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.