



WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>

Machine Id  
**810053**  
 Component  
**Diesel Engine**  
 Fluid  
**PETRO CANADA DURON SHP 15W40 (--- GAL)**

**RECOMMENDATION**

Resample at the next service interval to monitor. Please specify the component make and model with your next sample.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>GFL0093978</b>	GFL0093960	GFL0093938
Sample Date		Client Info		<b>27 May 2024</b>	04 Mar 2024	18 Dec 2023
Machine Age	hrs	Client Info		<b>0</b>	5147	0
Oil Age	hrs	Client Info		<b>0</b>	0	0
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>N/A</b>	N/A	N/A
Filter Changed		Client Info		<b>N/A</b>	N/A	N/A
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

**WEAR**

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>100	<b>20</b>	21	27
Chromium	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	<1	<1
Nickel	ppm	ASTM D5185(m)	>4	<b>0</b>	<1	<1
Titanium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)	>3	<b>0</b>	0	0
Aluminum	ppm	ASTM D5185(m)	>20	<b>3</b>	6	10
Lead	ppm	ASTM D5185(m)	>40	<b>0</b>	0	<1
Copper	ppm	ASTM D5185(m)	>330	<b>2</b>	2	2
Tin	ppm	ASTM D5185(m)	>15	<b>0</b>	0	<1
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
White Metal	scalar	Visual*	NONE	<b>NONE</b>	---	---
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	---	---

**CONTAMINATION**











There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>25	<b>2</b>	4	7
Potassium	ppm	ASTM D5185(m)	>20	<b>4</b>	7	13
Fuel		WC Method	>5	<b>&lt;1.0</b>	<1.0	<1.0
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Glycol		WC Method		<b>NEG</b>	NEG	NEG
Soot %	%	ASTM D7844*	>3	<b>0.4</b>	0.4	0.5
Nitration	Abs/cm	ASTM D7624*	>20	<b>9.7</b>	9.7	9.8
Sulfation	Abs/.1mm	ASTM D7415*	>30	<b>21.3</b>	20.5	21.0
Silt	scalar	Visual*	NONE	<b>VLITE</b>	---	---
Debris	scalar	Visual*	NONE	<b>NONE</b>	---	---
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	---	---
Appearance	scalar	Visual*	NORML	<b>NORML</b>	---	---
Odor	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	Visual*	>0.2	<b>NEG</b>	NEG	NEG

**FLUID CONDITION**

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		<b>8</b>	9	9
Boron	ppm	ASTM D5185(m)	0	<b>4</b>	6	4
Barium	ppm	ASTM D5185(m)	0	<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185(m)	60	<b>60</b>	59	60
Manganese	ppm	ASTM D5185(m)	0	<b>&lt;1</b>	0	0
Magnesium	ppm	ASTM D5185(m)	1010	<b>955</b>	924	945
Calcium	ppm	ASTM D5185(m)	1070	<b>1084</b>	1111	1169
Phosphorus	ppm	ASTM D5185(m)	1150	<b>989</b>	987	1021
Zinc	ppm	ASTM D5185(m)	1270	<b>1182</b>	1150	1188
Sulfur	ppm	ASTM D5185(m)	2060	<b>2385</b>	2566	2610
Oxidation	Abs/.1mm	ASTM D7414*	>25	<b>18.3</b>	17.7	17.8
Visc @ 100°C	cSt	ASTM D7279(m)	15.4	<b>13.6</b>	13.4	13.5

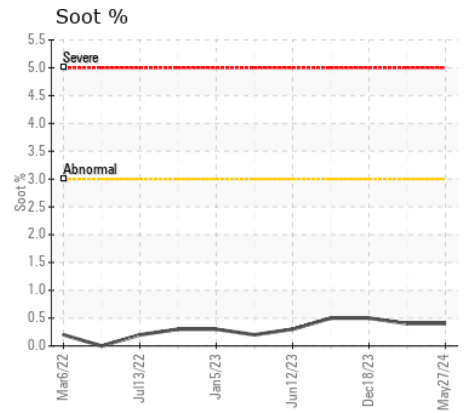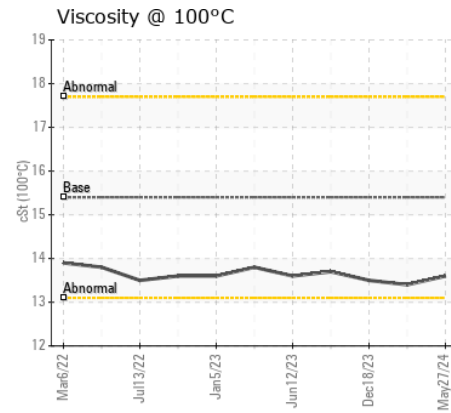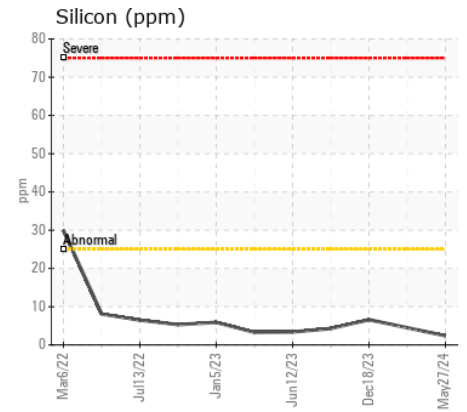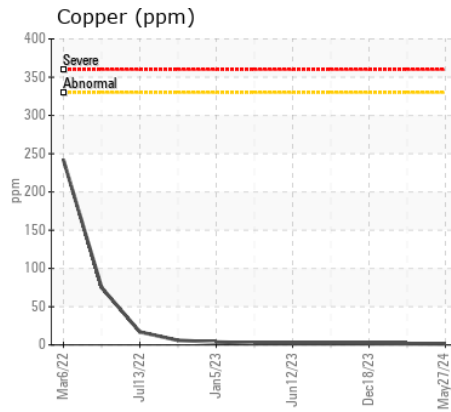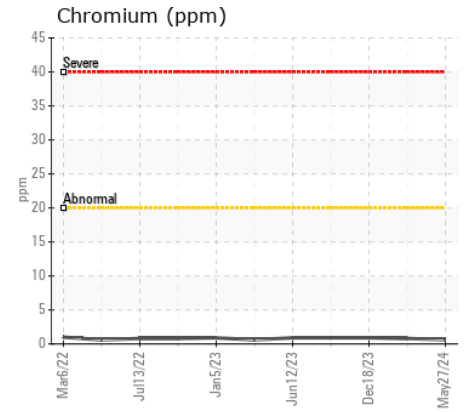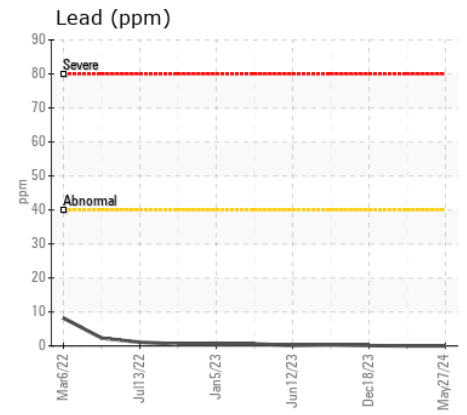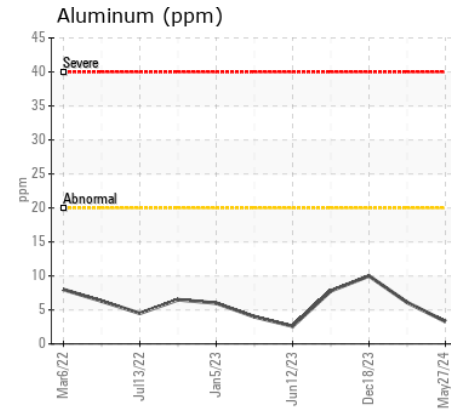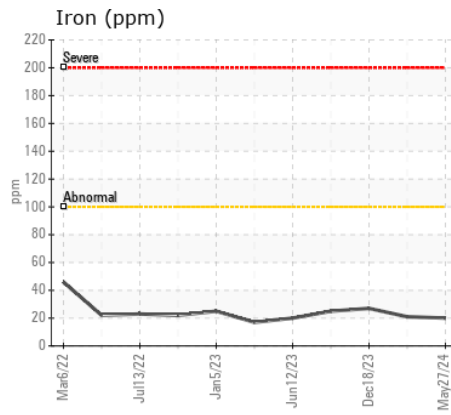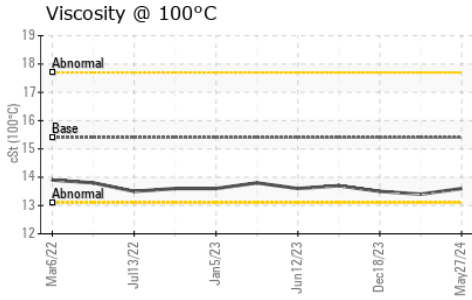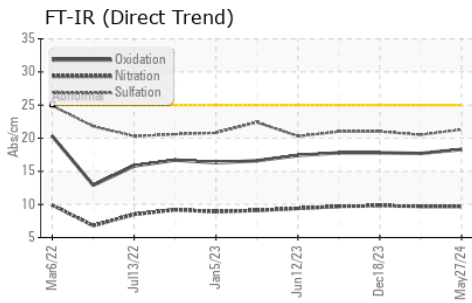

ISO 17025:2017  
Accredited  
Laboratory

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : GFL0093978  
**Lab Number** : 02638788  
**Unique Number** : 5787950  
**Test Package** : MOB 1 ( Additional Tests: Visual )

**GFL Environmental - 777 - Belleville-Municipal waste**  
 197 Putman Industrial Road  
 Belleville, ON  
 CA K8N 4Z6  
 Contact: Ian Patton  
 ipatton@gflenv.com  
 T: (905)831-6297  
 F: (905)426-3577

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.