

**OIL ANALYSIS REPORT** 

WEAR CONTAMINATION FLUID CONDITION

NORMAL NORMAL

۸۲۵۵


## **HANDFIELD AVIATION [53326]**


## **DEHAVILLAND DHC-3T P-37139C (S/N 404)**


Jet Turbine


EASTMAN TURBO OIL 2380 (--- GAL)


RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
This is a baseline read-out on the submitted sample.	Sample Number		Client Info		GT57864	GT56732	GT56734
	Sample Date		Client Info		22 May 2024	09 Nov 2023	14 Sep 2023
	Machine Age	hrs	Client Info		0	0	0
	Oil Age	hrs	Client Info		726	562	509
	Filter Age	hrs	Client Info		73	54	116
	Oil Changed		Client Info		N/A	N/A	N/A
	Filter Changed		Client Info		N/A	N/A	N/A
	Sample Status				NORMAL	NORMAL	
WEAR	Iron	ppm	ASTM D5185(m)	>8	<1	<1	0
	Chromium	ppm	ASTM D5185(m)	>2	0	0	0
	Nickel	ppm	ASTM D5185(m)	>2	0	0	0
	Silver	ppm	ASTM D5185(m)	>2	0	0	0
	Aluminum	ppm	ASTM D5185(m)	>2	<1	<1	<1
	Lead	ppm	ASTM D5185(m)	>3	<1	<1	0
	Copper	ppm	ASTM D5185(m)	>3	<1	<1	<1
CONTAMINATION	Water		WC Method	>0.1	NEG	NEG	NEG
FLUID CONDITION	Magnesium	ppm	ASTM D5185(m)	0	<1	<1	<1
	Acid Number (AN)	mg KOH/g	ASTM D974*	0.43	0.82	0.79	0.89
	Visc @ 40°C	cSt	ASTM D7279(m)	24.2	24.4		

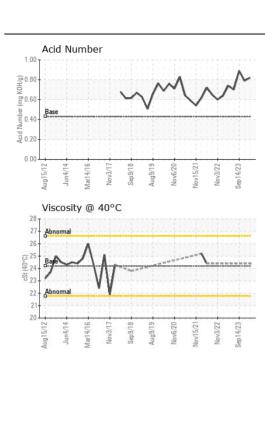

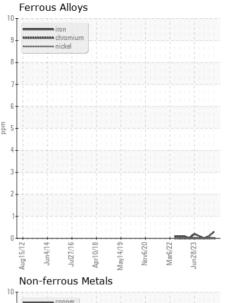

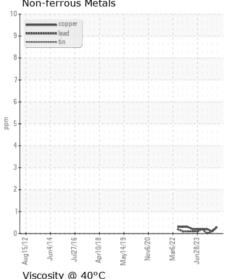

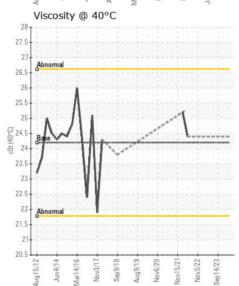

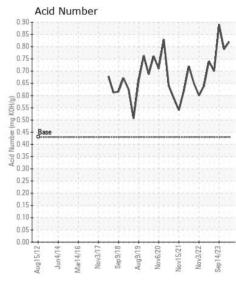



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number : 02639302

: GT57864

Tested Unique Number : 5788464 Diagnosed

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Received : 31 May 2024

: 31 May 2024 : 31 May 2024 - Wes Davis

**Honeywell Engines** 111 S. 34th Street, 301 Receiving, Attn: SOAP Program PHOENIX, AZ

US 85034 Contact: GARRETT

Test Package : G331 ( Additional Tests: ICP ) To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

T: F: (602)365-2676