



WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>

Machine Id  
**351126**  
 Component  
**Diesel Engine**  
 Fluid  
**SAE 10W30 (--- GAL)**

**RECOMMENDATION**

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>GFL0107904</b>	---	---
Sample Date		Client Info		<b>23 Apr 2024</b>	---	---
Machine Age	kms	Client Info		<b>0</b>	---	---
Oil Age	kms	Client Info		<b>0</b>	---	---
Filter Age	kms	Client Info		<b>0</b>	---	---
Oil Changed		Client Info		<b>Changed</b>	---	---
Filter Changed		Client Info		<b>Changed</b>	---	---
Sample Status				<b>NORMAL</b>	---	---

**WEAR**

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>100	<b>17</b>	---	---
Chromium	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	---	---
Nickel	ppm	ASTM D5185(m)	>2	<b>0</b>	---	---
Titanium	ppm	ASTM D5185(m)	>2	<b>0</b>	---	---
Silver	ppm	ASTM D5185(m)	>2	<b>0</b>	---	---
Aluminum	ppm	ASTM D5185(m)	>25	<b>2</b>	---	---
Lead	ppm	ASTM D5185(m)	>40	<b>0</b>	---	---
Copper	ppm	ASTM D5185(m)	>330	<b>5</b>	---	---
Tin	ppm	ASTM D5185(m)	>15	<b>0</b>	---	---
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	---	---
White Metal	scalar	Visual*	NONE	<b>VLITE</b>	---	---
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	---	---

**CONTAMINATION**











There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>25	<b>3</b>	---	---
Potassium	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	---	---
Fuel		WC Method	>5	<b>&lt;1.0</b>	---	---
Water		WC Method	>0.2	<b>NEG</b>	---	---
Glycol		WC Method		<b>NEG</b>	---	---
Soot %	%	ASTM D7844*	>3	<b>0</b>	---	---
Nitration	Abs/cm	ASTM D7624*	>20	<b>12.1</b>	---	---
Sulfation	Abs/.1mm	ASTM D7415*	>30	<b>24.4</b>	---	---
Silt	scalar	Visual*	NONE	<b>NONE</b>	---	---
Debris	scalar	Visual*	NONE	<b>NONE</b>	---	---
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	---	---
Appearance	scalar	Visual*	NORML	<b>NORML</b>	---	---
Odor	scalar	Visual*	NORML	<b>NORML</b>	---	---
Emulsified Water	scalar	Visual*	>0.2	<b>NEG</b>	---	---

**FLUID CONDITION**

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)	>228	<b>3</b>	---	---
Boron	ppm	ASTM D5185(m)		<b>6</b>	---	---
Barium	ppm	ASTM D5185(m)		<b>0</b>	---	---
Molybdenum	ppm	ASTM D5185(m)		<b>59</b>	---	---
Manganese	ppm	ASTM D5185(m)		<b>&lt;1</b>	---	---
Magnesium	ppm	ASTM D5185(m)		<b>897</b>	---	---
Calcium	ppm	ASTM D5185(m)		<b>1013</b>	---	---
Phosphorus	ppm	ASTM D5185(m)		<b>828</b>	---	---
Zinc	ppm	ASTM D5185(m)		<b>1074</b>	---	---
Sulfur	ppm	ASTM D5185(m)		<b>2337</b>	---	---
Oxidation	Abs/.1mm	ASTM D7414*	>25	<b>20.3</b>	---	---
Visc @ 100°C	cSt	ASTM D7279(m)	11.0	<b>11.6</b>	---	---

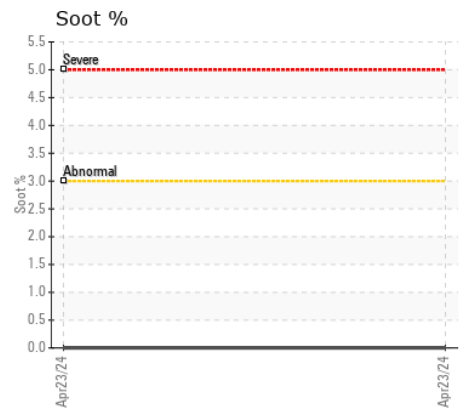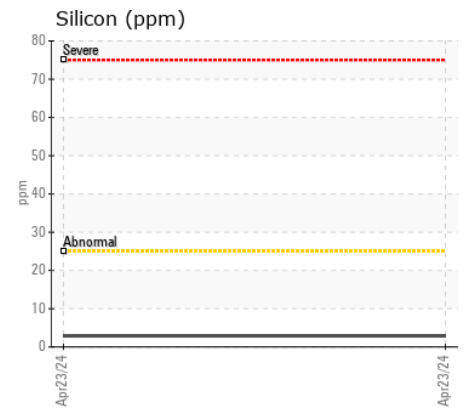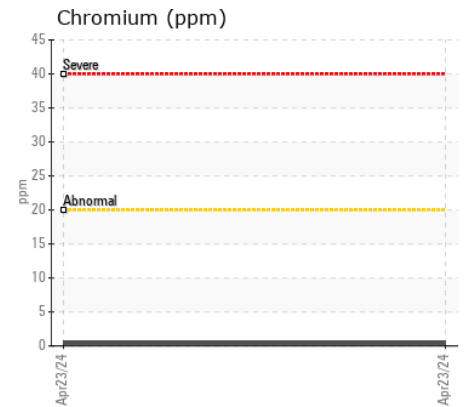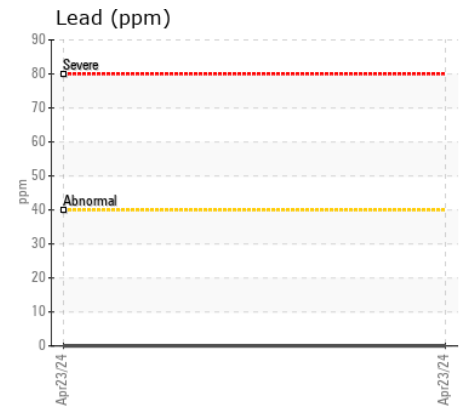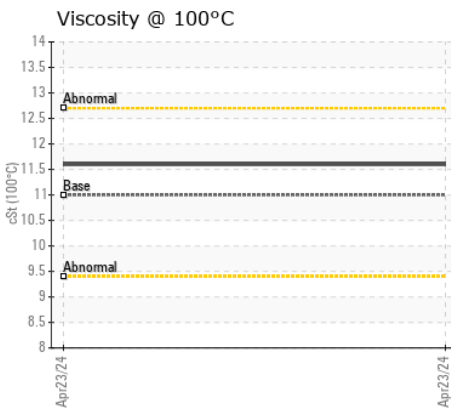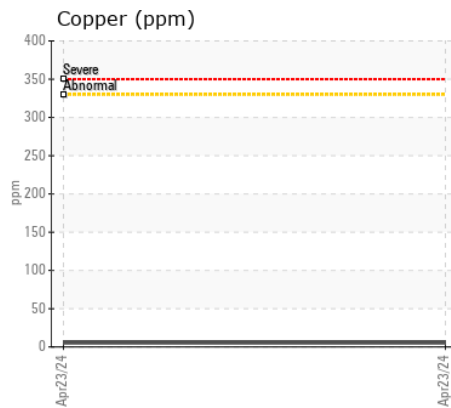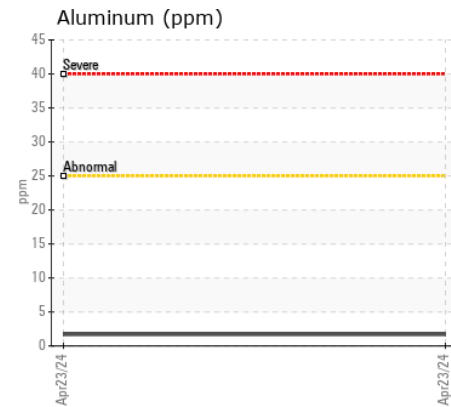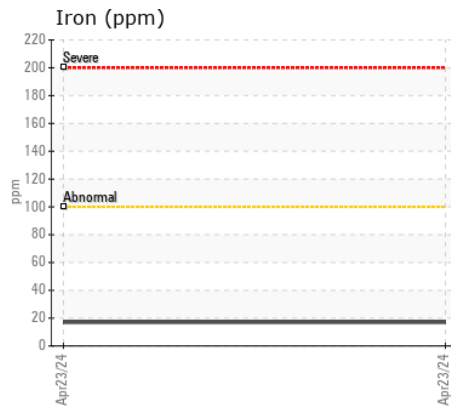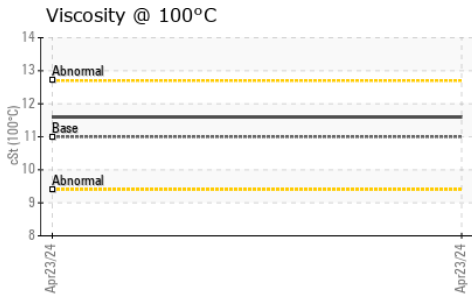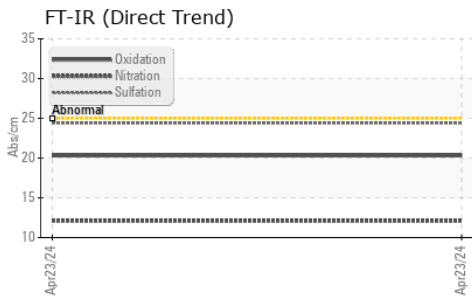

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : GFL0107904 **Received** : 04 Jun 2024  
**Lab Number** : 02639574 **Tested** : 05 Jun 2024  
**Unique Number** : 5788736 **Diagnosed** : 05 Jun 2024 - Wes Davis  
**Test Package** : MOB 1 ( Additional Tests: Visual )

**GFL Environmental - 310 - Winnipeg**  
 #360 – 555 Hervo Street,  
 Winnipeg, MB  
 CA R3T 3L6  
 Contact: Joshua Lourenco  
 jlourenco@gflenv.com  
 T: (204)987-9600  
 F:

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.