WEAR CONTAMINATION FLUID CONDITION

NORMAL NORMAL


[50505]

MOUNT PEARL CO2

Diesel Engine

SAE 15W40 (--- GAL)

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		CU0022620		
	Sample Date		Client Info		04 Jun 2024		
	Machine Age	hrs	Client Info		0		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		N/A		
	Filter Changed		Client Info		N/A		
	Sample Status				NORMAL		
VEAR	Iron	ppm	ASTM D5185(m)	>100	2		
	Chromium	ppm	ASTM D5185(m)		0		
All component wear rates are normal.	Nickel	ppm	ASTM D5185(m)		0		
	Titanium	ppm	ASTM D5185(m)	71	0		
	Silver	ppm	ASTM D5185(m)	>3	0		
	Aluminum	ppm	ASTM D5185(m)		<1		
	Lead	ppm	ASTM D5185(m)		0		
	Copper	ppm	ASTM D5185(m)		3		
	Tin	ppm	ASTM D5185(m)		0		
	Vanadium	ppm	ASTM D5185(m)		0		
CONTAMINATION	Silicon	ppm	ASTM D5185(m)	>25	4		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185(m)	>20	<1		
	Fuel		WC Method		<1.0		
	Water		WC Method	>0.2	NEG		
	Glycol		WC Method		NEG		
	Soot %	%	ASTM D7844*	>3	0		
	Nitration	Abs/cm	ASTM D7624*	>20	6.7		
	Sulfation	Abs/.1mm	ASTM D7415*	>30	19.9		
	Emulsified Water	scalar	Visual*	>0.2	NEG		
LUID CONDITION	Sodium	ppm	ASTM D5185(m)	>57	3		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185(m)		46		
	Barium	ppm	ASTM D5185(m)		0		
	Molybdenum	ppm	ASTM D5185(m)		45		
	Manganese	ppm	ASTM D5185(m)		0		
	Magnesium	ppm	ASTM D5185(m)		736		
	Calcium	ppm	ASTM D5185(m)		1244		
	Phosphorus	ppm	ASTM D5185(m)		758		
	Zinc	ppm	ASTM D5185(m)		846		
	Sulfur	ppm	ASTM D5185(m)		2027		
	Oxidation	Abs/.1mm	ASTM D7414*	>25	17.3		
	Visc @ 100°C	cSt	ASTM D7279(m)	14.5	13.4		

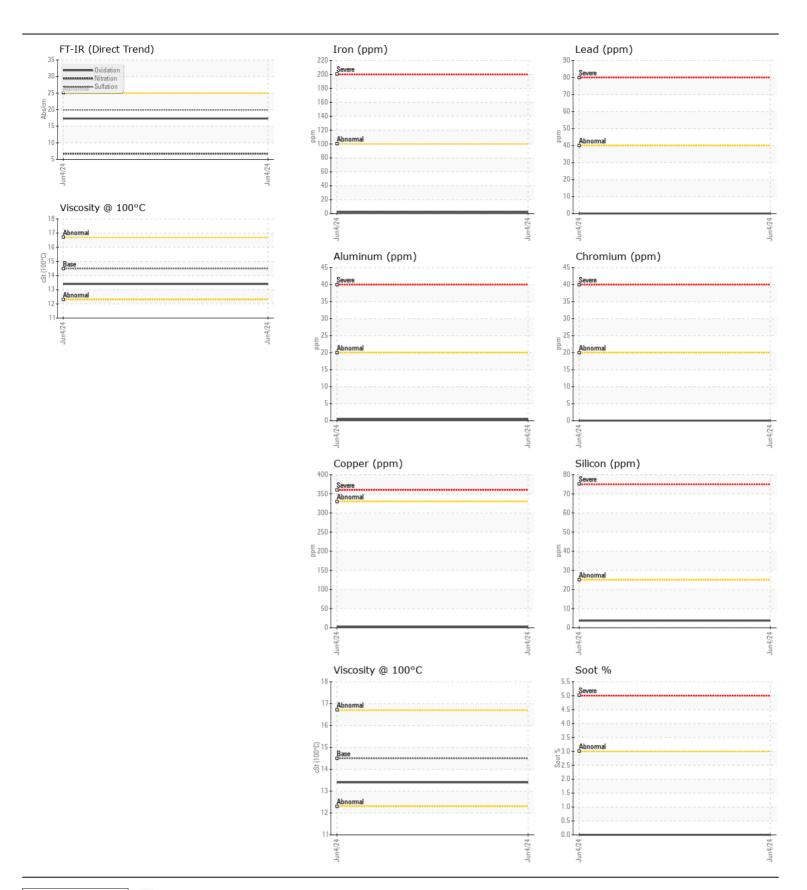



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number : 02639748

: CU0022620 Unique Number : 5788910 Test Package : MOB 1

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Received **Tested**

: 05 Jun 2024 : 05 Jun 2024 Diagnosed

: 05 Jun 2024 - Wes Davis

CUMMINS EASTERN CANADA INC. 122 CLYDE AVENUE MOUNT PEARL, NL CA A1N 4S3

Contact: DARRYL CAREY DARRYL.CAREY@CUMMINS.COM

T: (709)747-1135

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

Validity of results and interpretation are based on the sample and information as supplied. F: (709)747-1084 Contact/Location: DARRYL CAREY - CUMMOU