



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Machine Id
HL8146 Fore Deck Machinery - Aft Tank
 Component
Tank Hydraulic System
 Fluid
ESSO UNIVIS N 22 (850 LTR)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		WC0929746	WC0709114	WC0676980
Sample Date		Client Info		30 May 2024	20 Mar 2023	29 May 2022
Machine Age	yrs	Client Info		0	0	0
Oil Age	yrs	Client Info		0	0	0
Filter Age	yrs	Client Info		0	0	0
Oil Changed		Client Info		Not Changed	N/A	Not Changed
Filter Changed		Client Info		Changed	N/A	Changed
Sample Status				NORMAL	ABNORMAL	NORMAL

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>20	0	<1	<1
Chromium	ppm	ASTM D5185(m)	>10	0	0	0
Nickel	ppm	ASTM D5185(m)	>10	0	<1	<1
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)		0	0	<1
Aluminum	ppm	ASTM D5185(m)	>10	0	<1	0
Lead	ppm	ASTM D5185(m)	>20	0	2	2
Copper	ppm	ASTM D5185(m)	>20	2	8	6
Tin	ppm	ASTM D5185(m)	>10	0	<1	<1
Vanadium	ppm	ASTM D5185(m)		0	0	0
White Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE

CONTAMINATION










The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

Silicon	ppm	ASTM D5185(m)	>15	0	1	1
Potassium	ppm	ASTM D5185(m)	>20	0	0	<1
Water		WC Method	>0.05	NEG	NEG	NEG
Particles >4µm		ASTM D7647	>5000	4111	▲ 27634	4141
Particles >6µm		ASTM D7647	>1300	854	▲ 7806	788
Particles >14µm		ASTM D7647	>160	87	▲ 497	33
Particles >21µm		ASTM D7647	>40	17	▲ 116	6
Particles >38µm		ASTM D7647	>10	2	6	0
Particles >71µm		ASTM D7647	>3	1	1	0
Oil Cleanliness		ISO 4406 (c)	>19/17/14	19/17/14	▲ 22/20/16	19/17/12
Silt	scalar	Visual*	NONE	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	VLITE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.05	NEG	NEG	NEG

FLUID CONDITION

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185(m)		<1	2	1
Boron	ppm	ASTM D5185(m)	.3	0	0	<1
Barium	ppm	ASTM D5185(m)		0	0	<1
Molybdenum	ppm	ASTM D5185(m)	0	0	0	0
Manganese	ppm	ASTM D5185(m)		0	0	0
Magnesium	ppm	ASTM D5185(m)	0	<1	<1	<1
Calcium	ppm	ASTM D5185(m)	49	49	34	34
Phosphorus	ppm	ASTM D5185(m)	192	347	386	368
Zinc	ppm	ASTM D5185(m)	237	419	401	407
Sulfur	ppm	ASTM D5185(m)		888	1469	1356
Acid Number (AN)	mg KOH/g	ASTM D974*		0.38	0.40	0.36
Visc @ 40°C	cSt	ASTM D7279(m)	22	21.8	21.6	21.6

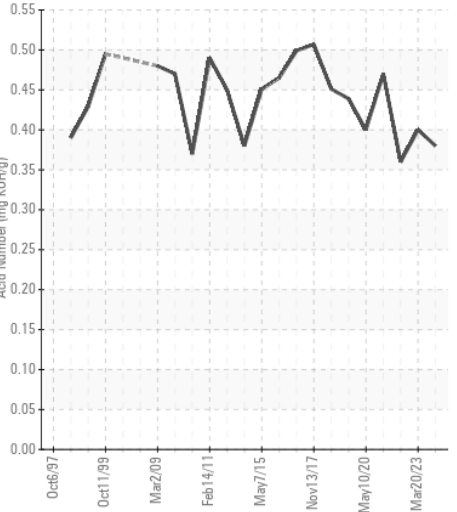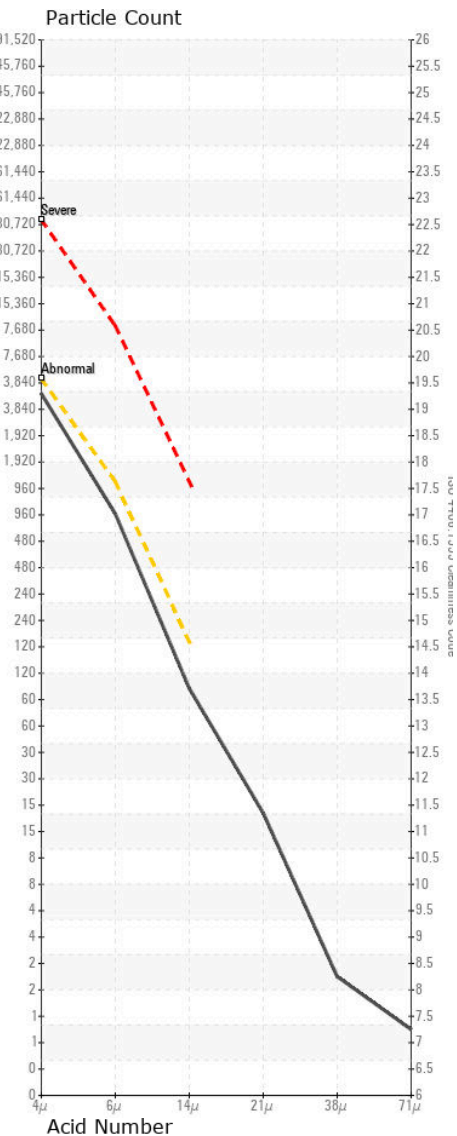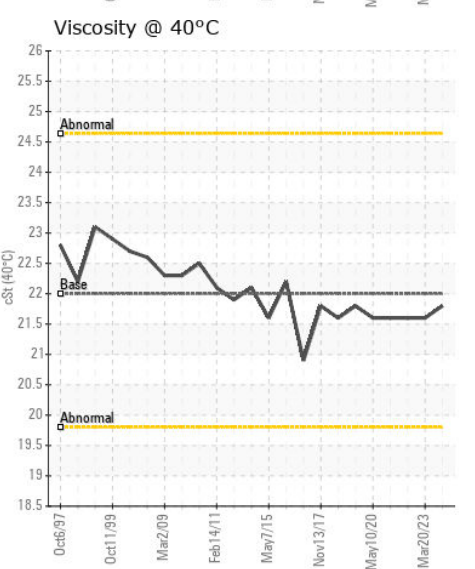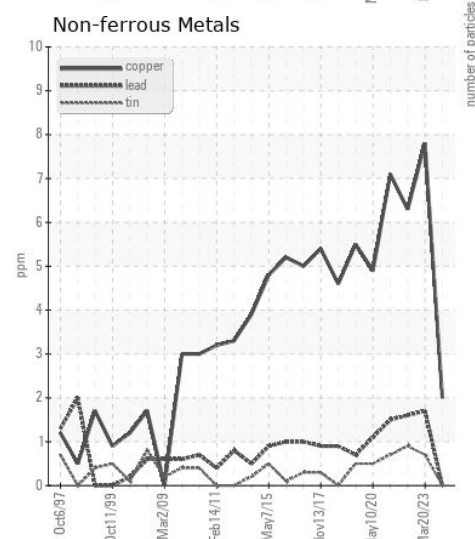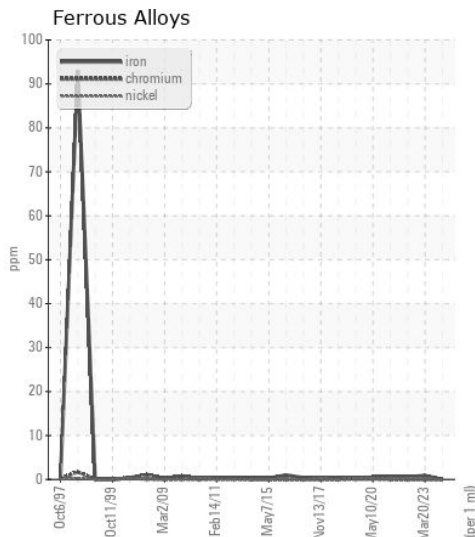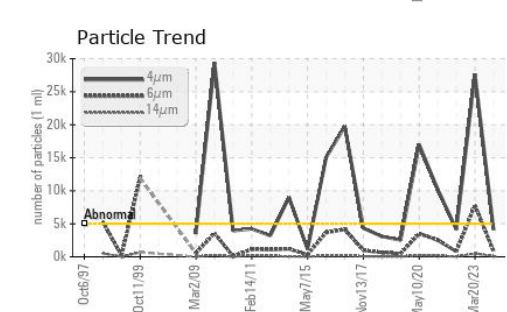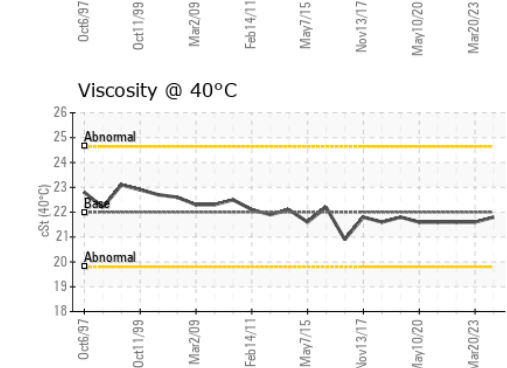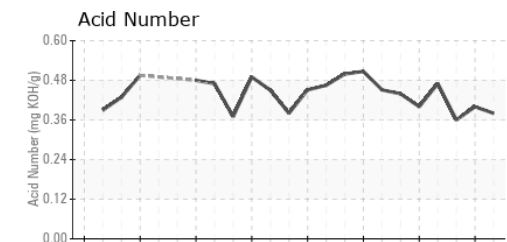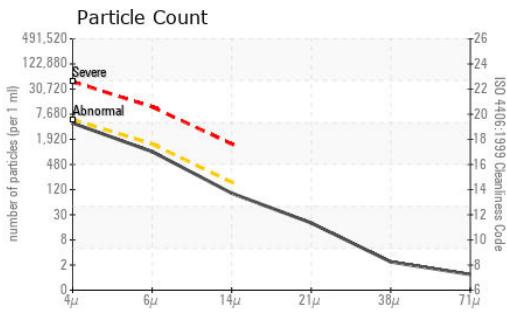

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0929746
Lab Number : 02639884
Unique Number : 5789046
Test Package : MAR 2
Received : 05 Jun 2024
Tested : 06 Jun 2024
Diagnosed : 06 Jun 2024 - Wes Davis

CANADIAN COAST GUARD
 CCGS HENRY LARSEN, P.O. BOX 5667, 280 SOUTHSIDE RD.
 ST. JOHN'S, NL
 CA A1C 5X1
 Contact: Chief Engineer
 henrylarsence@ccgs-ngcc.gc.ca
 T: (709)687-5198
 F: (709)685-3187

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.