

OIL ANALYSIS REPORT

WEAR CONTAMINATION FLUID CONDITION

NORMAL NORMAL


Aroo


(CFYAG) PERIMITER AVIATION [53361] [CFYAG] FAIRCHILD METRO 3 SA 227 P-44292 (S/N AC-782B)


2 Jet Turbine


EASTMAN TURBO OIL 2380 (--- GAL)


RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
This is a baseline read-out on the submitted sample.	Sample Number		Client Info		GT56344	GT57538	GT57522
	Sample Date		Client Info		04 Jun 2024	19 Apr 2024	22 Mar 2024
	Machine Age	hrs	Client Info		0	0	0
	Oil Age	hrs	Client Info		824	730	638
	Filter Age	hrs	Client Info		94	92	86
	Oil Changed		Client Info		N/A	N/A	N/A
	Filter Changed		Client Info		N/A	N/A	N/A
	Sample Status				NORMAL	NORMAL	
WEAR	Iron	ppm	ASTM D5185(m)	>8	<1	<1	<1
	Chromium	ppm	ASTM D5185(m)	>2	0	0	0
	Nickel	ppm	ASTM D5185(m)	>2	0	0	0
	Silver	ppm	ASTM D5185(m)	>2	0	0	0
	Aluminum	ppm	ASTM D5185(m)	>2	<1	<1	<1
	Lead	ppm	ASTM D5185(m)	>3	0	<1	<1
	Copper	ppm	ASTM D5185(m)	>3	<1	<1	<1
CONTAMINATION	Water		WC Method	>0.1	NEG	NEG	NEG
FLUID CONDITION	Magnesium	ppm	ASTM D5185(m)	0	0	0	0
	Acid Number (AN)	mg KOH/g	ASTM D974*	0.43	1.05	0.98	0.98
	Visc @ 40°C	cSt	ASTM D7279(m)	24.2	24.5	24.9	

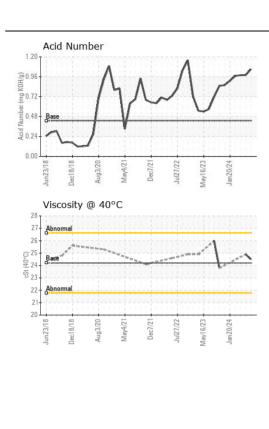

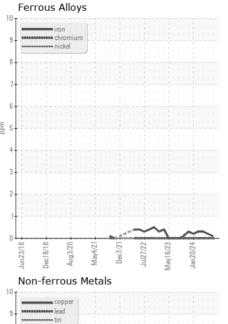

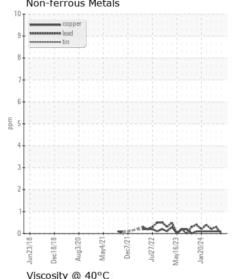

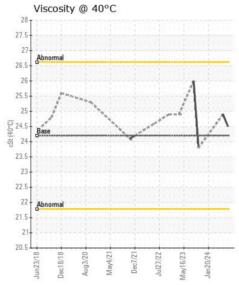

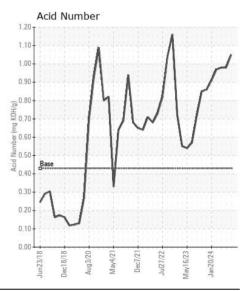



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No.

: GT56344 Lab Number : 02640971

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9

Received Tested Diagnosed Unique Number : 5798510 Test Package: G331 (Additional Tests: ICP)

: 10 Jun 2024 : 10 Jun 2024

: 10 Jun 2024 - Wes Davis

Honeywell Engines 111 S. 34th Street, 301 Receiving, Attn: SOAP Program

PHOENIX, AZ US 85034 Contact: GARRETT

To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

T: F: (602)365-2676